

**OIL ANALYSIS REPORT** 

**WEAR CONTAMINATION FLUID CONDITION** 


NORMAL **NORMAL NORMAL** 

**SKYCARE AIR AMBULANCE [52981]** FAIRCHILD SA227AC 44306C (S/N AC-594)

Component Left Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)

ENDATION	<del>-</del> .						
	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		GT57554	GT57542	GT57256
	Sample Date		Client Info		14 Feb 2024	02 Feb 2024	05 Jan 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		734	679	601
	Filter Age	hrs	Client Info		55	78	81
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status					NORMAL	
	Iron	ppm	ASTM D5185(m)	>8	0	0	0
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	0	0	0
	Copper	ppm	ASTM D5185(m)	>3	0	0	0
	Water		WC Method	>0.1	NEG	NEG	NEG
	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	1.09	1.03	1.02
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2		24.4	

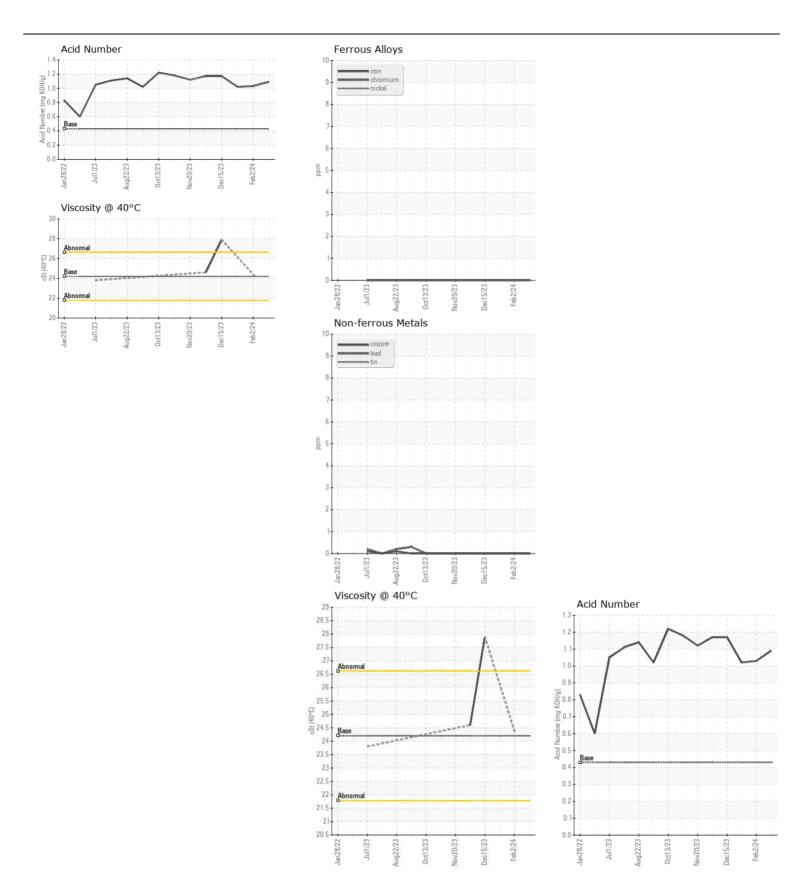





Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Lab Number : 02616824

: GT57554

Tested Unique Number : 5733934 Diagnosed Test Package : G331 ( Additional Tests: ICP )

Received : 20 Feb 2024

111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ US 85034 Contact: GARRETT

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676

**Honeywell Engines**