

OIL ANALYSIS REPORT

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL

Area


MIANKI AIRCRAFT REPAIR SERVICE [52985]


DEHAVILLAND DHC3T P-37103C (S/N 287)


Jet Turbine

BP TURBO OIL 2380 (--- GAL)

·/							
DATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		GT56906	GT56908	GT56911
	Sample Date		Client Info		07 Jan 2024	25 Aug 2023	24 Jul 2023
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		360	300	200
	Filter Age	hrs	Client Info		68	100	200
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status						ATTENTION
	Iron	ppm	ASTM D5185(m)	>8	<1	<1	<1
	Chromium	ppm	ASTM D5185(m)	>2	0	<1	<1
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	1	1	▲ <1
	Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Water		WC Method	>0.1	NEG	NEG	NEG
	Magnesium	ppm	ASTM D5185(m)	0	<1	<1	<1
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.77	1.28	1.05
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2			24.4

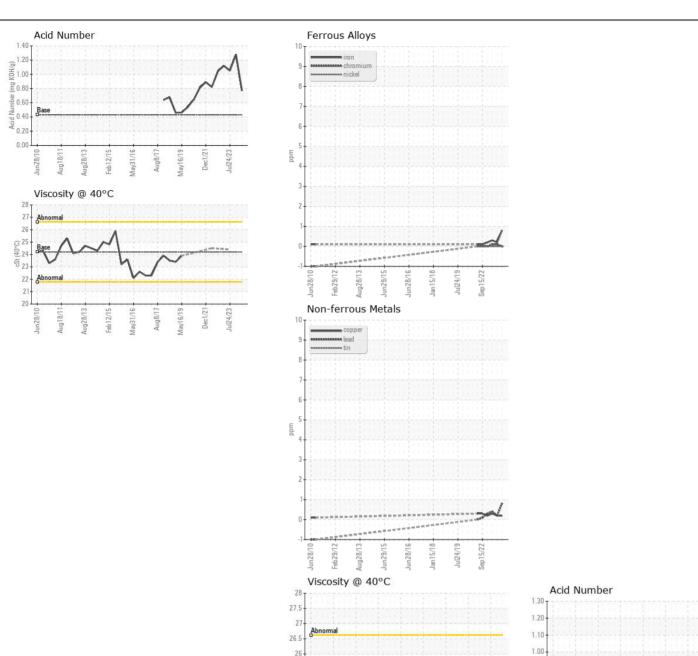

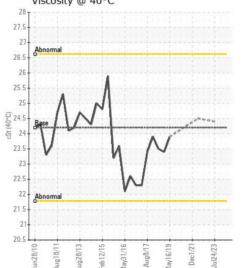

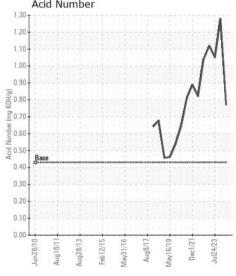



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: GT56906 Lab Number : 02617330

Unique Number : 5734440

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received : 21 Feb 2024

Diagnosed

Tested

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program

PHOENIX, AZ US 85034 Contact: GARRETT

Test Package : G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676