## Honeywell

**OIL ANALYSIS REPORT** 

## SKYCARE [53014] FAIRCHILD TC-264 P-54242

## Right Jet Turbine

RECOMMENDATION

Area


EASTMAN TURBO OIL 2380 (--- GAL)

	-		-	-	-	-	-	-	-
V	١	1		,	4		F	R	

CONTAMINATION
FLUID CONDITION

Test UON		Method	Limit/Abn	Current	History1	History2	
Sample Number		Client Info		GT57717	GT57369	GT57367	
Sample Date		Client Info		25 Feb 2024	07 Feb 2024	4 15 Jan 2024	
Machine Age	hrs	Client Info		0	0	0	
Oil Age	hrs	Client Info		369	297	228	
Filter Age	hrs	Client Info		72	69	64	
Oil Changed		Client Info		N/A	N/A	N/A	
Filter Changed		Client Info		N/A	N/A	N/A	
Sample Status					NORMAL		
Iron	ppm	ASTM D5185(m)	>8	0	0	0	
Chromium	ppm	ASTM D5185(m)	>2	0	0	0	
Nickel	ppm	ASTM D5185(m)	>2	0	0	0	
Silver	ppm	ASTM D5185(m)	>2	0	0	0	
Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1	
Lead	ppm	ASTM D5185(m)	>3	0	<1	0	
Copper	ppm	ASTM D5185(m)	>3	0	0	0	
Water		WC Method	>0.1	NEG	NEG	NEG	
Magnesium	ppm	ASTM D5185(m)	0	0	0	0	
Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.43	0.45	0.49	
Visc @ 40°C	cSt	ASTM D7279(m)	24.2	)	24.4		

## WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

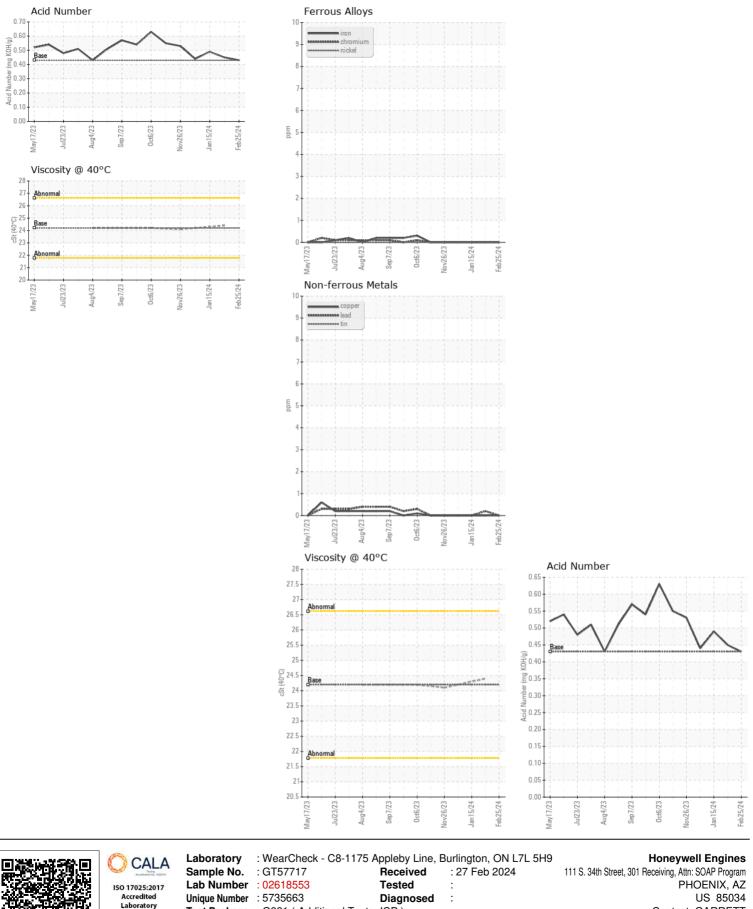

LaboratoryTest Package: G331 ( Additional Tests: ICP )To discuss this sample report, contact Customer Service at 1-800-268-2131.Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676

Contact: GARRETT