



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**701023**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON SHP 15W40 (22 LTR)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0111744</b>	WC0875107	GFL0094226
Sample Date		Client Info		<b>23 Feb 2024</b>	15 Dec 2023	05 Sep 2023
Machine Age	hrs	Client Info		<b>10766</b>	10766	9387
Oil Age	hrs	Client Info		<b>0</b>	559	0
Filter Age	hrs	Client Info		<b>0</b>	559	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>80	<b>9</b>	18	5
Chromium	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>3	<b>0</b>	<1	0
Aluminum	ppm	ASTM D5185(m)	>30	<b>2</b>	2	<1
Lead	ppm	ASTM D5185(m)	>30	<b>&lt;1</b>	<1	0
Copper	ppm	ASTM D5185(m)	>150	<b>&lt;1</b>	2	<1
Tin	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0

**CONTAMINATION**










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>20	<b>4</b>	8	4
Potassium	ppm	ASTM D5185(m)	>20	<b>1</b>	<1	<1
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>3	<b>0.1</b>	0.3	0
Nitration	Abs/cm	ASTM D7624*	>20	<b>7.3</b>	9.9	6.1
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>19.0</b>	20.4	19.2
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>5</b>	7	4
Boron	ppm	ASTM D5185(m)	0	<b>13</b>	2	8
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	<1	0
Molybdenum	ppm	ASTM D5185(m)	60	<b>58</b>	59	56
Manganese	ppm	ASTM D5185(m)	0	<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185(m)	1010	<b>929</b>	951	919
Calcium	ppm	ASTM D5185(m)	1070	<b>1040</b>	1065	1002
Phosphorus	ppm	ASTM D5185(m)	1150	<b>981</b>	948	1001
Zinc	ppm	ASTM D5185(m)	1270	<b>1162</b>	1189	1119
Sulfur	ppm	ASTM D5185(m)	2060	<b>2630</b>	2300	2492
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>14.9</b>	17.6	13.6
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>14.3</b>	13.5	13.8

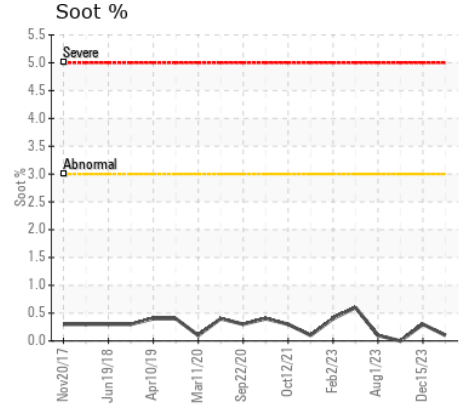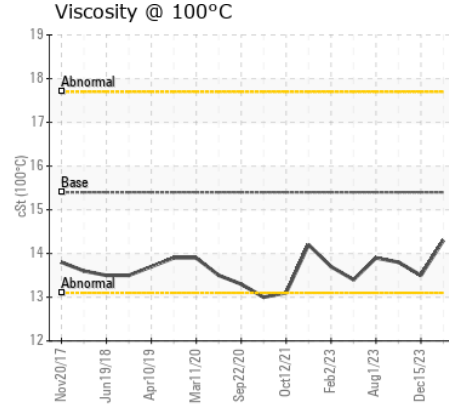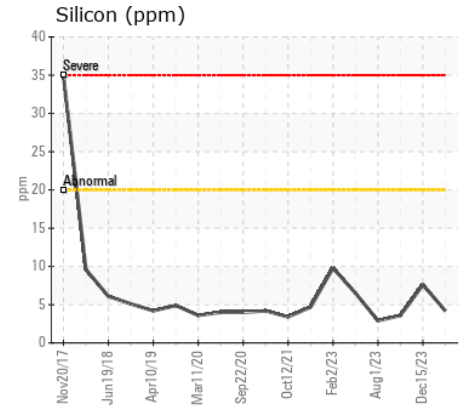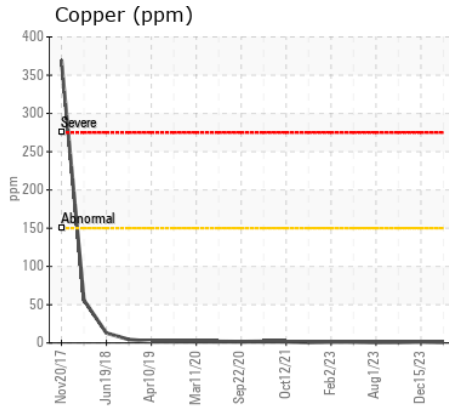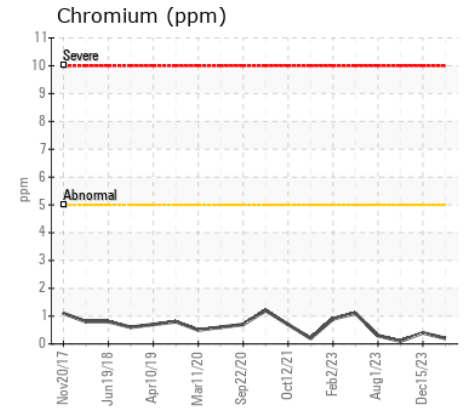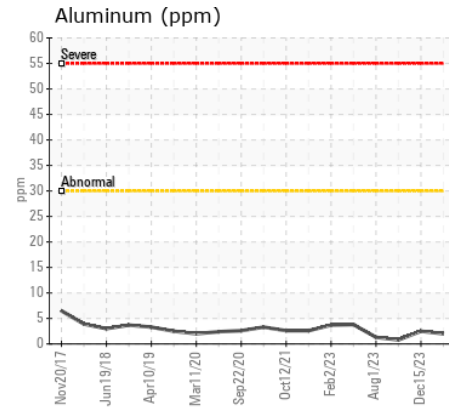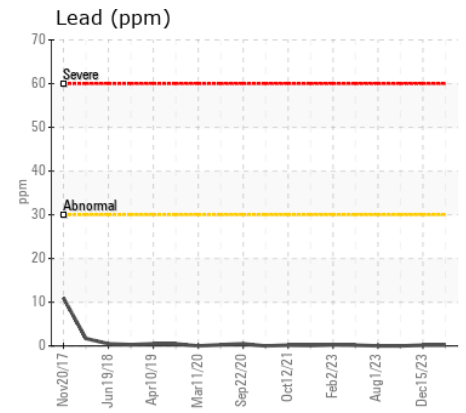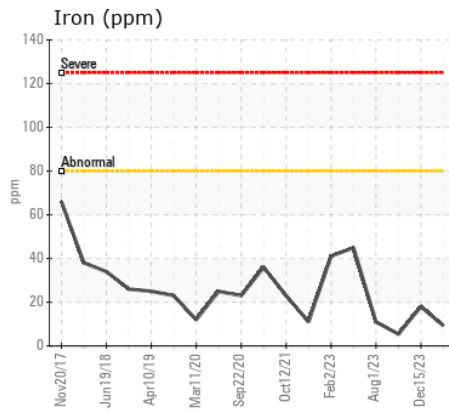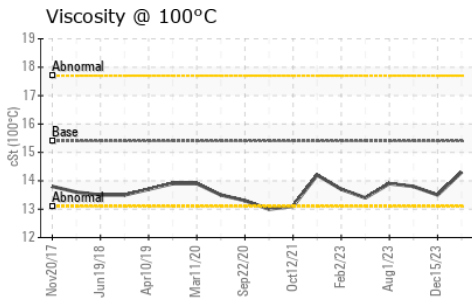

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0111744  
**Lab Number** : 02618587  
**Unique Number** : 5735697  
**Test Package** : MOB 1  
**Received** : 28 Feb 2024  
**Tested** : 28 Feb 2024  
**Diagnosed** : 28 Feb 2024 - Wes Davis

**GFL Environmental - 217 - Aurora**  
 14131 BAYVIEW AVE, AURORA YARD  
 AURORA, ON  
 CA L4G 0K6  
 Contact: Mike Havens  
 MHavens@gflenv.com  
 T:  
 F: (905)713-2445

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.