



Machine Id
W0404
Component
Hydraulic System
Fluid
SAE 10W (--- GAL)

RECOMMENDATION

Nous recommandons le remplacement des filtres de ce composant. Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0067511	---	---
Sample Date		Client Info		27 Feb 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				ATTENTION	---	---

WEAR

Les taux d'usure de tous les composants sont normaux.

PQ		ASTM D8184*		0	---	---
Iron	ppm	ASTM D5185(m)	>20	21	---	---
Chromium	ppm	ASTM D5185(m)	>10	0	---	---
Nickel	ppm	ASTM D5185(m)	>10	<1	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>10	2	---	---
Lead	ppm	ASTM D5185(m)	>10	<1	---	---
Copper	ppm	ASTM D5185(m)	>75	6	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION









Il y a une légère quantité de limon (particules de 4 à 14 microns) dans l'huile.

Silicon	ppm	ASTM D5185(m)	>20	3	---	---
Potassium	ppm	ASTM D5185(m)	>20	2	---	---
Water		WC Method	>0.1	NEG	---	---
Particles >4µm		ASTM D7647	>5000	5795	---	---
Particles >6µm		ASTM D7647	>1300	533	---	---
Particles >14µm		ASTM D7647	>160	59	---	---
Particles >21µm		ASTM D7647	>40	14	---	---
Particles >38µm		ASTM D7647	>10	1	---	---
Particles >71µm		ASTM D7647	>3	0	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	20/16/13	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---

FLUID CONDITION

L'état de l'huile est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)		<1	---	---
Boron	ppm	ASTM D5185(m)		<1	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		4	---	---
Calcium	ppm	ASTM D5185(m)		183	---	---
Phosphorus	ppm	ASTM D5185(m)		654	---	---
Zinc	ppm	ASTM D5185(m)		813	---	---
Sulfur	ppm	ASTM D5185(m)		1502	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	35.0	40.4	---	---

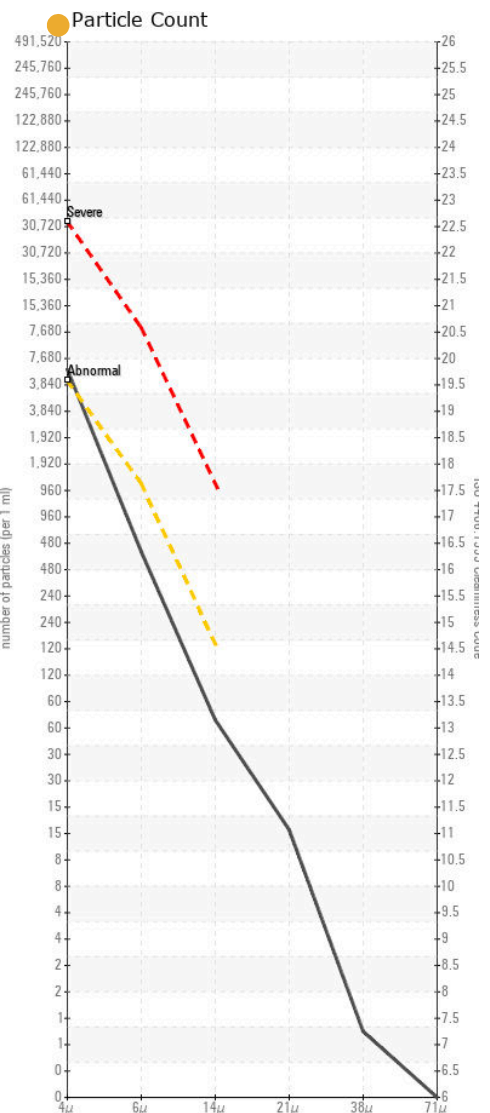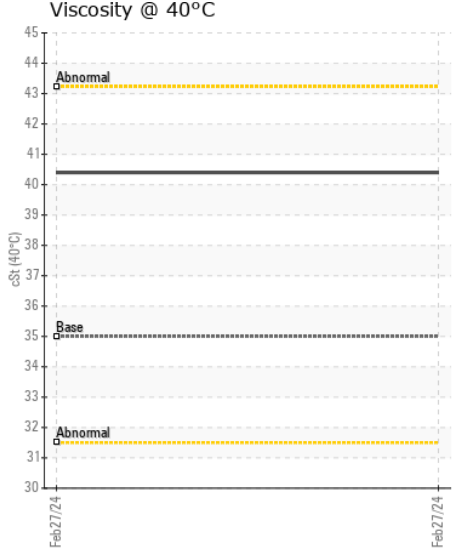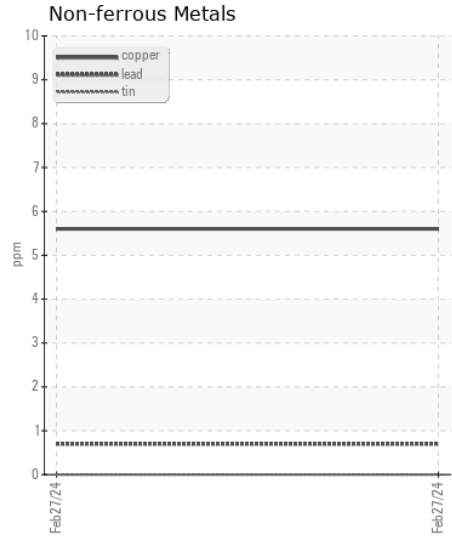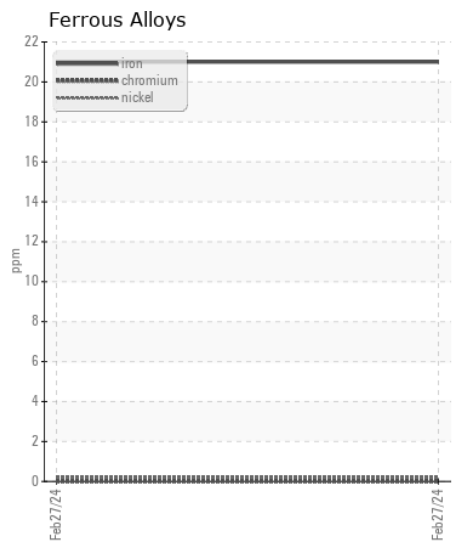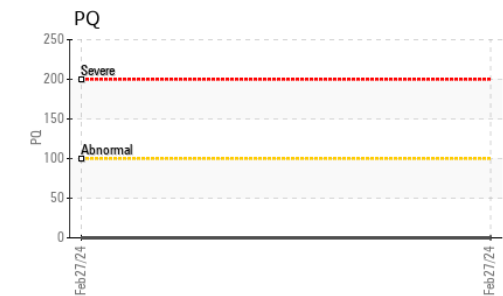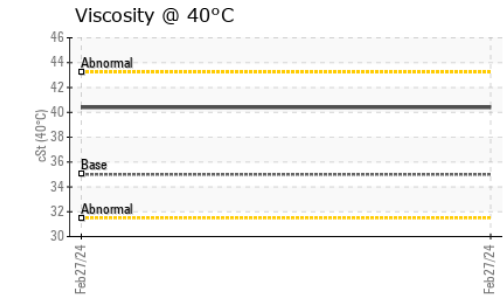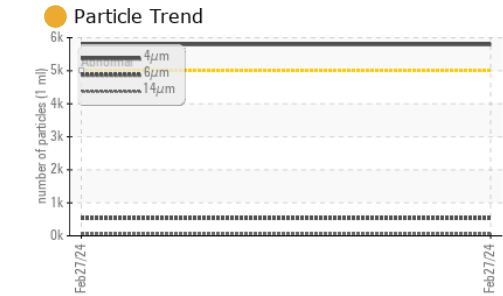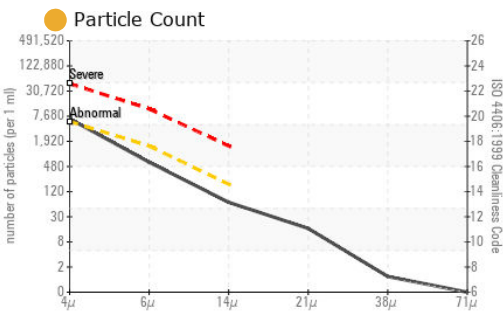

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0067511
Lab Number : 02618672
Unique Number : 5735782
Test Package : MOB 1 (Additional Tests: PQ, PrtCount)

Received : 28 Feb 2024
Tested : 29 Feb 2024
Diagnosed : 29 Feb 2024 - Kevin Marson
GFL Environmental - 743 - Montreal Est CD Processing
 10930 rue Sherbrooke
 Montreal, QC
 CA H1B 1B4

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Contact: Patrick Beaulieu
 patrick.beaulieu@gflenv.com
 T:
 F: