



WEAR	<b>ABNORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**801203**  
Component  
**Transmission (Auto)**  
Fluid  
**DEXRON III (--- GAL)**

**RECOMMENDATION**

Nous vous recommandons de vidanger le fluide de ce composant si vous ne l'avez pas déjà fait. Nous vous recommandons d'échantillonner de nouveau dès que possible afin de contrôler la situation. Le fluide n'était pas spécifié, toutefois, une comparaison avec d'autres fluides indiquent que ce fluide est du (GENERIC) DEXRON III. Veuillez confirmer.

**WEAR**

Il y a indication d'usure du convertisseur de couple.

**CONTAMINATION**

Il n'y a aucun indice de contamination dans le fluide.

**FLUID CONDITION**











Le fluide n'est plus en état de service en raison d'une usure anormale et/ou sévère.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0110452</b>	GFL0089681	GFL0068245
Sample Date		Client Info		<b>21 Feb 2024</b>	26 Sep 2023	14 Mar 2023
Machine Age	hrs	Client Info		<b>9271</b>	8644	8035
Oil Age	hrs	Client Info		<b>2164</b>	8644	2164
Filter Age	hrs	Client Info		<b>2164</b>	8644	2164
Oil Changed		Client Info		<b>N/A</b>	N/A	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>ABNORMAL</b>	ABNORMAL	NORMAL

Iron	ppm	ASTM D5185(m)	>160	<b>128</b>	138	103
Chromium	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Silver	ppm	ASTM D5185(m)	>5	<b>0</b>	<1	0
Aluminum	ppm	ASTM D5185(m)	>50	<b>▲ 52</b>	▲ 54	45
Lead	ppm	ASTM D5185(m)	>50	<b>6</b>	5	4
Copper	ppm	ASTM D5185(m)	>225	<b>43</b>	39	31
Tin	ppm	ASTM D5185(m)	>10	<b>6</b>	6	5
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

Silicon	ppm	ASTM D5185(m)	>20	<b>11</b>	▲ 26	10
Potassium	ppm	ASTM D5185(m)	>20	<b>5</b>	7	4
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	VLITE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	VLITE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	NEG	NEG

Sodium	ppm	ASTM D5185(m)		<b>21</b>	28	20
Boron	ppm	ASTM D5185(m)		<b>67</b>	65	72
Barium	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	1
Magnesium	ppm	ASTM D5185(m)		<b>&lt;1</b>	4	<1
Calcium	ppm	ASTM D5185(m)		<b>84</b>	86	82
Phosphorus	ppm	ASTM D5185(m)		<b>239</b>	231	257
Zinc	ppm	ASTM D5185(m)		<b>6</b>	29	5
Sulfur	ppm	ASTM D5185(m)		<b>1088</b>	899	905
Visc @ 40°C	cSt	ASTM D7279(m)	26.0	<b>34.4</b>	34.6	34.6

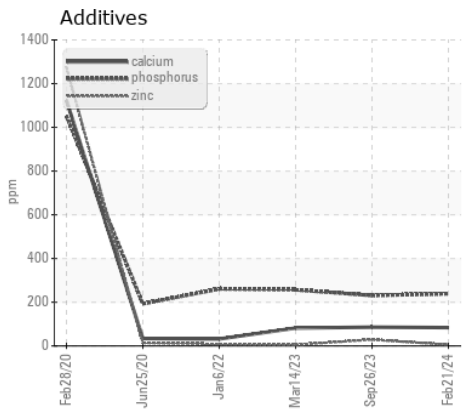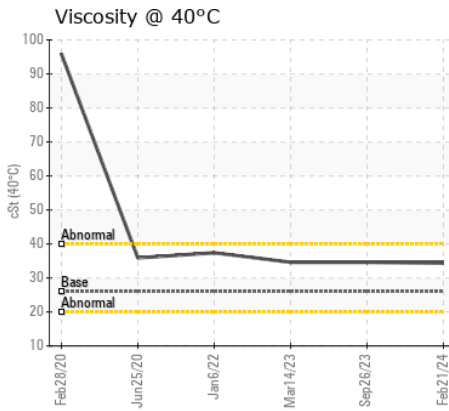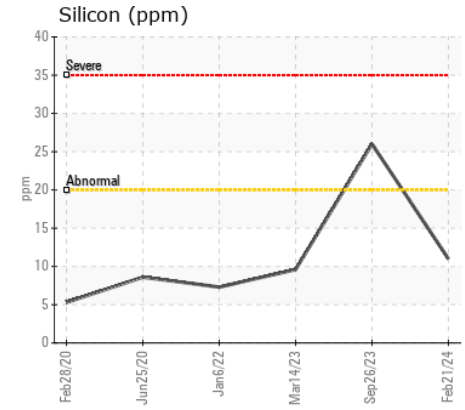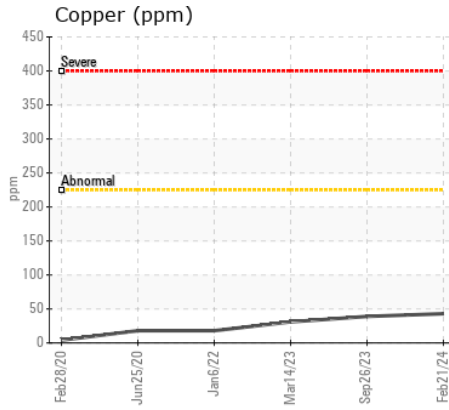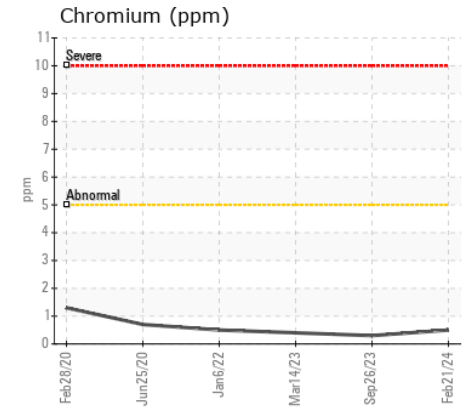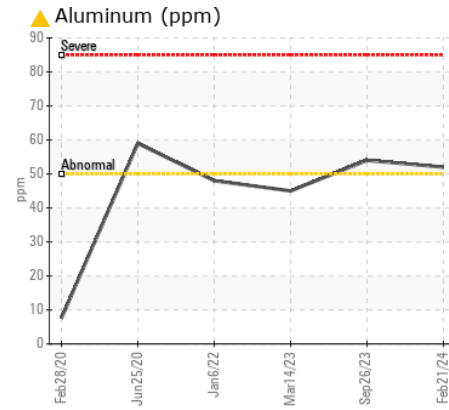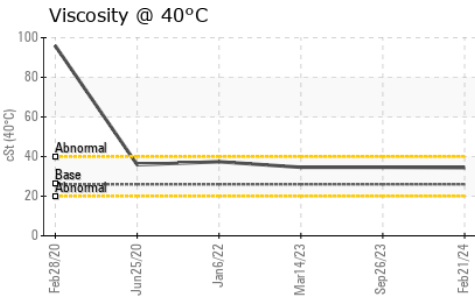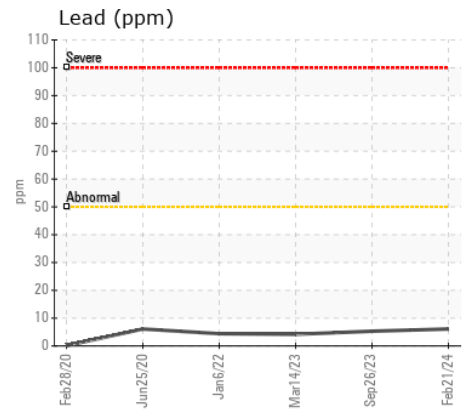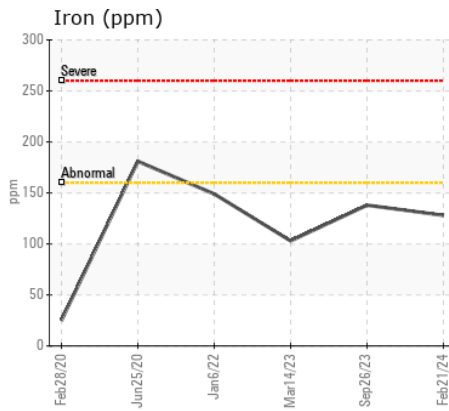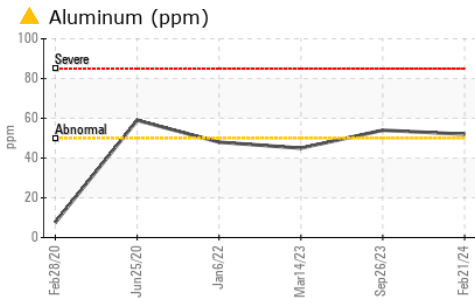

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0110452  
**Lab Number** : 02618993  
**Unique Number** : 5736103  
**Test Package** : MOB 1  
**Received** : 29 Feb 2024  
**Tested** : 01 Mar 2024  
**Diagnosed** : 01 Mar 2024 - Kevin Marson

**GFL Environmental - 732 - Beauce - Hauling - Solid Waste**  
 139, 181 Street,  
 Beauceville, QC  
 CA G5X 2S9  
 Contact: Sandrine Duval  
 sduval@matrec.ca  
 T: (418)774-5275  
 F: (418)774-5292

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.