WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL



LIEBHERR LH60 096587

Component Rear Left Wheel Hub

PETRO CANADA TRAXON 7	5W90 SYNTH	ETIC	(GAL)	.,		
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		LH0284791		
	Sample Date		Client Info		24 Feb 2024		
	Machine Age	hrs	Client Info		11676		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185(m)	>650	48		
All component wear rates are normal.	Chromium	ppm	ASTM D5185(m)	>4	<1		
	Nickel	ppm	ASTM D5185(m)	>4	<1		
	Titanium	ppm	ASTM D5185(m)	>4	0		
	Silver	ppm	ASTM D5185(m)		0		
	Aluminum	ppm	ASTM D5185(m)	>25	<1		
	Lead	ppm	ASTM D5185(m)	>4	0		
	Copper	ppm	ASTM D5185(m)	>60	6		
	Tin	ppm	ASTM D5185(m)	>4	0		
	Vanadium	ppm	ASTM D5185(m)		0		
	White Metal	scalar	Visual*	NONE	NONE		
	Yellow Metal	scalar	Visual*	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185(m)	>75	2		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)		<1		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	Visual*	NONE	NONE		
	Debris	scalar	Visual*	NONE	NONE		
	Sand/Dirt	scalar	Visual*	NONE	NONE		
	Appearance	scalar	Visual*	NORML	NORML		
	Odor	scalar	Visual*	NORML	NORML		
	Emulsified Water	scalar	Visual*	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185(m)		1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)	328	110		
	Barium	ppm	ASTM D5185(m)	1	1		
	Molybdenum	ppm	ASTM D5185(m)		0		
	Manganese	ppm	ASTM D5185(m)		<1		
	Magnesium	ppm	ASTM D5185(m)	1	1		
	Calcium	ppm	ASTM D5185(m)		8		
	Phosphorus	ppm	ASTM D5185(m)		1040		
	Zinc	ppm	ASTM D5185(m)		9		
	Sulfur	ppm	ASTM D5185(m)		22090		
	Visc @ 40°C	cSt	ASTM D7279(m)	99.6	105		

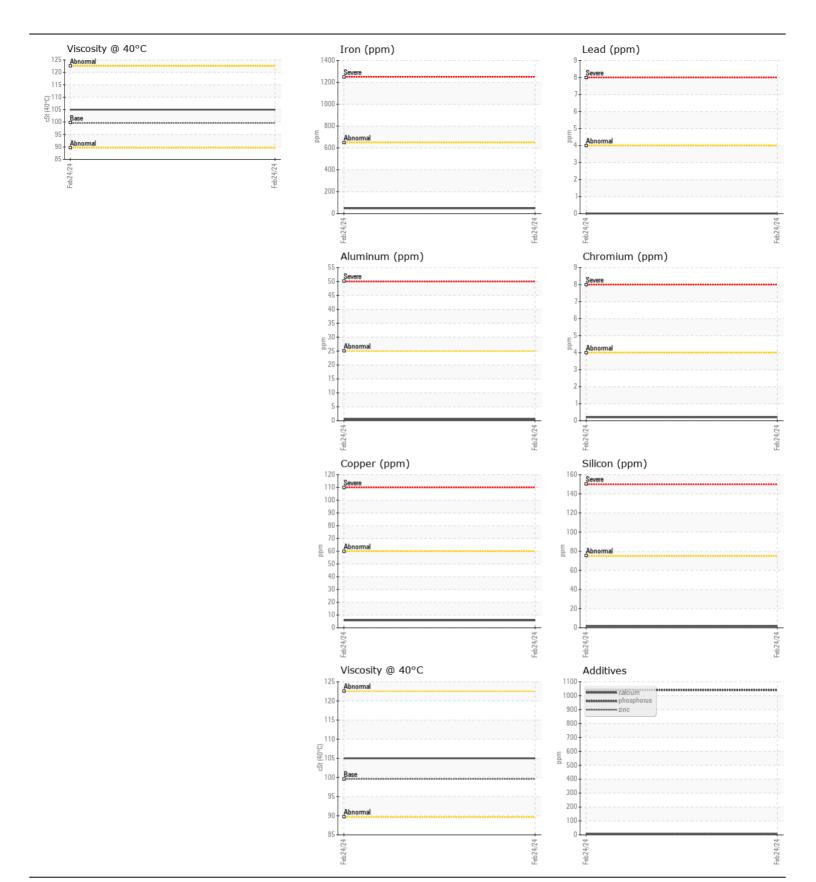



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: LH0284791 Lab Number : 02620014 Unique Number : 5737124 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received **Tested**

Diagnosed

: 05 Mar 2024

: 05 Mar 2024 - Wes Davis

: 05 Mar 2024

Contact: Service Manager

American Iron and Metal

131 Toombs St

Moncton, NB

CA E1A 3A5

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T:

F: