

**OIL ANALYSIS REPORT** 

**WEAR CONTAMINATION FLUID CONDITION** 


**NORMAL NORMAL** NORMAL

**SKYCARE AIR AMBULANCE [53037] FAIRCHILD SA227AC 44306C (S/N AC-594)** 

**Left Jet Turbine** 

EASTMAN TURBO OIL 2380 (--- GAL)

ECOMMEND ATION							
COMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		GT57561	GT57554	GT57542
	Sample Date		Client Info		01 Mar 2024	14 Feb 2024	02 Feb 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		809	734	679
	Filter Age	hrs	Client Info		0	55	78
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status						NORMAL
	Iron	ppm	ASTM D5185(m)	>8	0	0	0
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	0	0	0
	Copper	ppm	ASTM D5185(m)	>3	0	0	0
	Water		WC Method	>0.1	NEG	NEG	NEG
TION	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	1.05	1.09	1.03
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2			24.4

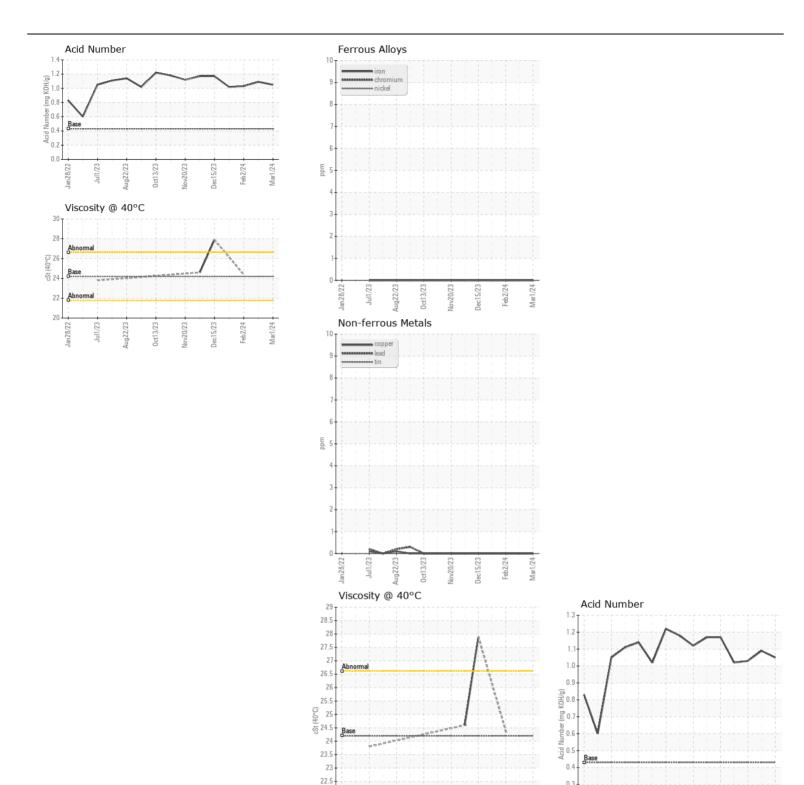





Laboratory Sample No.

: GT57561 Lab Number : 02620389 Unique Number : 5737499

21.5

21 20.5

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received : 06 Mar 2024 Tested

Diagnosed

Dec15/23

**Honeywell Engines** 111 S. 34th Street, 301 Receiving, Attn: SOAP Program

0.1

Mar1/24 -

PHOENIX, AZ US 85034 Contact: GARRETT

Test Package : G331 ( Additional Tests: ICP ) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (602)365-2676