



Machine Id
NO UNIT GFL0096669

Component
Hydraulic System

Fluid
{not provided} (--- GAL)

RECOMMENDATION

Vérifier les scelles et/ou les filters pour des points d'entrée des contaminants. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessiccant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Nous vous recommandons de vidanger l'huile de ce composant si vous ne l'avez pas déjà fait. Nous recommandons le remplacement des filters de ce composant. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation. Veuillez préciser la marque et le modèle du composant lors du prochain échantillon. Veuillez préciser la marque, le type et la viscosité de l'huile lors de votre prochain échantillon.

WEAR

Usure de segment.










CONTAMINATION

Il y a une grande quantité de limon (particules de 4 à 14 microns) dans l'huile.

FLUID CONDITION

La viscosité de l'échantillon se situe dans la portée de l'ISO 22; nous vous conseillons de vérifier. l'huile n'est plus en état de service en raison d'une usure anormale et/ou sévère.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0096669	---	---
Sample Date		Client Info		27 Mar 2024	---	---
Machine Age	kms	Client Info		119096	---	---
Oil Age	kms	Client Info		0	---	---
Filter Age	kms	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				SEVERE	---	---
PQ		ASTM D8184*		0	---	---
Iron	ppm	ASTM D5185(m)	>20	24	---	---
Chromium	ppm	ASTM D5185(m)	>10	▲ 12	---	---
Nickel	ppm	ASTM D5185(m)	>10	0	---	---
Titanium	ppm	ASTM D5185(m)		<1	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>10	2	---	---
Lead	ppm	ASTM D5185(m)	>10	▲ 10	---	---
Copper	ppm	ASTM D5185(m)	>75	1	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Silicon	ppm	ASTM D5185(m)	>20	7	---	---
Potassium	ppm	ASTM D5185(m)	>20	10	---	---
Water		WC Method	>0.1	NEG	---	---
Particles >4µm		ASTM D7647	>5000	▲ 44773	---	---
Particles >6µm		ASTM D7647	>1300	684	---	---
Particles >14µm		ASTM D7647	>160	11	---	---
Particles >21µm		ASTM D7647	>40	3	---	---
Particles >38µm		ASTM D7647	>10	1	---	---
Particles >71µm		ASTM D7647	>3	0	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 23/17/11	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Sodium	ppm	ASTM D5185(m)		12	---	---
Boron	ppm	ASTM D5185(m)		<1	---	---
Barium	ppm	ASTM D5185(m)		<1	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		56	---	---
Calcium	ppm	ASTM D5185(m)		97	---	---
Phosphorus	ppm	ASTM D5185(m)		322	---	---
Zinc	ppm	ASTM D5185(m)		380	---	---
Sulfur	ppm	ASTM D5185(m)		817	---	---
Visc @ 40°C	cSt	ASTM D7279(m)		22.5	---	---

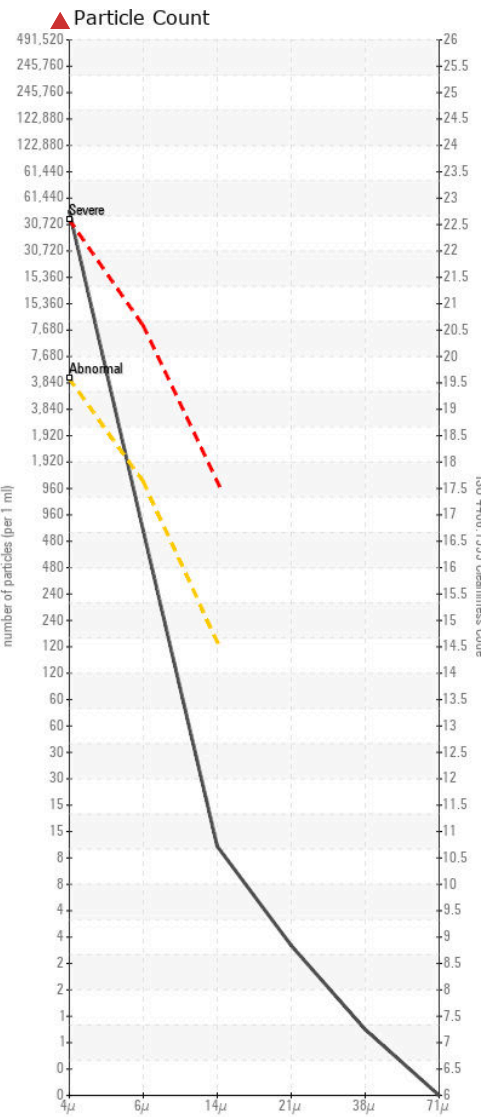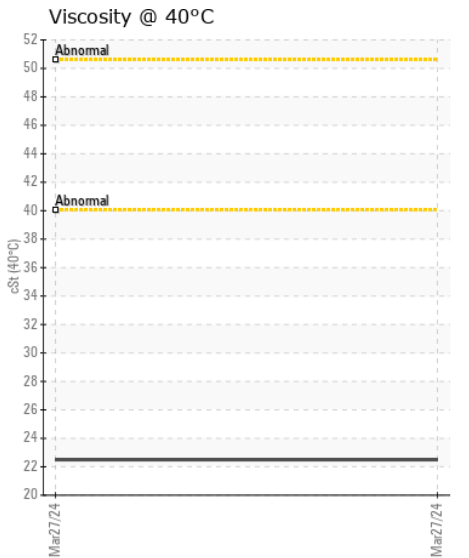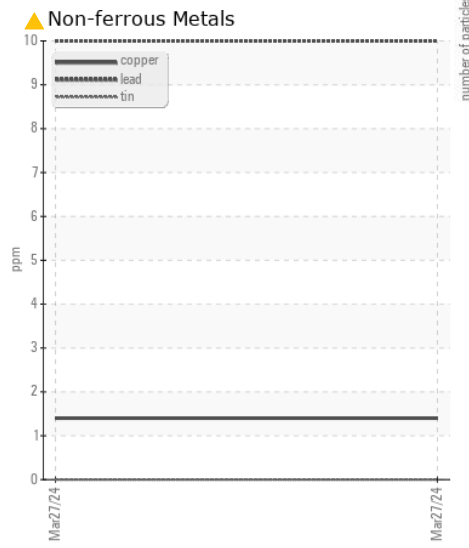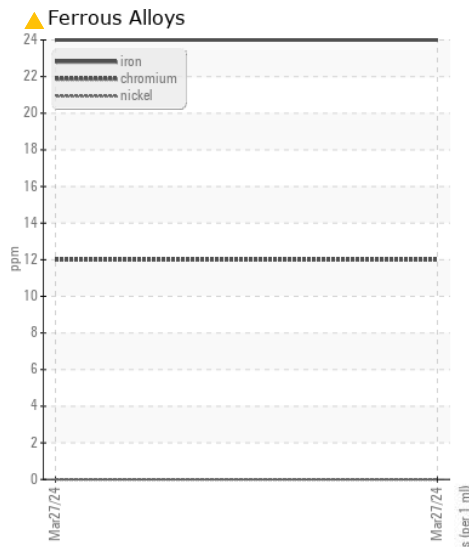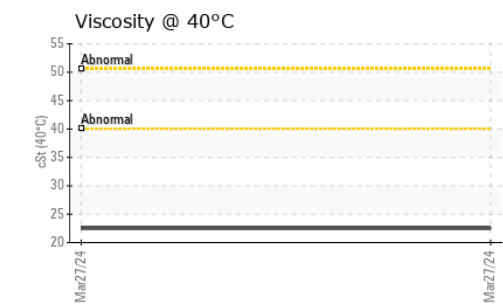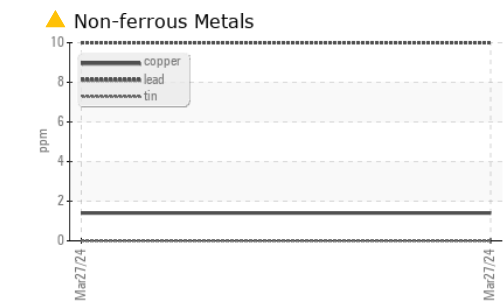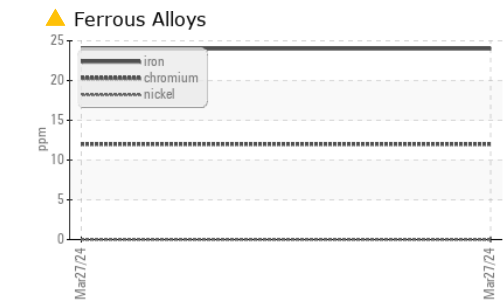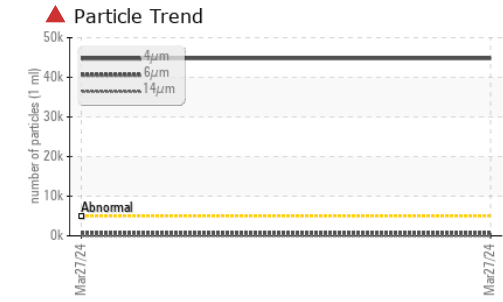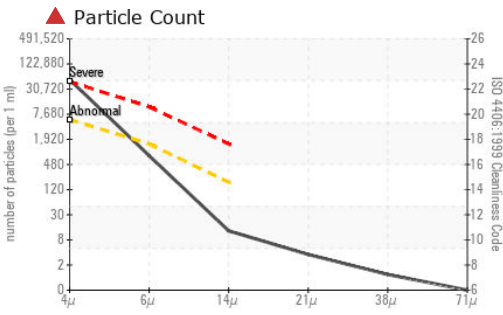

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0096669
Lab Number : 02625311
Unique Number : 5750430
Test Package : MOB 1 (Additional Tests: PQ, PrtCount)

GFL Environmental - 730 - Chicoutimi - Hauling
 3199 Boul. Talbot
 Chicoutimi, QC
 CA G7H 5B1
 Contact: Yan Houde
 yhoude@matrec.ca
 T: (418)549-8074
 F: (418)549-7973

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.