

OIL ANALYSIS REPORT

WEAR CONTAMINATION FLUID CONDITION

UNKNOWN UNKNOWN


Area


(CGBQC) OOKPIK AVIATION [53135]
[CGBQC] DEHAVILLAND DHC-3T P-123144 (S/N 401)


Jet Turbine


BP TURBO OIL 2380 (--- GAL)


MMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		GT56681	GT54226	GT47663
	Sample Date		Client Info		11 Mar 2024	14 Jul 2023	10 Apr 2023
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		400	200	100
	Filter Age	hrs	Client Info		100	200	100
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status					NORMAL	
	Iron	ppm	ASTM D5185(m)	>8	<1	<1	0
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	1
	Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Water		WC Method	>0.1	NEG	NEG	NEG
	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.59	0.60	0.54
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.3	24.6	24.0

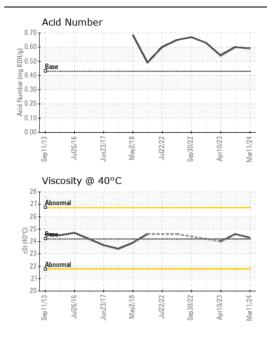

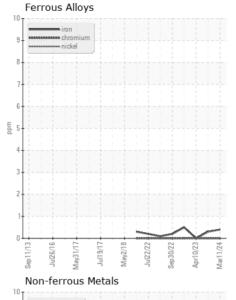

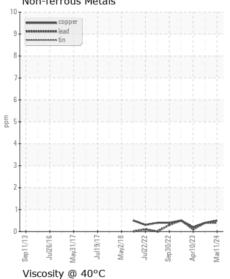

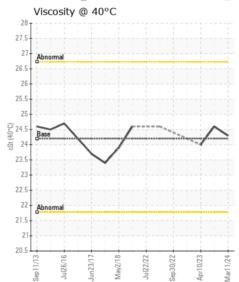

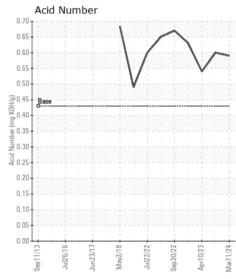



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT56681 Lab Number : 02626509

Received Tested Unique Number : 5759641

: 03 Apr 2024 Diagnosed

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ

US 85034 Contact: GARRETT

Test Package : G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676