



WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
901130
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 10W30 (--- GAL)

RECOMMENDATION

Confirmez la source du lubrifiant utilisé pour l'appoint/remplissage. Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0093672	---	---
Sample Date		Client Info		02 Apr 2024	---	---
Machine Age	hrs	Client Info		10852	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Changed	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				NORMAL	---	---

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>120	4	---	---
Chromium	ppm	ASTM D5185(m)	>20	0	---	---
Nickel	ppm	ASTM D5185(m)	>5	0	---	---
Titanium	ppm	ASTM D5185(m)	>2	0	---	---
Silver	ppm	ASTM D5185(m)	>2	0	---	---
Aluminum	ppm	ASTM D5185(m)	>20	2	---	---
Lead	ppm	ASTM D5185(m)	>40	0	---	---
Copper	ppm	ASTM D5185(m)	>330	3	---	---
Tin	ppm	ASTM D5185(m)	>15	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---

CONTAMINATION












Il n'y a aucun indice de contamination dans l'huile.

Silicon	ppm	ASTM D5185(m)	>25	5	---	---
Potassium	ppm	ASTM D5185(m)	>20	2	---	---
Fuel		WC Method	>3.0	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	ASTM D7844*	>4	0.1	---	---
Nitration	Abs/cm	ASTM D7624*	>20	7.7	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	18.2	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---

FLUID CONDITION

Les niveaux d'additifs indiquent l'ajout d'une autre marque ou d'un autre type d'huile. L'état de l'huile est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)		2	---	---
Boron	ppm	ASTM D5185(m)	2	57	---	---
Barium	ppm	ASTM D5185(m)	0	0	---	---
Molybdenum	ppm	ASTM D5185(m)	50	13	---	---
Manganese	ppm	ASTM D5185(m)	0	<1	---	---
Magnesium	ppm	ASTM D5185(m)	950	735	---	---
Calcium	ppm	ASTM D5185(m)	1050	1304	---	---
Phosphorus	ppm	ASTM D5185(m)	995	722	---	---
Zinc	ppm	ASTM D5185(m)	1180	819	---	---
Sulfur	ppm	ASTM D5185(m)	2600	2431	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	12.7	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	12.00	11.5	---	---

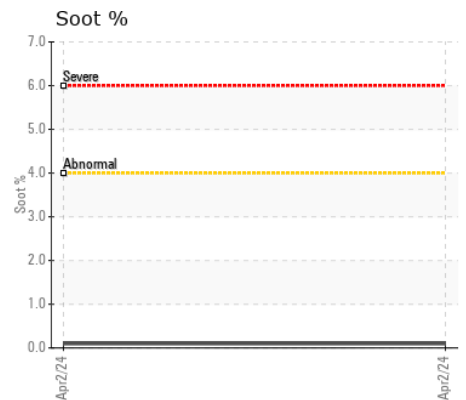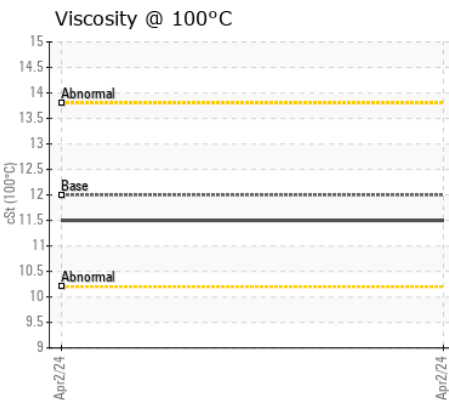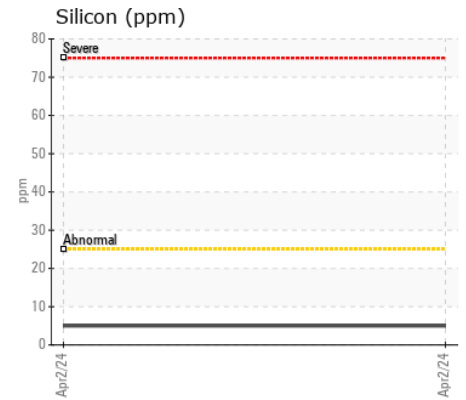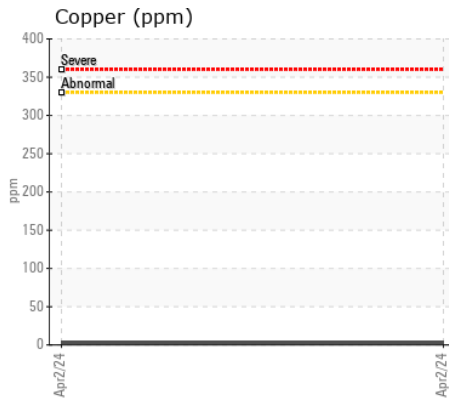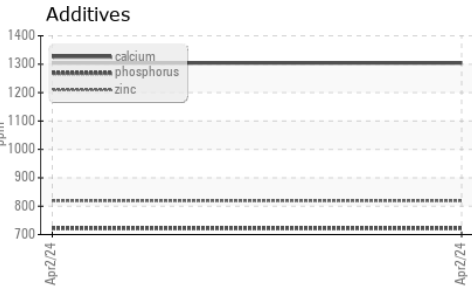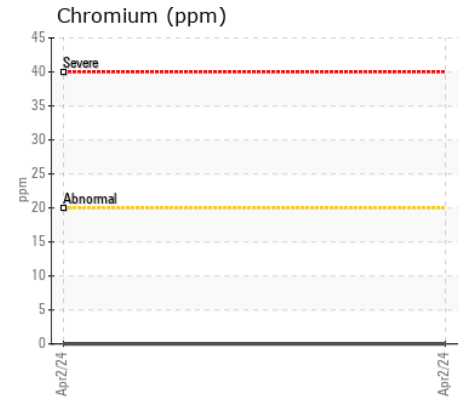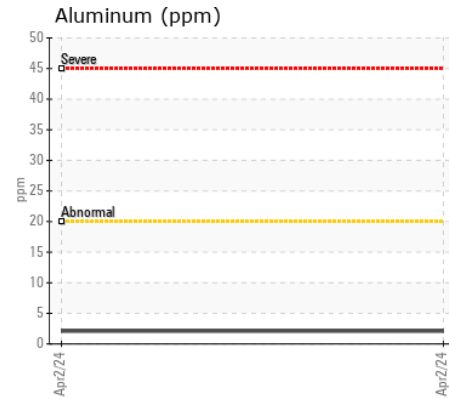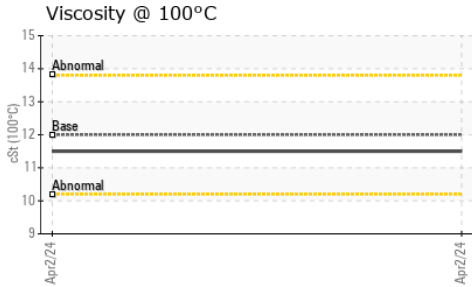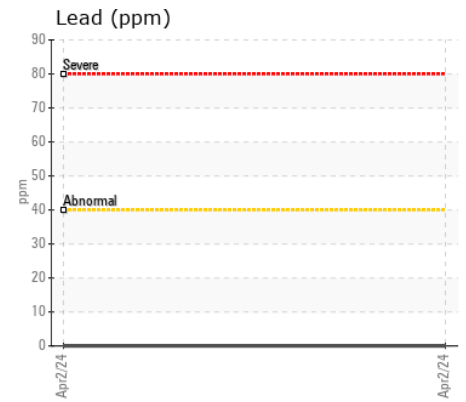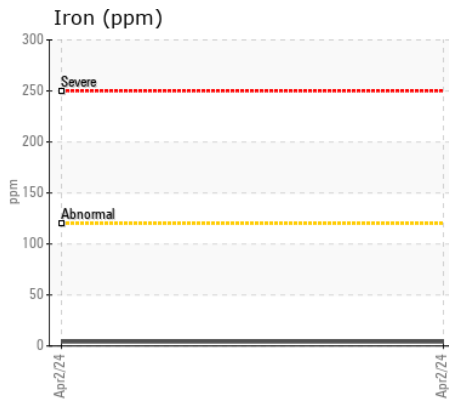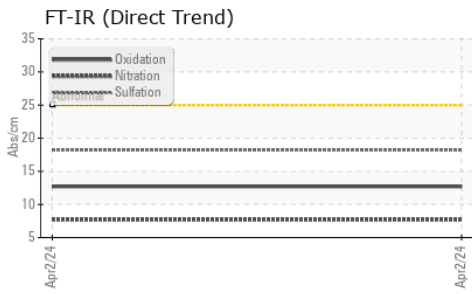

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **GFL Environmental - 769 - Drummondville CD**
Sample No. : GFL0093672 **Received** : 12 Apr 2024 1005 rue Rhea
Lab Number : 02628353 **Tested** : 12 Apr 2024 Drummondville, QC
Unique Number : 5761485 **Diagnosed** : 12 Apr 2024 - Kevin Marson CA J2B 8A9
Test Package : MOB 1 **Contact**: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: