

OIL ANALYSIS REPORT

WEAR CONTAMINATION FLUID CONDITION

UNKNOWN UNKNOWN

Area

SKYCARE AIR AMBULANCE [53178]


Machine Id

FAIRCHILD SA227AC 44306C (S/N AC-594)

Left Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)

ENDATION		Test	UOM	Method	Limit/Abn	Current	History1	History2
		Sample Number		Client Info		GT57684	GT57693	GT57559
		Sample Date		Client Info		12 Apr 2024	25 Mar 2024	14 Mar 2024
		Machine Age	hrs	Client Info		0	0	0
		Oil Age	hrs	Client Info		23	911	892
		Filter Age	hrs	Client Info		67	19	83
		Oil Changed		Client Info		N/A	N/A	N/A
		Filter Changed		Client Info		N/A	N/A	N/A
		Sample Status					NORMAL	
		Iron	ppm	ASTM D5185(m)	>8	0	0	0
		Chromium	ppm	ASTM D5185(m)	>2	0	0	0
		Nickel	ppm	ASTM D5185(m)	>2	0	0	0
		Silver	ppm	ASTM D5185(m)	>2	0	0	0
		Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
		Lead	ppm	ASTM D5185(m)	>3	0	0	<1
		Copper	ppm	ASTM D5185(m)	>3	0	0	0
		Water		WC Method	>0.1	NEG	NEG	NEG
		Magnesium	ppm	ASTM D5185(m)	0	0	0	0
		Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.70	1.07	1.04
		Visc @ 40°C	cSt	ASTM D7279(m)	24.2)	25.1	

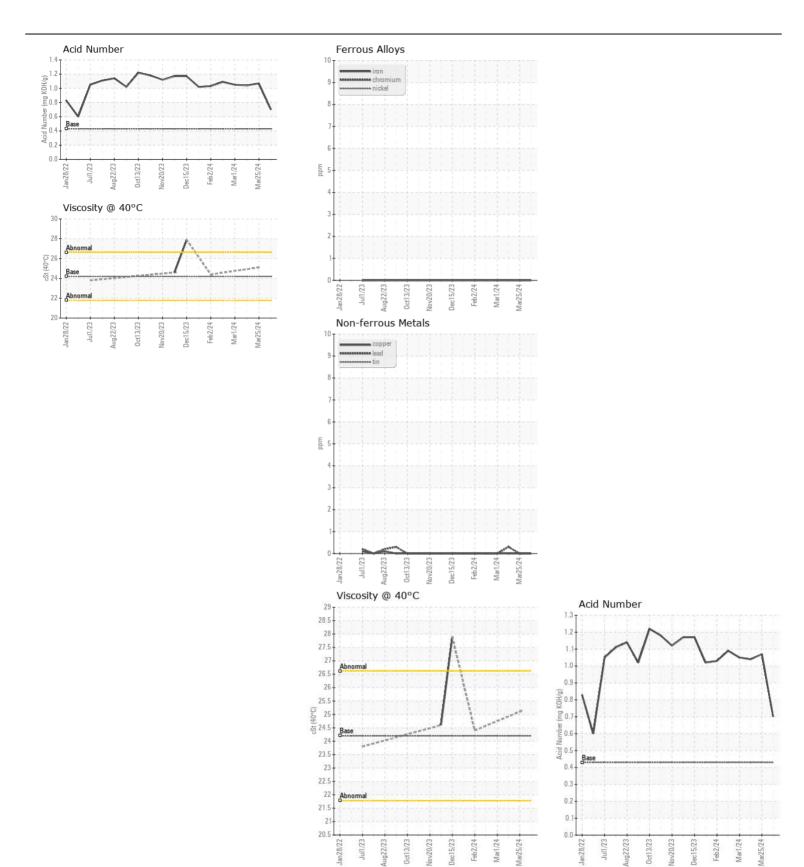





Laboratory Sample No.

: GT57684 Lab Number : 02629822 Unique Number : 5762954

Received Tested Diagnosed

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : 17 Apr 2024

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ US 85034

Contact: GARRETT

Test Package : G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676