WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL NORMAL


Machine Id

ROADTEC 16-375

Component
Diesel Engine

Fluid

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		WC0872160		
	Sample Date		Client Info		16 Apr 2024		
	Machine Age	hrs	Client Info		3600		
	Oil Age	hrs	Client Info		10		
	Filter Age	hrs	Client Info		10		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185(m)	>100	1		
All component wear rates are normal.	Chromium	ppm	ASTM D5185(m)		0		
	Nickel	ppm	ASTM D5185(m)		0		
	Titanium	ppm	ASTM D5185(m)		0		
	Silver	ppm	ASTM D5185(m)	>3	0		
	Aluminum	ppm	ASTM D5185(m)	>20	<1		
	Lead	ppm	ASTM D5185(m)	>40	0		
	Copper	ppm	ASTM D5185(m)	>330	0		
	Tin	ppm	ASTM D5185(m)	>15	0		
	Vanadium	ppm	ASTM D5185(m)		0		
CONTAMINATION	Silicon	ppm	ASTM D5185(m)	>25	1		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)	>20	0		
	Fuel		WC Method	>5	<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	ASTM D7844*	>3	0		
	Nitration	Abs/cm	ASTM D7624*	>20	4.4		
	Sulfation	Abs/.1mm	ASTM D7415*	>30	17.8		
	Emulsified Water	scalar	Visual*	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185(m)		1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)	0	2		
	Barium	ppm	ASTM D5185(m)	0	0		
	Molybdenum	ppm	ASTM D5185(m)	60	57		
	Manganese	ppm	ASTM D5185(m)	0	0		
	Magnesium	ppm	ASTM D5185(m)	1010	965		
	Calcium	ppm	ASTM D5185(m)	1070	1049		
	Phosphorus	ppm	ASTM D5185(m)	1150	996		
	Zinc	ppm	ASTM D5185(m)	1270	1162		
	Sulfur	ppm	ASTM D5185(m)		2616		
	Oxidation	Abs/.1mm	ASTM D7414*		12.8		
	Visc @ 100°C	cSt	ASTM D7279(m)	15.6	13.7		

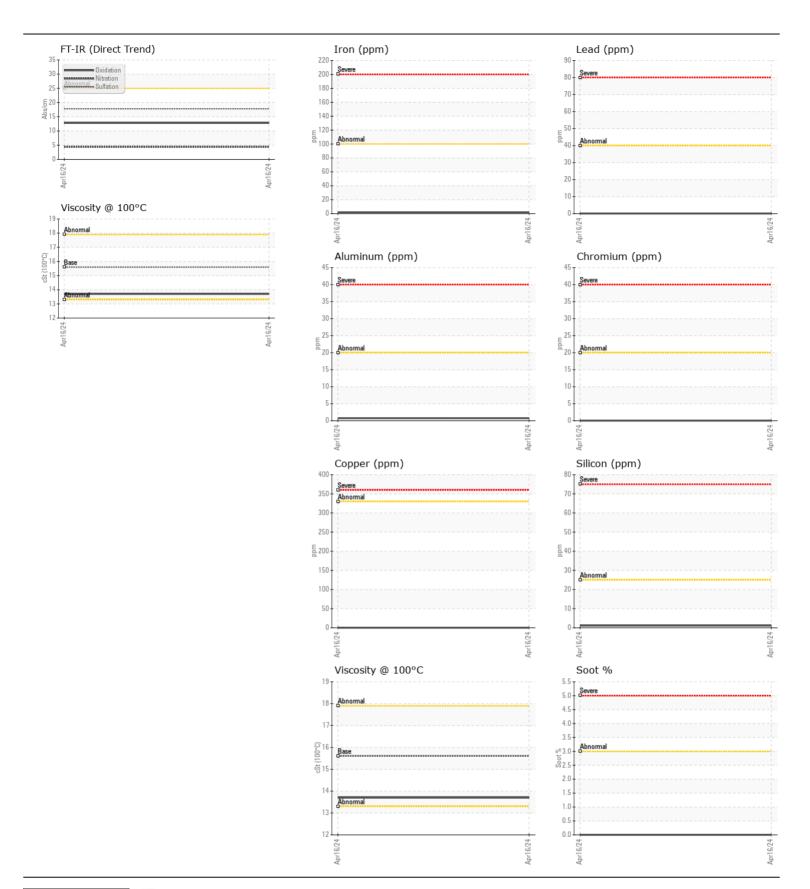



CALA ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Sample No. : WC0872160

Lab Number : 02630042 Unique Number : 5763174

Test Package : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Received

Diagnosed

Tested

: 18 Apr 2024

: 18 Apr 2024

: 18 Apr 2024 - Wes Davis

BRANTCO CONSTRUCTION

1555 BISHOP STREET UNIT 1 CAMBRIDGE, ON CA N1R 7J4 Contact: Joe Cunha jcunha@brantco.ca T: (519)223-0397 F: (519)622-2443