

Machine Id
7144
Component
Hydraulic System
Fluid
PETRO CANADA HYDREX MV 32 (--- GAL)

RECOMMENDATION

Vérifier les scelles et/ou les filtres pour des points d'entrée des contaminants. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessicant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Nous avons pris note que le filtre a été remplacé au moment de l'échantillonnage. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation.

WEAR

Les taux d'usure de tous les composants sont normaux.








CONTAMINATION

Il y a une grande quantité de limon (particules de 4 à 14 microns) dans l'huile.

FLUID CONDITION

La viscosité de l'échantillon se situe dans la portée de l'ISO 46; nous vous conseillons de vérifier. l'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0114876	GFL0073359	GFL0055272
Sample Date		Client Info		18 Apr 2024	29 Mar 2023	13 Oct 2022
Machine Age	hrs	Client Info		0	1717	1516
Oil Age	hrs	Client Info		1200	1200	0
Filter Age	hrs	Client Info		1200	1200	0
Oil Changed		Client Info		Not Changd	N/A	N/A
Filter Changed		Client Info		Changed	N/A	Changed
Sample Status				SEVERE	SEVERE	SEVERE
Iron	ppm	ASTM D5185(m)	>20	3	8	6
Chromium	ppm	ASTM D5185(m)	>10	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>10	0	0	0
Titanium	ppm	ASTM D5185(m)		0	<1	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>10	<1	2	2
Lead	ppm	ASTM D5185(m)	>10	0	<1	<1
Copper	ppm	ASTM D5185(m)	>75	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>10	0	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	▲ LTMOD	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Silicon	ppm	ASTM D5185(m)	>20	<1	3	2
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	0
Water		WC Method	>0.1	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>5000	▲ 92412	▲ 146753	▲ 130239
Particles >6µm		ASTM D7647	>1300	▲ 16826	▲ 71225	▲ 51007
Particles >14µm		ASTM D7647	>160	108	▲ 1525	▲ 1251
Particles >21µm		ASTM D7647	>40	8	▲ 120	▲ 190
Particles >38µm		ASTM D7647	>10	1	2	2
Particles >71µm		ASTM D7647	>3	1	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 24/21/14	▲ 24/23/18	▲ 24/23/17
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG
Sodium	ppm	ASTM D5185(m)		1	2	2
Boron	ppm	ASTM D5185(m)	0	3	12	8
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	2	4	1
Manganese	ppm	ASTM D5185(m)	1	0	<1	<1
Magnesium	ppm	ASTM D5185(m)	0	40	80	16
Calcium	ppm	ASTM D5185(m)	50	139	202	93
Phosphorus	ppm	ASTM D5185(m)	330	503	447	365
Zinc	ppm	ASTM D5185(m)	430	647	475	400
Sulfur	ppm	ASTM D5185(m)	760	1363	1173	871
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	▲ 39.8	32.0	33.2

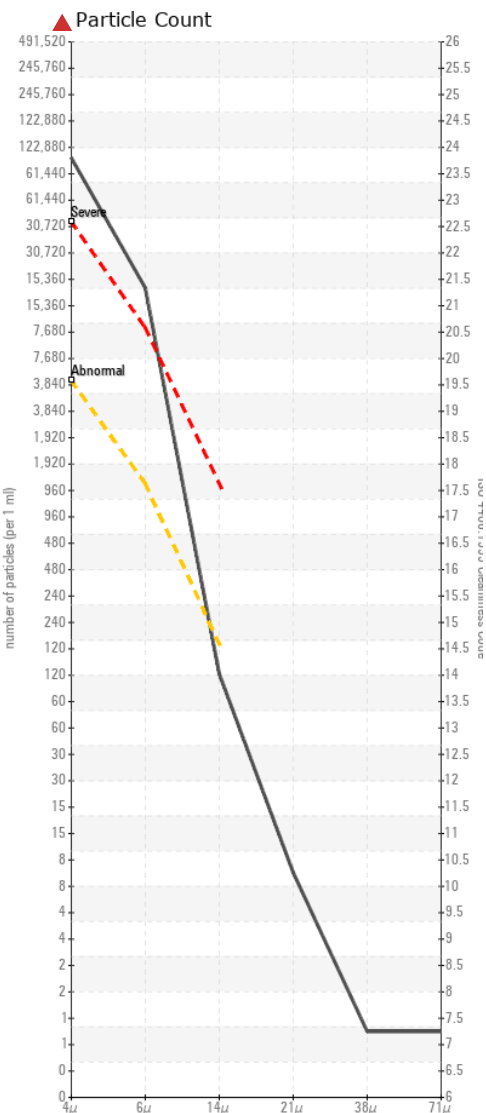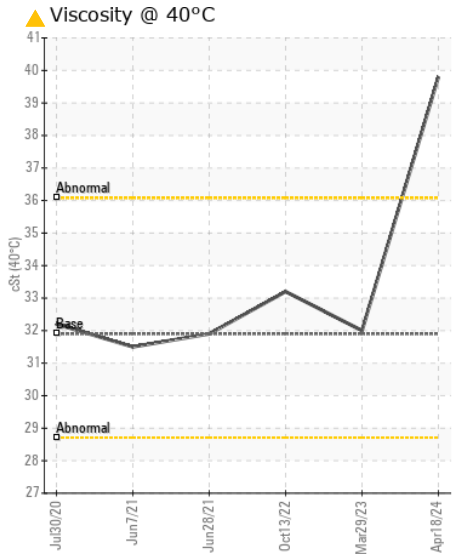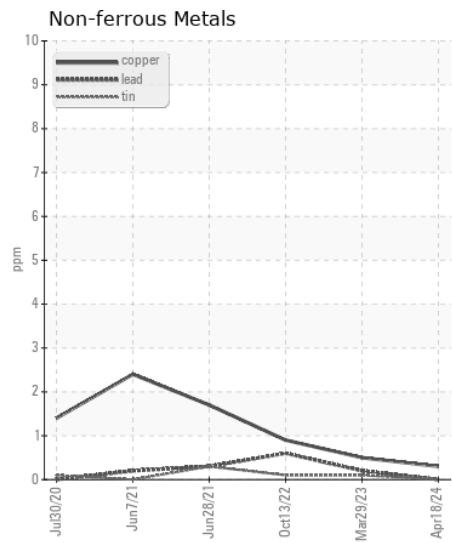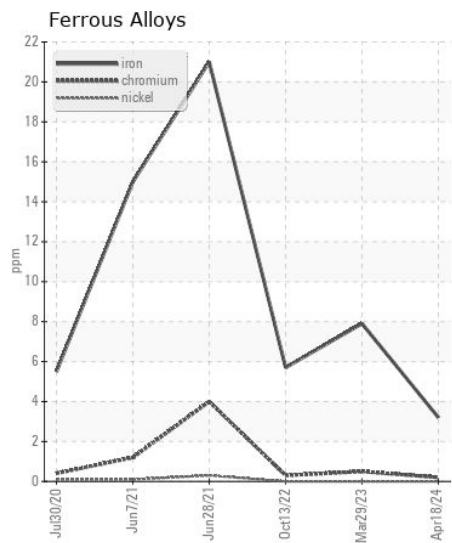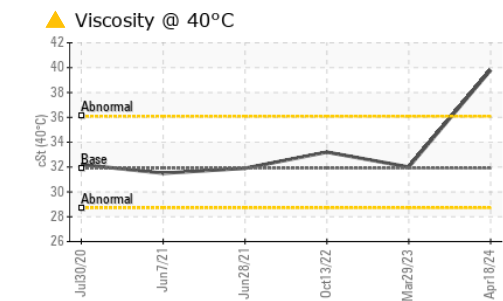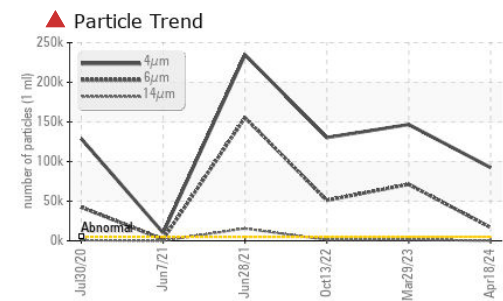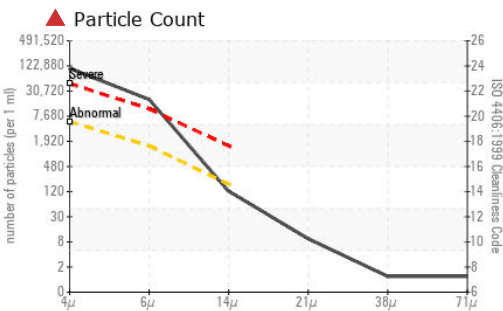

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0114876
Lab Number : 02631186
Unique Number : 5772339
Test Package : MOB 1 (Additional Tests: PrtCount)

GFL Environmental - 780 - GMA - ICI - Solid Waste
 4365 boul. St-Elzear Ouest,
 Laval, QC
 CA H7P 4J3
 Contact: Pieces Laval
 pieces.laval@gflenv.com
 T: (450)687-3838
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.