



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	ABNORMAL

Area  
**SEA TO SHORE FISHING LTD**

Machine Id  
**FV LASQUETI STORM**

Component  
**Diesel Engine**

Fluid  
**JOHN DEERE ENGINE OIL PLUS 50 II 15W40 (--- GAL)**

**RECOMMENDATION**

The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		OF0000905	---	---
Sample Date		Client Info		30 Apr 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		550	---	---
Filter Age	hrs	Client Info		550	---	---
Oil Changed		Client Info		Changed	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				ABNORMAL	---	---

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>90	8	---	---
Chromium	ppm	ASTM D5185(m)	>20	<1	---	---
Nickel	ppm	ASTM D5185(m)	>2	0	---	---
Titanium	ppm	ASTM D5185(m)	>2	0	---	---
Silver	ppm	ASTM D5185(m)	>2	0	---	---
Aluminum	ppm	ASTM D5185(m)	>20	2	---	---
Lead	ppm	ASTM D5185(m)	>40	<1	---	---
Copper	ppm	ASTM D5185(m)	>330	1	---	---
Tin	ppm	ASTM D5185(m)	>15	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---

**CONTAMINATION**













There is a moderate amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Silicon	ppm	ASTM D5185(m)	>25	6	---	---
Potassium	ppm	ASTM D5185(m)	>20	2	---	---
Fuel	%	ASTM D7593*	>3.0	▲ 4.1	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	ASTM D7844*	>6	0	---	---
Nitration	Abs/cm	ASTM D7624*	>20	6.9	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.0	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---

**FLUID CONDITION**

The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

Sodium	ppm	ASTM D5185(m)		3	---	---
Boron	ppm	ASTM D5185(m)		133	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		165	---	---
Manganese	ppm	ASTM D5185(m)		<1	---	---
Magnesium	ppm	ASTM D5185(m)		634	---	---
Calcium	ppm	ASTM D5185(m)		1129	---	---
Phosphorus	ppm	ASTM D5185(m)		769	---	---
Zinc	ppm	ASTM D5185(m)		905	---	---
Sulfur	ppm	ASTM D5185(m)		2193	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	16.2	---	---
Base Number (BN)	mg KOH/g	ASTM D2896*	13.6	8.78	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	▲ 11.5	---	---

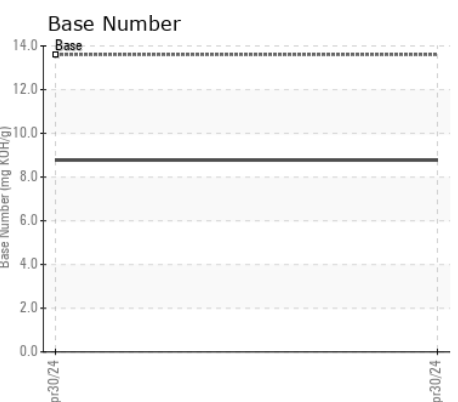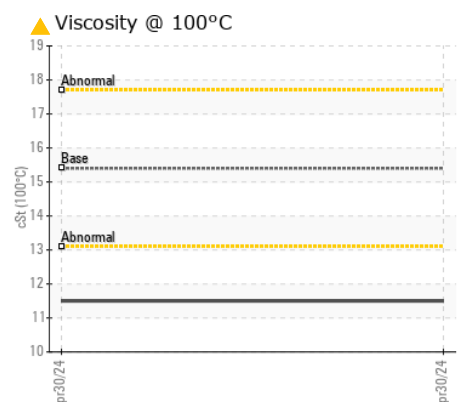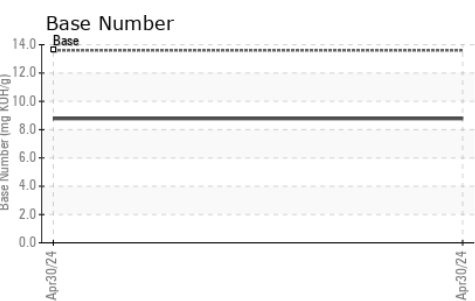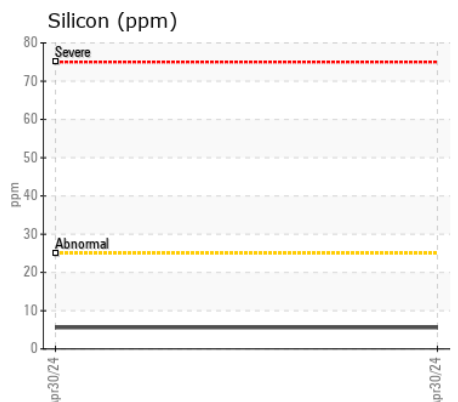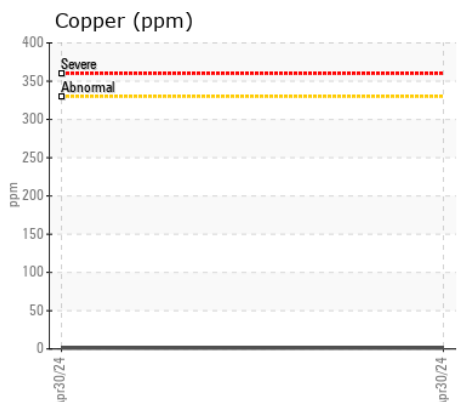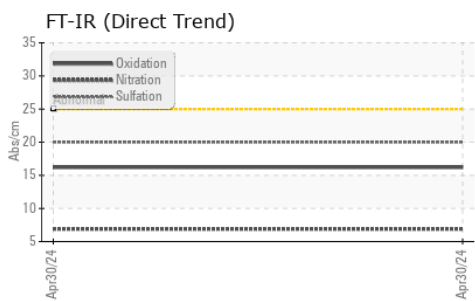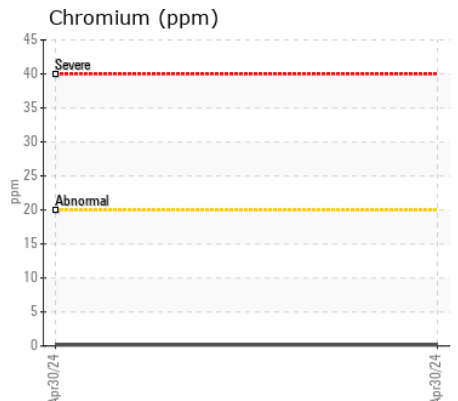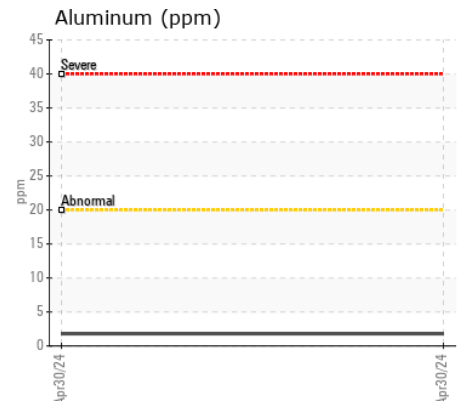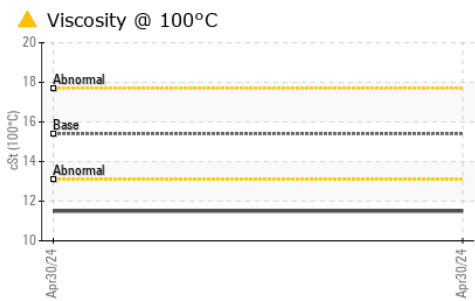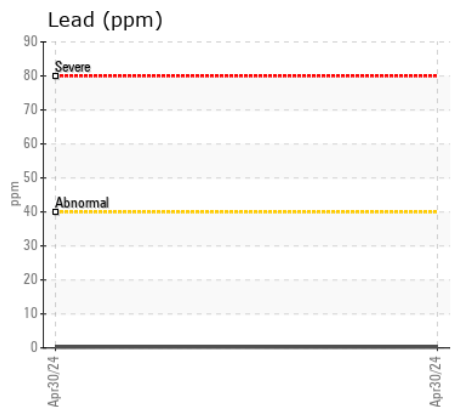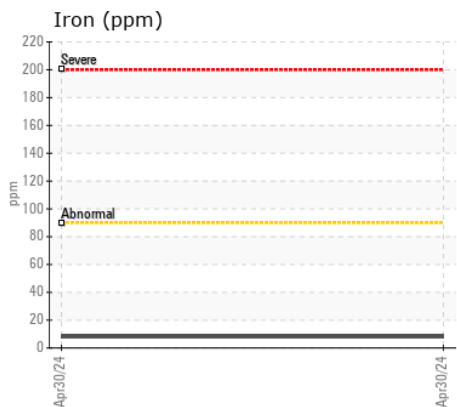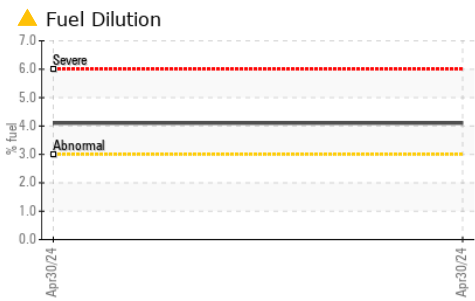

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : OF0000905 **Received** : 06 May 2024  
**Lab Number** : **02633398** **Tested** : 07 May 2024  
**Unique Number** : 5774551 **Diagnosed** : 07 May 2024 - Wes Davis  
**Test Package** : MOB 2 ( Additional Tests: FuelDilution, PercentFuel )

**Oil Filtration Solutions Ltd.**  
 PO BOX 16125  
 CONCEPTION BAY SOUTH, NL  
 CA A1X 2E2  
 Contact: BILL BUTLER  
 BBUTLER@OILFILTRATIONSOLUTIONS.COM  
 T: (709)834-8433  
 F: (709)834-8435

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.