

Machine Id
833082
Component
Hydraulic System
Fluid
PETRO CANADA HYDREX MV 32 (--- GAL)

RECOMMENDATION

Nous vous recommandons de vérifier tous les endroits par lesquels des contaminants peuvent pénétrer dans le système. Nous vous recommandons de remplacer le filtre et d'utiliser un système de filtrage hors-ligne afin d'améliorer la propreté du fluide. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessicant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation. Veuillez préciser la marque et le modèle du composant lors du prochain échantillon.

WEAR

Les taux d'usure de tous les composants sont normaux.








CONTAMINATION

Il y a une quantité élevée de matières particulaires (2 à 100 µm de taille) présente dans l'huile.

FLUID CONDITION

L'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0107527	---	---
Sample Date		Client Info		11 Apr 2024	---	---
Machine Age	hrs	Client Info		50484	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Not Changd	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				SEVERE	---	---
Iron	ppm	ASTM D5185(m)	>20	7	---	---
Chromium	ppm	ASTM D5185(m)	>10	6	---	---
Nickel	ppm	ASTM D5185(m)	>10	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>10	1	---	---
Lead	ppm	ASTM D5185(m)	>10	0	---	---
Copper	ppm	ASTM D5185(m)	>75	2	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Silicon	ppm	ASTM D5185(m)	>20	4	---	---
Potassium	ppm	ASTM D5185(m)	>20	4	---	---
Water		WC Method	>0.1	NEG	---	---
Particles >4µm		ASTM D7647	>5000	▲ 86053	---	---
Particles >6µm		ASTM D7647	>1300	▲ 12278	---	---
Particles >14µm		ASTM D7647	>160	▲ 983	---	---
Particles >21µm		ASTM D7647	>40	▲ 187	---	---
Particles >38µm		ASTM D7647	>10	6	---	---
Particles >71µm		ASTM D7647	>3	1	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 24/21/17	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Sodium	ppm	ASTM D5185(m)		6	---	---
Boron	ppm	ASTM D5185(m)	0	<1	---	---
Barium	ppm	ASTM D5185(m)	0	<1	---	---
Molybdenum	ppm	ASTM D5185(m)	0	0	---	---
Manganese	ppm	ASTM D5185(m)	1	0	---	---
Magnesium	ppm	ASTM D5185(m)	0	2	---	---
Calcium	ppm	ASTM D5185(m)	50	56	---	---
Phosphorus	ppm	ASTM D5185(m)	330	327	---	---
Zinc	ppm	ASTM D5185(m)	430	421	---	---
Sulfur	ppm	ASTM D5185(m)	760	753	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	31.3	---	---

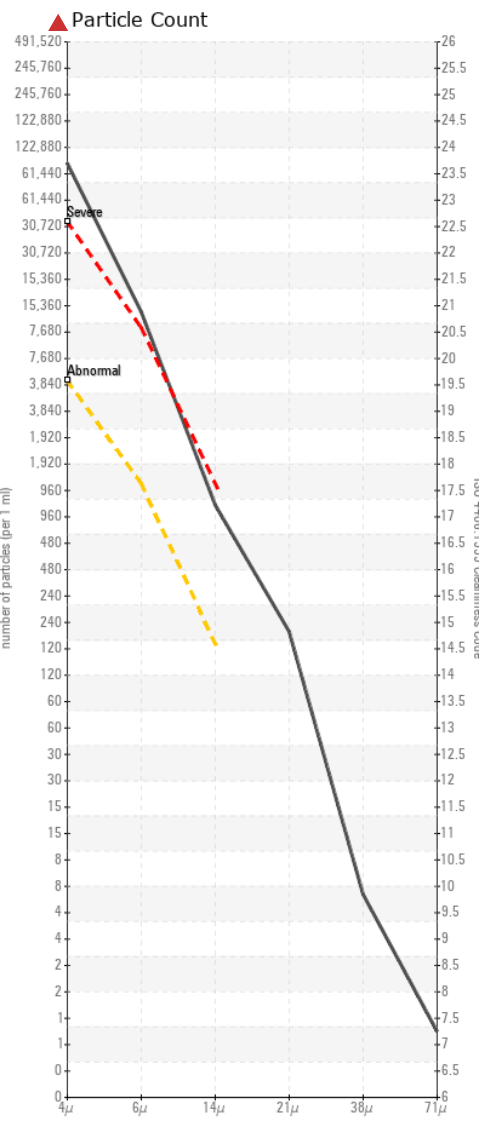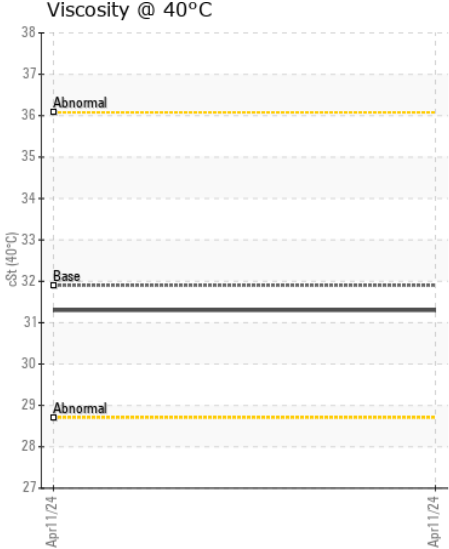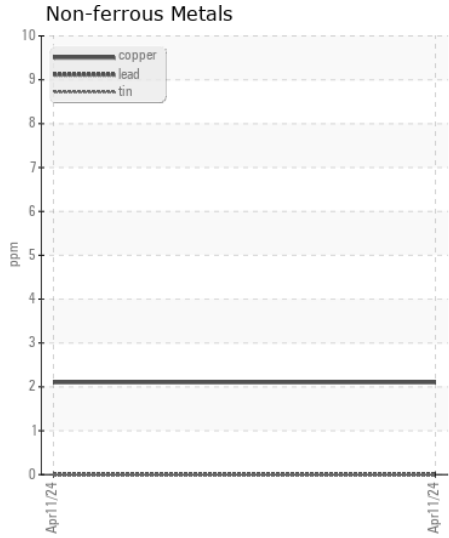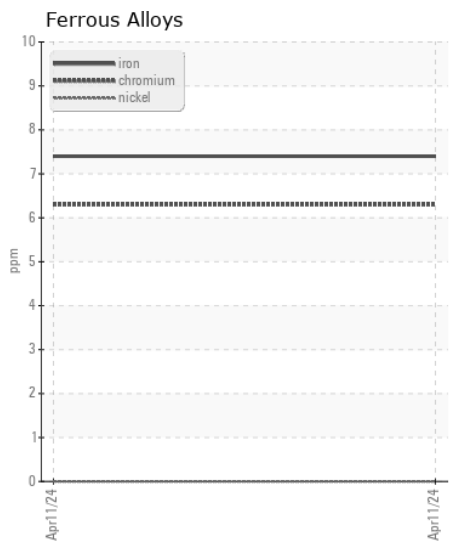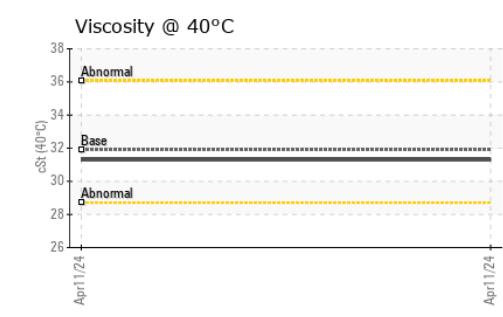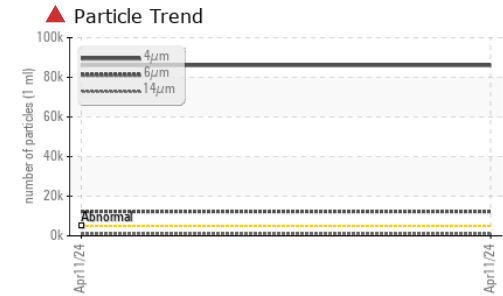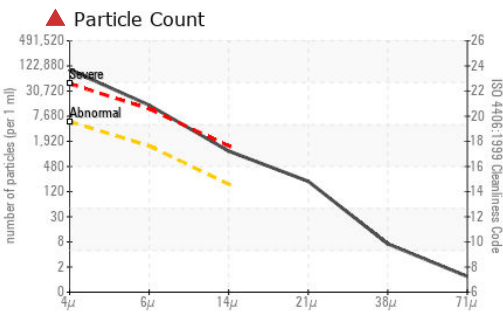

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0107527
Lab Number : 02633519
Unique Number : 5774672
Test Package : MOB 1 (Additional Tests: PrtCount)

GFL Environmental - 747 - GMA - Solid Waste
 4 Chemin du Tremblay,
 Boucherville, QC
 CA J4B 6Z5
 Contact: Service Manager
 llapierre@matrec.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.