## Honeywell

**OIL ANALYSIS REPORT** 

## NORTHWESTERN AIR LEASE [53245] JETSTREAM J32 P-66070C (S/N 843)

Jet Turbine

Area

## BP TURBO OIL 2380 (--- GAL)

## RECOMMENDATION

This is a baseline read-out on the submitted sample.

WW	EA	1

CONTAMINATION
FLUID CONDITION

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GT57669	GT57135	GT57033
Sample Date		Client Info		26 Apr 2024	05 Jan 2024	10 Oct 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		679	481	275
Filter Age	hrs	Client Info		198	206	187
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL		
Iron	ppm	ASTM D5185(m)	>8	<1	<1	<1
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>3	0	0	0
Water		WC Method	>0.1	NEG	NEG	NEG
Magnesium	ppm	ASTM D5185(m)	0	<1	0	0
Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.52	0.57	0.61
Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.2		

NORMAL


NORMAL

NORMAL

WEAR

CONTAMINATION

**FLUID CONDITION** 

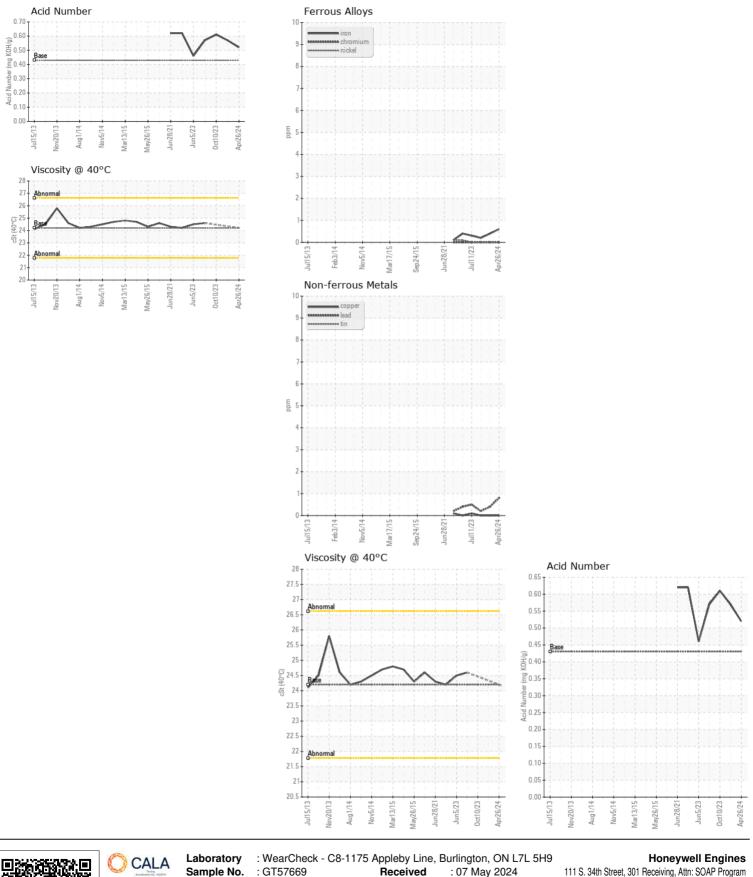

Sample No. Received :07 May 2024 111 S. 34th Street, 301 Receiving, Attn: SOAP Program : GT57669 Lab Number : 02633980 Tested PHOENIX, AZ :07 May 2024 ISO 17025:2017 Accredited Laboratory : 07 May 2024 - Wes Davis US 85034 Unique Number : 5775133 Diagnosed Test Package : G331 (Additional Tests: ICP) Contact: GARRETT To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. T: Validity of results and interpretation are based on the sample and information as supplied. F: (602)365-2676

Contact/Location: GARRETT ? - HONPHO Page 2 of 2