



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>ABNORMAL</b>



Machine Id  
**NO UNIT PC0088670**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON SHP 10W30 (--- LTR)**

**RECOMMENDATION**

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PC0088670</b>	---	---
Sample Date		Client Info		<b>02 May 2024</b>	---	---
Machine Age	kms	Client Info		<b>33364</b>	---	---
Oil Age	kms	Client Info		<b>0</b>	---	---
Filter Age	kms	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>N/A</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>ABNORMAL</b>	---	---

**WEAR**

Les taux de métaux sont typiques pour la période de rodage d'un nouveau composant.

Iron	ppm	ASTM D5185(m)	>80	<b>9</b>	---	---
Chromium	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Titanium	ppm	ASTM D5185(m)		<b>0</b>	---	---
Silver	ppm	ASTM D5185(m)	>3	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185(m)	>30	<b>2</b>	---	---
Lead	ppm	ASTM D5185(m)	>30	<b>0</b>	---	---
Copper	ppm	ASTM D5185(m)	>150	<b>&lt;1</b>	---	---
Tin	ppm	ASTM D5185(m)	>5	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---	---

**CONTAMINATION**












Il n'y a aucun indice de contamination dans l'huile.

Silicon	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Potassium	ppm	ASTM D5185(m)	>20	<b>1</b>	---	---
Fuel		WC Method	>5	<b>&lt;1.0</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	ASTM D7844*	>3	<b>0.1</b>	---	---
Nitration	Abs/cm	ASTM D7624*	>20	<b>6.8</b>	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>18.8</b>	---	---
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	---	---

**FLUID CONDITION**

La viscosité de l'échantillon se situe dans la portée de l'SAE 30; nous vous conseillons de vérifier. L'état de l'huile est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)		<b>4</b>	---	---
Boron	ppm	ASTM D5185(m)	2	<b>11</b>	---	---
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185(m)	50	<b>61</b>	---	---
Manganese	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185(m)	950	<b>960</b>	---	---
Calcium	ppm	ASTM D5185(m)	1050	<b>1081</b>	---	---
Phosphorus	ppm	ASTM D5185(m)	995	<b>978</b>	---	---
Zinc	ppm	ASTM D5185(m)	1180	<b>1169</b>	---	---
Sulfur	ppm	ASTM D5185(m)	2600	<b>2518</b>	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>14.4</b>	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	80.1	<b>▲ 107</b>	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	12.00	<b>11.1</b>	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	144	<b>86</b>	---	---

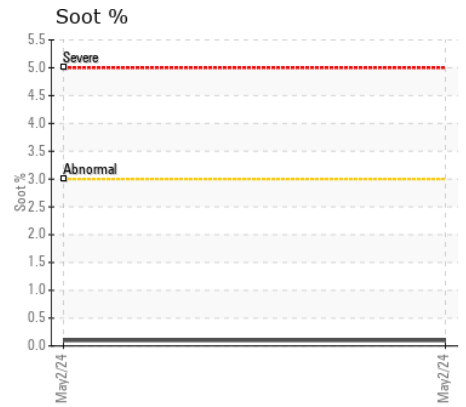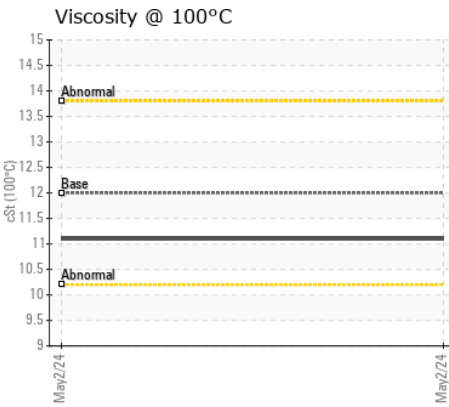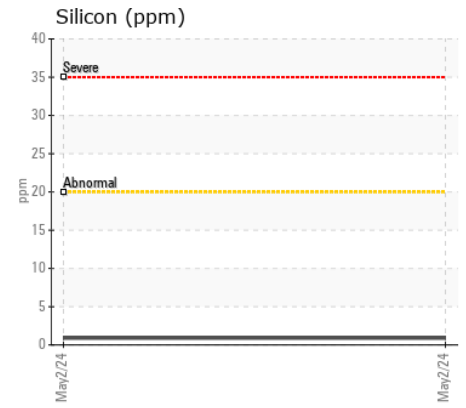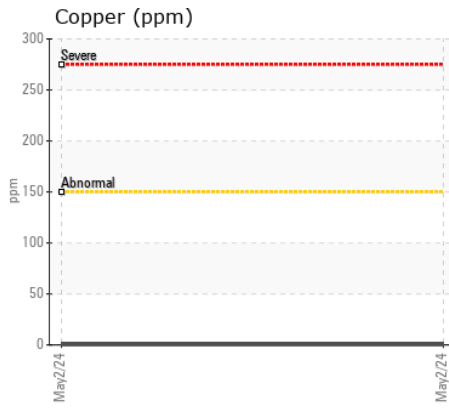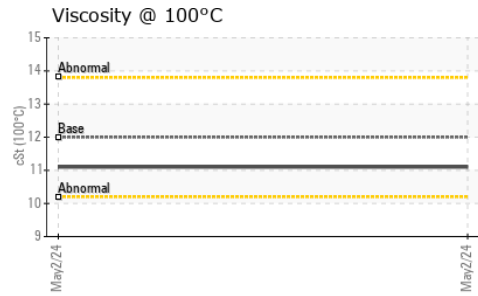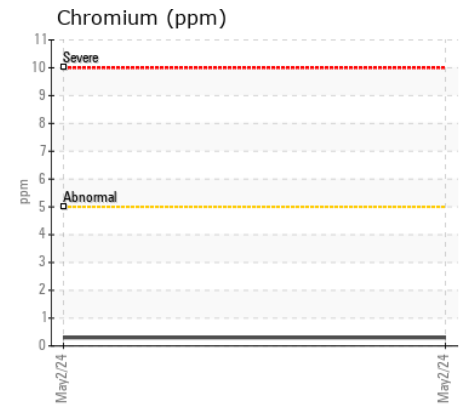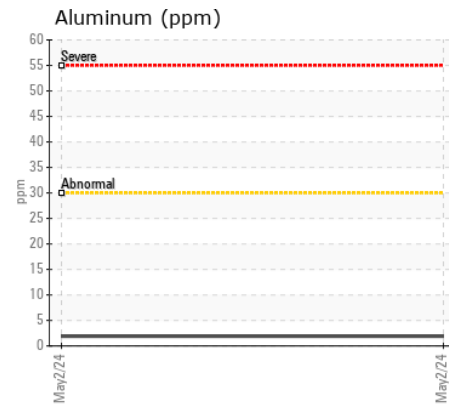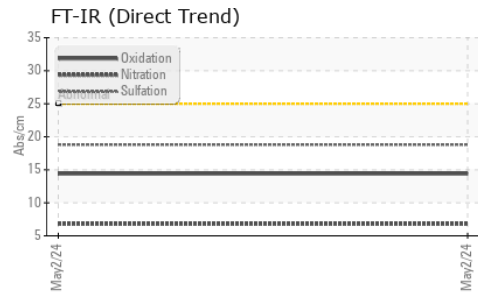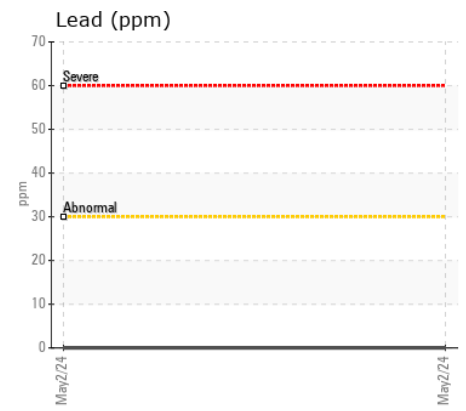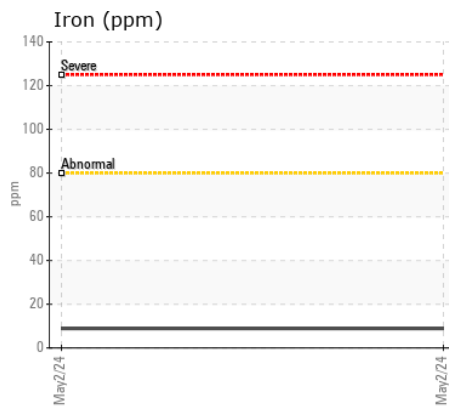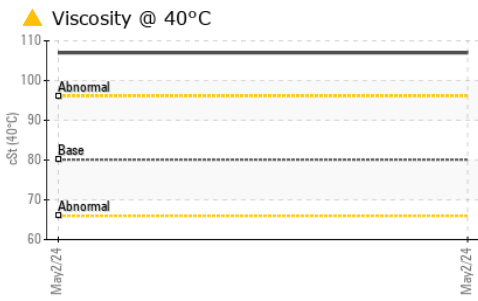

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PC0088670 **Received** : 09 May 2024  
**Lab Number** : 02634266 **Tested** : 09 May 2024  
**Unique Number** : 5775419 **Diagnosed** : 10 May 2024 - Kevin Marson  
**Test Package** : MOB 1 ( Additional Tests: KV40, VI )

**GFL Environmental - 742 - Quebec City Solid Waste**  
 5160 Jean-Talon Pierre-Bertrand Bou  
 Quebec City, QC  
 CA G2J 1B7  
 Contact: Dave  
 davebeaulieu@gflenv.com  
 T:  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.