



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area

(353690)

Machine Id

LIEBHERR LH60M 131944-1475

Component

Swing Drive

Fluid

PETRO CANADA TRAXON 75W90 SYNTHETIC (12 LTR)

RECOMMENDATION

Confirm the source of the lubricant being utilized for top-up/fill.
Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0288320	LH0276952	LH0221705
Sample Date		Client Info		26 Apr 2024	22 Nov 2023	04 Mar 2023
Machine Age	hrs	Client Info		12400	10354	7109
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>350	119	169	67
Chromium	ppm	ASTM D5185(m)	>15	<1	1	<1
Nickel	ppm	ASTM D5185(m)	>5	0	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>5	0	<1	<1
Lead	ppm	ASTM D5185(m)	>10	0	4	<1
Copper	ppm	ASTM D5185(m)	>300	9	8	36
Tin	ppm	ASTM D5185(m)	>15	0	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	VLITE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>15	0	2	<1
Potassium	ppm	ASTM D5185(m)	>20	1	<1	<1
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	VLITE	LIGHT	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

Additive levels indicate the addition of a different brand, or type of oil.
The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<1	<1	1
Boron	ppm	ASTM D5185(m)	328	36	44	289
Barium	ppm	ASTM D5185(m)	1	0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		<1	<1	<1
Magnesium	ppm	ASTM D5185(m)	1	1	2	1
Calcium	ppm	ASTM D5185(m)	7	7	7	12
Phosphorus	ppm	ASTM D5185(m)	1145	491	545	1307
Zinc	ppm	ASTM D5185(m)	3	5	6	10
Sulfur	ppm	ASTM D5185(m)	17909	16057	17416	21665
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	88.5	89.8	99.5

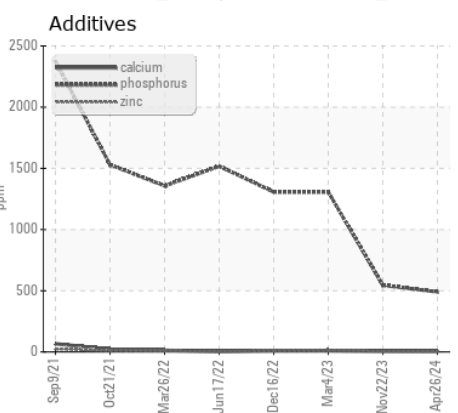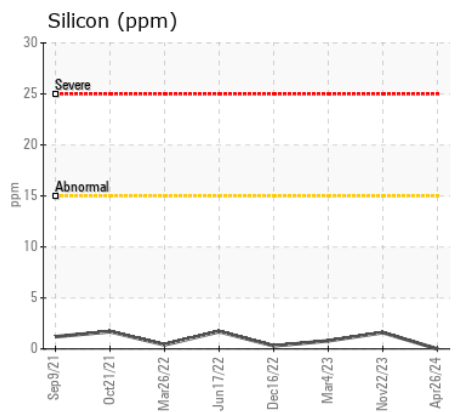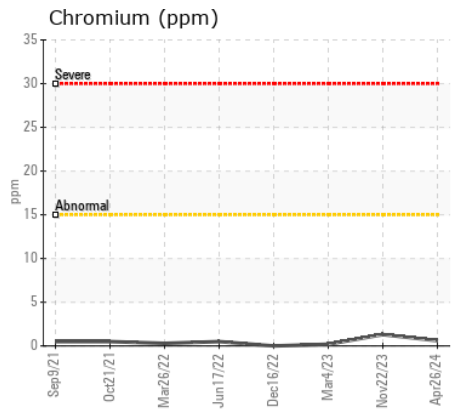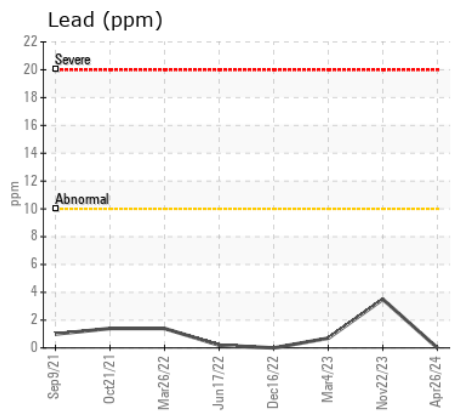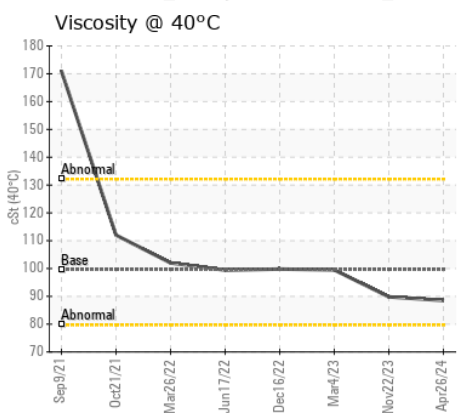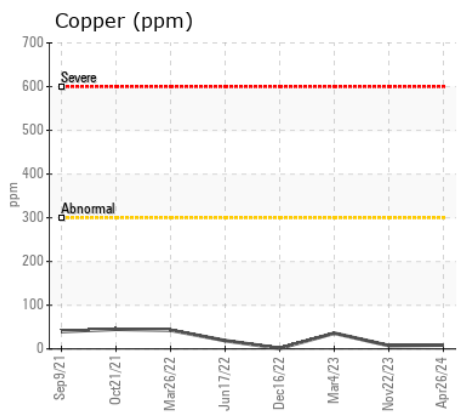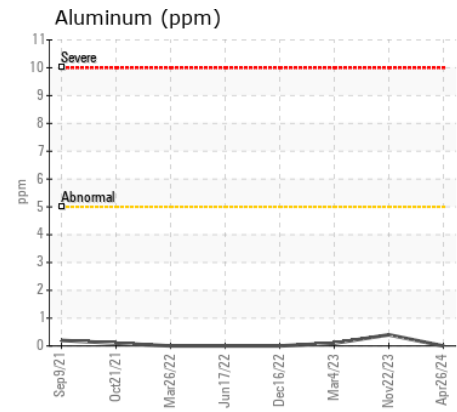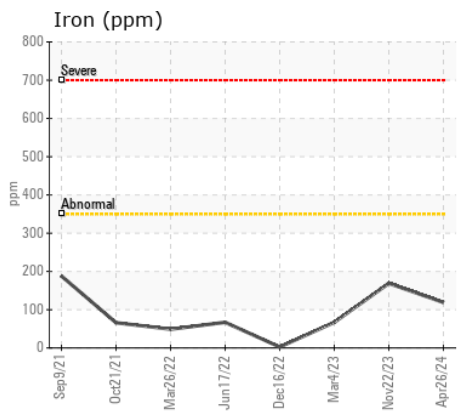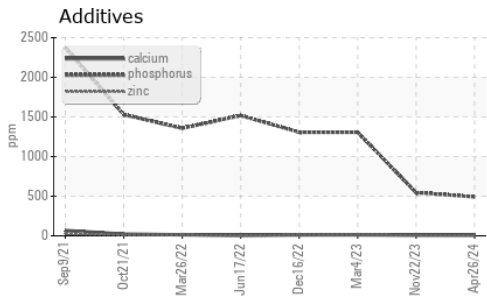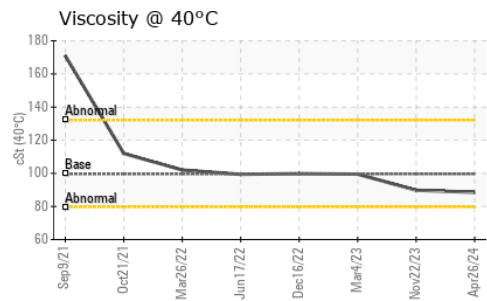

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0288320 **Received** : 13 May 2024
Lab Number : 02635019 **Tested** : 13 May 2024
Unique Number : 5776172 **Diagnosed** : 13 May 2024 - Wes Davis
Test Package : MOB 1

Eacom Timber Corporation
 100 Old Nairn Centre Road
 Nairn Centre, ON
 CA P0M 2L0
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: