
WEAR CONTAMINATION **FLUID CONDITION**

NORMAL NORMAL NORMAL

Machine Id 901139

Component Natural Gas Engine

PETRO CANADA DURON GEO LD 15W40 (GAL)						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the component make and model with your next sample.	Sample Number		Client Info		GFL0096838		
	Sample Date		Client Info		10 May 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185(m)	>50	3		
All component wear rates are normal.	Chromium	ppm	ASTM D5185(m)	>4	0		
	Nickel	ppm	ASTM D5185(m)	>2	0		
	Titanium	ppm	ASTM D5185(m)		0		
	Silver	ppm	ASTM D5185(m)	>3	0		
	Aluminum	ppm	ASTM D5185(m)	>9	<1		
	Lead	ppm	ASTM D5185(m)	>30	0		
	Copper	ppm	ASTM D5185(m)	>35	<1		
	Tin	ppm	ASTM D5185(m)	>4	0		
	Vanadium	ppm	ASTM D5185(m)		0		
CONTAMINATION	Silicon	ppm	ASTM D5185(m)	>+100	6		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)	>20	<1		
	Water		WC Method	>0.1	NEG		
	Soot %	%	ASTM D7844*		0		
	Nitration	Abs/cm	ASTM D7624*	>20	9.6		
	Sulfation	Abs/.1mm	ASTM D7415*	>30	20.4		
	Emulsified Water	scalar	Visual*	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185(m)		5		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)	50	20		
	Barium	ppm	ASTM D5185(m)	5	0		
	Molybdenum	ppm	ASTM D5185(m)	50	48		
	Manganese	ppm	ASTM D5185(m)	0	0		
	Magnesium	ppm	ASTM D5185(m)	560	552		
	Calcium	ppm	ASTM D5185(m)	1510	1508		
	Phosphorus	ppm	ASTM D5185(m)	780	696		
	Zinc	ppm	ASTM D5185(m)	870	867		
	Sulfur	ppm	ASTM D5185(m)	2040	1909		
	Oxidation	Abs/.1mm	ASTM D7414*		17.3		
	Visc @ 100°C	cSt	ASTM D7279(m)	15.1	14.9		

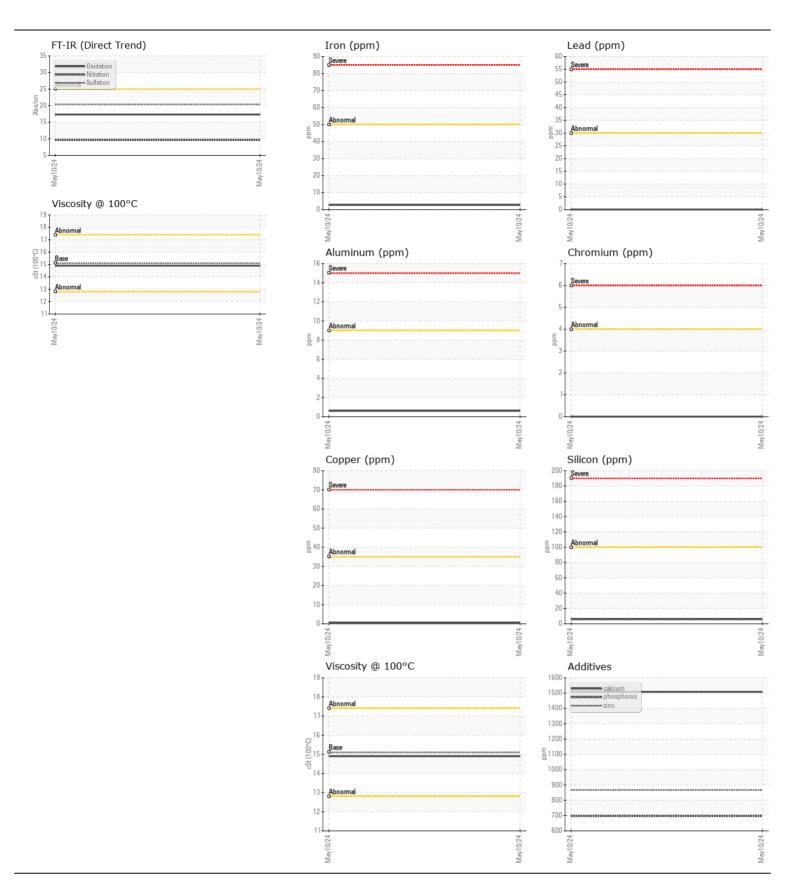



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number : 02636851

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 574 - Vancouver Fleet : GFL0096838

Unique Number : 5786013 Test Package : MOB 1

Received : 22 May 2024 **Tested** : 22 May 2024

Diagnosed : 22 May 2024 - Wes Davis

70 Golden Drive, Coquitlam, BC CA V3K 6B5 Contact: Sanjay Kisun skisun@gflenv.com T: (604)529-4030

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (604)529-4026