Honeywell

OIL ANALYSIS REPORT

(BWQ) SKYCARE [53301] [BWQ] FAIRCHILD SA226 P-54188 (S/N TC-379)

Right Jet Turbine

Area

EASTMAN TURBO OIL 2380 (--- GAL)

RECOMMENDATION


This is a baseline read-out on the submitted sample.

	_
E/	

CONTAMINATION
FLUID CONDITION

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GT57820	GT57537	GT57709
Sample Date		Client Info		21 May 2024	21 May 2024	22 Apr 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		714	325	646
Filter Age	hrs	Client Info		68	95	61
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
Iron	ppm	ASTM D5185(m)	>8	0	<1	0
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>3	0	0	<1
Water		WC Method	>0.1	NEG	NEG	NEG
Magnesium	ppm	ASTM D5185(m)	0	0	0	0
Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.42	0.55	0.43
Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.2	24.5	24.8

WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

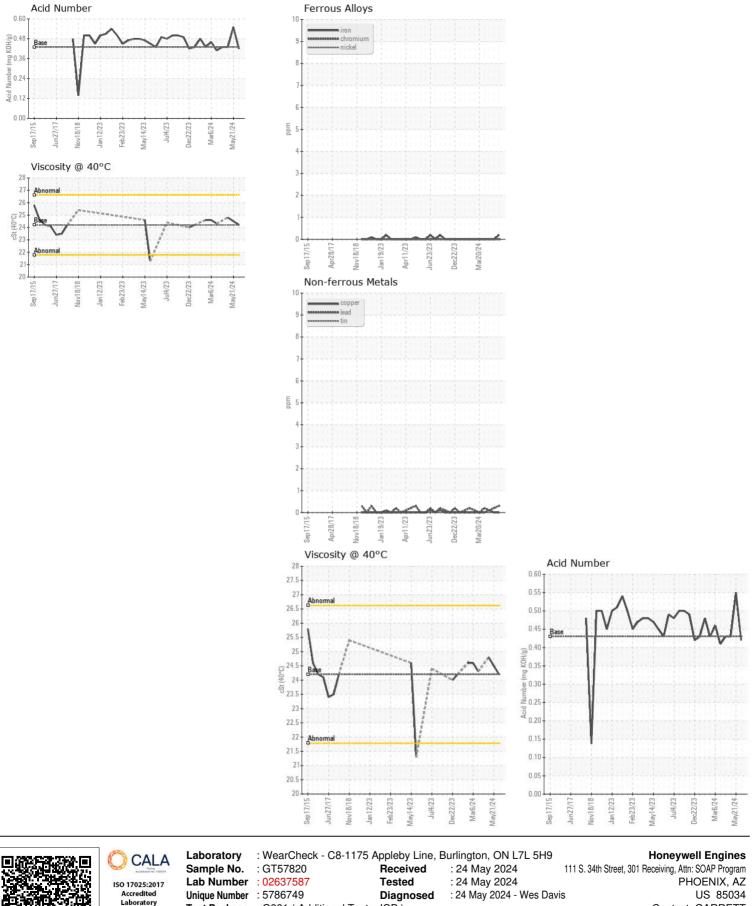

 Laboratory
 Test Package
 : G331 (Additional Tests: ICP)

 To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676

Contact: GARRETT

Contact/Location: GARRETT ? - HONPHO Page 2 of 2