



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
(366970)

Machine Id
LIEBHERR L556 066890-1826

Component
Front Differential

Fluid
PETRO CANADA TRAXON 75W90 SYNTHETIC (42 LTR)

RECOMMENDATION

Confirm the source of the lubricant being utilized for top-up/fill.
Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0281284	LH0276942	LH0265579
Sample Date		Client Info		09 May 2024	18 Jan 2024	03 Nov 2023
Machine Age	hrs	Client Info		12115	10306	9032
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>1000	42	69	81
Chromium	ppm	ASTM D5185(m)	>10	0	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	0	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>5	0	<1	<1
Copper	ppm	ASTM D5185(m)	>100	31	15	28
Tin	ppm	ASTM D5185(m)	>10	1	2	1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	VLITE	VLITE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>100	0	2	3
Potassium	ppm	ASTM D5185(m)	>20	0	<1	0
Water		WC Method	>.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	VLITE	VLITE
Debris	scalar	Visual*	NONE	VLITE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>.2	NEG	NEG	NEG

FLUID CONDITION

Additive levels indicate the addition of a different brand, or type of oil.
The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<1	<1	1
Boron	ppm	ASTM D5185(m)	328	268	24	294
Barium	ppm	ASTM D5185(m)	1	0	0	<1
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		<1	1	<1
Magnesium	ppm	ASTM D5185(m)	1	2	2	<1
Calcium	ppm	ASTM D5185(m)	7	15	7	4
Phosphorus	ppm	ASTM D5185(m)	1145	2441	1746	2495
Zinc	ppm	ASTM D5185(m)	3	23	33	18
Sulfur	ppm	ASTM D5185(m)	17909	19712	16267	20084
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	94.2	80.7	95.4

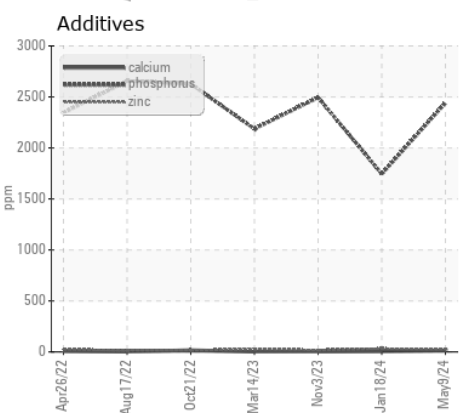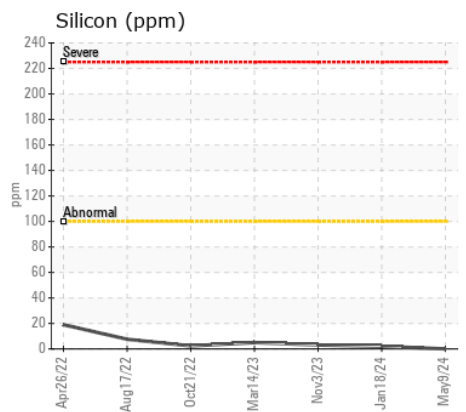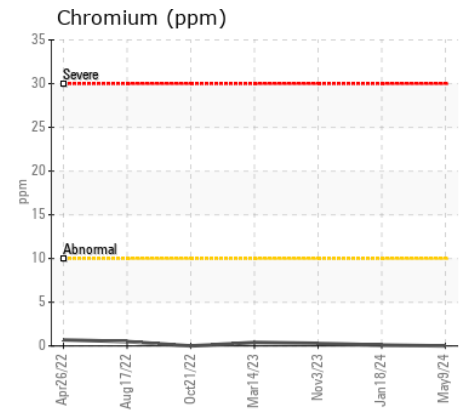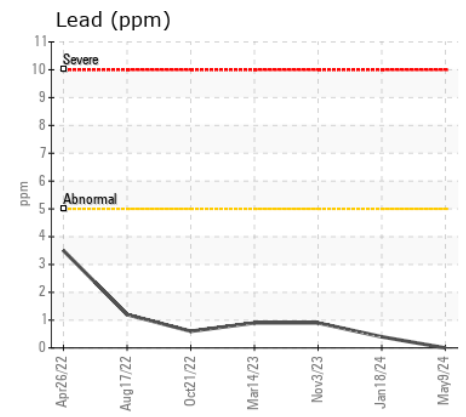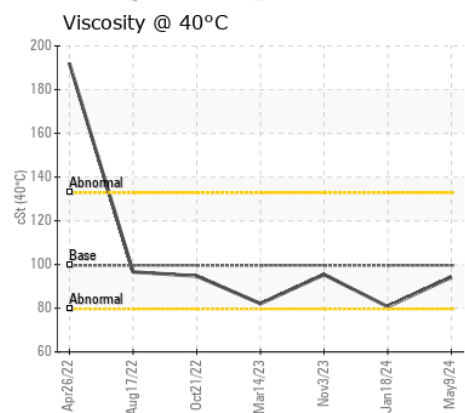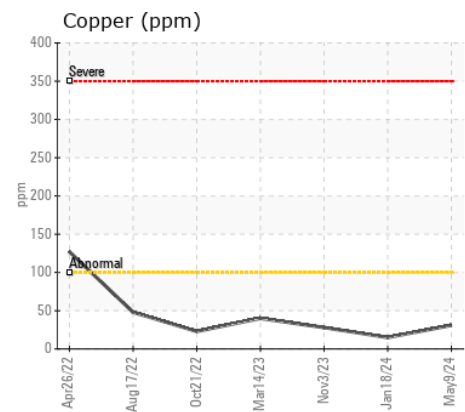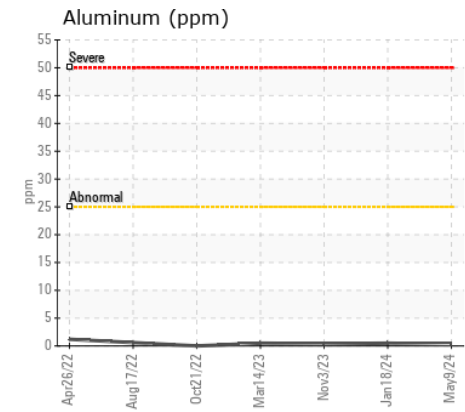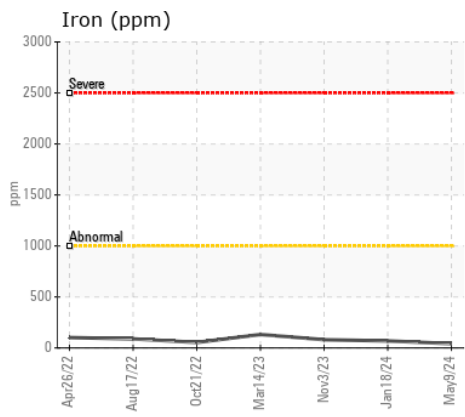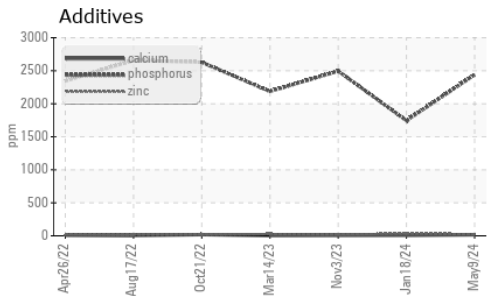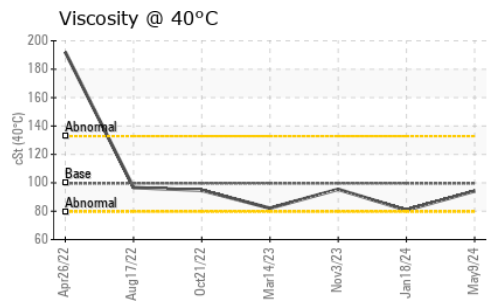

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0281284
Lab Number : 02638561
Unique Number : 5787723
Test Package : MOB 1
Received : 29 May 2024
Tested : 29 May 2024
Diagnosed : 29 May 2024 - Wes Davis

Eacom Timber Corporation
 100 Old Nairn Centre Road
 Nairn Centre, ON
 CA P0M 2L0
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: