

**OIL ANALYSIS REPORT** 

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL

Area


## (C-FJLO) PERIMETER AVIATION [53338]

[C-FJLO] FAIRCHILD SA227AC P-44277C (S/N AC-678)


2 Jet Turbine


EASTMAN TURBO OIL 2380 (--- GAL)


ENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		GT57916	GT56003	GT55975
	Sample Date		Client Info		03 Jun 2024	19 Apr 2024	07 Mar 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		270	179	90
	Filter Age	hrs	Client Info		91	89	90
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status						
	Iron	ppm	ASTM D5185(m)	>8	<1	<1	<1
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	0	0	0
	 Water		WC Method	>0.1	NEG	NEG	NEG
	Magnesium	ppm	ASTM D5185(m)	0	0	<1	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.51	0.49	0.53

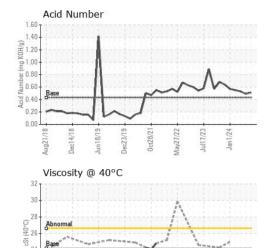


22

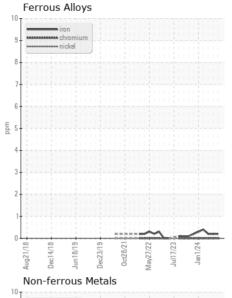

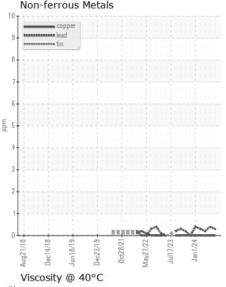

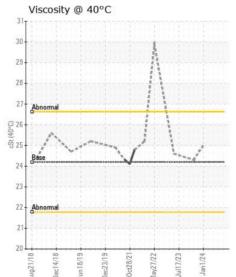

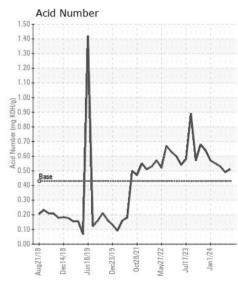



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT57916 Lab Number : 02640057

Unique Number : 5789219

Received **Tested** Diagnosed

: 05 Jun 2024

**Honeywell Engines** 111 S. 34th Street, 301 Receiving, Attn: SOAP Program

PHOENIX, AZ US 85034 Contact: GARRETT

Test Package: G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676