



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
JEEP JEEP TRACKHAWK
 Component
Rear Transmission (Auto)
 Fluid
AMSOIL SYNTHETIC ATF (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0770698	---	---
Sample Date		Client Info		17 Jun 2024	---	---
Machine Age	kms	Client Info		0	---	---
Oil Age	kms	Client Info		0	---	---
Filter Age	kms	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>160	23	---	---
Chromium	ppm	ASTM D5185(m)	>5	0	---	---
Nickel	ppm	ASTM D5185(m)	>5	<1	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)	>5	0	---	---
Aluminum	ppm	ASTM D5185(m)	>50	26	---	---
Lead	ppm	ASTM D5185(m)	>50	0	---	---
Copper	ppm	ASTM D5185(m)	>225	4	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION










There is no indication of any contamination in the fluid.

Silicon	ppm	ASTM D5185(m)	>20	9	---	---
Potassium	ppm	ASTM D5185(m)	>20	1	---	---
Water		WC Method	>0.1	NEG	---	---
Silt	scalar	Visual*	NONE	VLITE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---

FLUID CONDITION

The condition of the fluid is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		14	---	---
Boron	ppm	ASTM D5185(m)		237	---	---
Barium	ppm	ASTM D5185(m)		<1	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		<1	---	---
Magnesium	ppm	ASTM D5185(m)		4	---	---
Calcium	ppm	ASTM D5185(m)		264	---	---
Phosphorus	ppm	ASTM D5185(m)		607	---	---
Zinc	ppm	ASTM D5185(m)		7	---	---
Sulfur	ppm	ASTM D5185(m)		2519	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	32.4	30.1	---	---

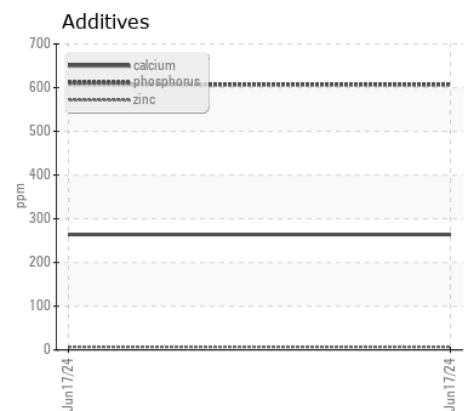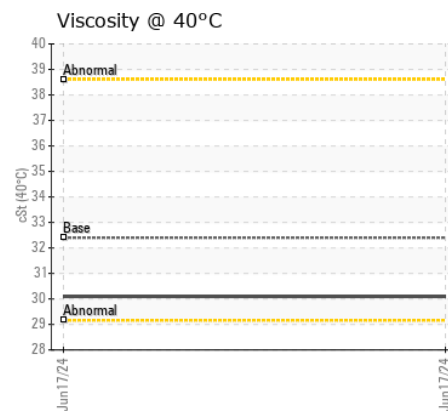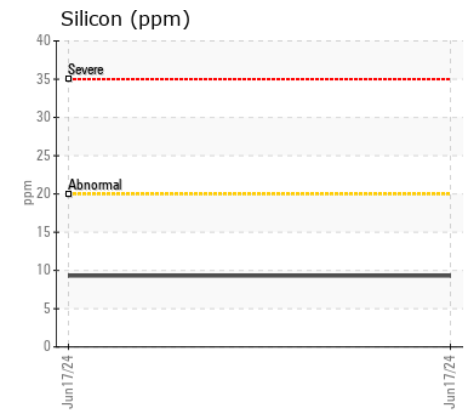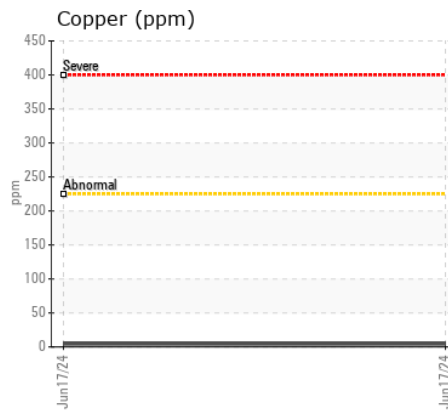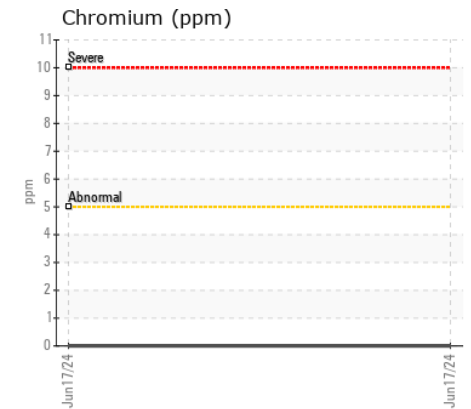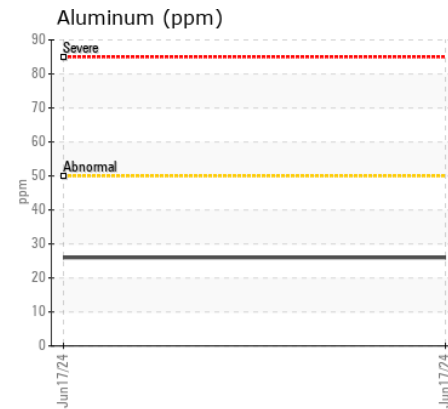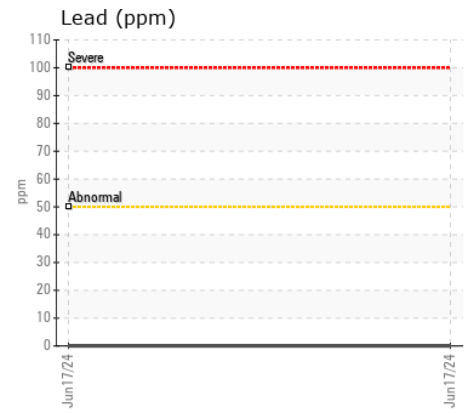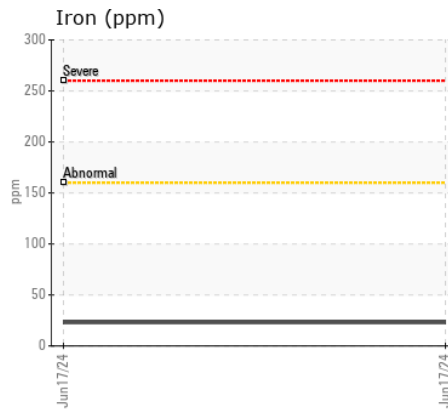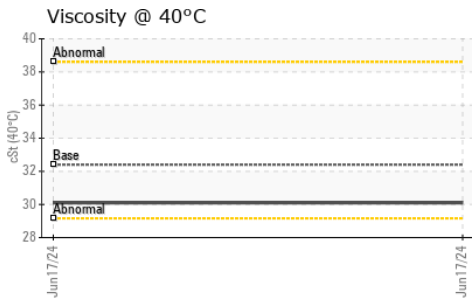

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0770698 **Received** : 18 Jun 2024
Lab Number : 02642624 **Tested** : 18 Jun 2024
Unique Number : 5800163 **Diagnosed** : 19 Jun 2024 - Kevin Marson
Test Package : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

European Automotive
 1239 Plains Rd E
 Burlington, ON
 CA L7S 2K2
 Contact: Jacob Gorski
 info@eaburlington.ca
 T: (905)639-8710
 F: