Honeywell

OIL ANALYSIS REPORT

Area (CFTJC) SKYCARE AIR AMBULANCE [53393] Machine Id [CFTJC] FAIRCHILD SA226 P-54224 (S/N TC-274)

1 Jet Turbine


ESSO EXXON TURBO OIL 2380 (--- GAL)

RECOMMENDATION	
----------------	--

This is a baseline read-out on the submitted sample.

CONTAMINATION
FLUID CONDITION

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GT57959	GT57702	GT57714
Sample Date		Client Info		18 Jun 2024	31 May 2024	13 May 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		563	434	359
Filter Age	hrs	Client Info		69	76	67
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL		NORMAL
Iron	ppm	ASTM D5185(m)	>8	0	0	0
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>3	<1	0	0
Copper	ppm	ASTM D5185(m)	>3	0	0	0
Water		WC Method	>0.1	NEG	NEG	NEG
Magnesium	ppm	ASTM D5185(m)	0.0	0	0	0
Acid Number (AN)	mg KOH/g	ASTM D974*	.38	0.50	0.51	0.52
Visc @ 40°C	cSt	ASTM D7279(m)	24.1	24.4		24.1

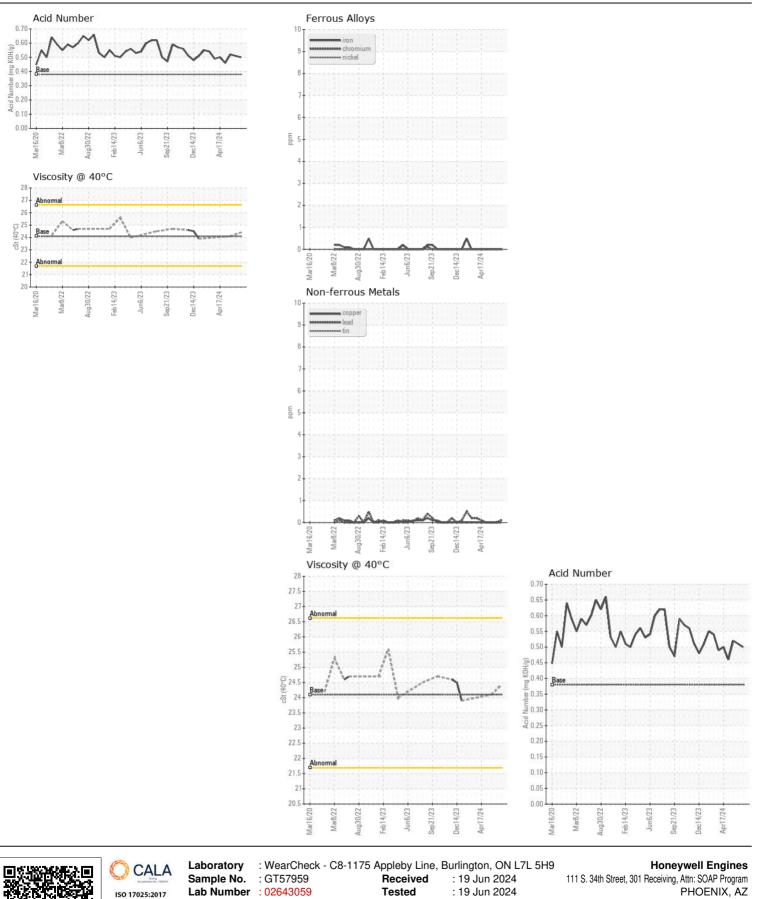

 Accredited Laboratory
 Unique Number
 : 5800598
 Diagnosed
 : 19 Jun 2024 - Wes Davis

 To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

 Validity of results and interpretation are based on the sample and information as supplied.

Contact: GARRETT T:

F: (602)365-2676

US 85034

Contact/Location: GARRETT ? - HONPHO Page 2 of 2