



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	MARGINAL
FLUID CONDITION	NORMAL

Machine Id
1610 DERSAN STREET
 Component
Diesel Engine
 Fluid
PETRO CANADA XR 4 SAE 15W40 (--- LTR)

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0940153	WC0810822	---
Sample Date		Client Info		23 May 2024	06 Jun 2023	---
Machine Age	hrs	Client Info		0	0	---
Oil Age	hrs	Client Info		0	0	---
Filter Age	hrs	Client Info		0	0	---
Oil Changed		Client Info		N/A	N/A	---
Filter Changed		Client Info		N/A	N/A	---
Sample Status				MARGINAL	ATTENTION	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	2	2	---
Chromium	ppm	ASTM D5185(m)	>20	0	0	---
Nickel	ppm	ASTM D5185(m)	>4	0	0	---
Titanium	ppm	ASTM D5185(m)		<1	8	---
Silver	ppm	ASTM D5185(m)	>3	<1	0	---
Aluminum	ppm	ASTM D5185(m)	>20	<1	2	---
Lead	ppm	ASTM D5185(m)	>40	<1	<1	---
Copper	ppm	ASTM D5185(m)	>330	<1	2	---
Tin	ppm	ASTM D5185(m)	>15	0	0	---
Vanadium	ppm	ASTM D5185(m)		0	<1	---

CONTAMINATION











Light fuel dilution occurring. No other contaminants were detected in the oil.

Silicon	ppm	ASTM D5185(m)	>25	11	4	---
Potassium	ppm	ASTM D5185(m)	>20	<1	1	---
Fuel	%	ASTM D7593*	>5	▲ 2.2	▲ 2.5	---
Water		WC Method	>0.2	NEG	NEG	---
Glycol		WC Method		NEG	NEG	---
Soot %	%	ASTM D7844*	>3	0	0	---
Nitration	Abs/cm	ASTM D7624*	>20	5.3	5.2	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	18.7	21.4	---
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	---

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		1	2	---
Boron	ppm	ASTM D5185(m)	1	27	● 410	---
Barium	ppm	ASTM D5185(m)	1	0	0	---
Molybdenum	ppm	ASTM D5185(m)	1	60	74	---
Manganese	ppm	ASTM D5185(m)		0	<1	---
Magnesium	ppm	ASTM D5185(m)	10	919	● 419	---
Calcium	ppm	ASTM D5185(m)	3032	1078	● 1490	---
Phosphorus	ppm	ASTM D5185(m)	1054	998	1087	---
Zinc	ppm	ASTM D5185(m)	1332	1172	1138	---
Sulfur	ppm	ASTM D5185(m)	3985	2767	2879	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	14.0	15.9	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	12.1	12.9	---

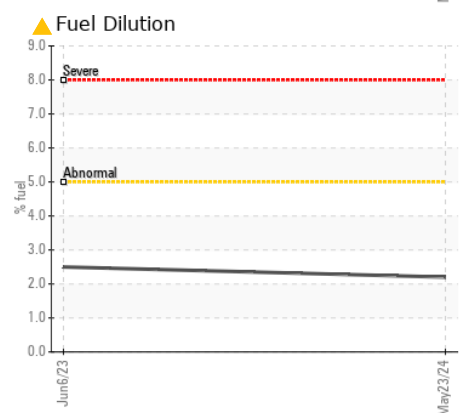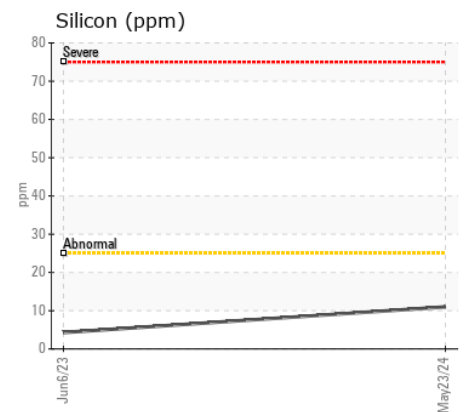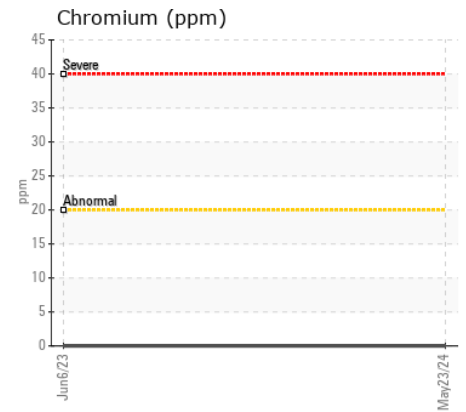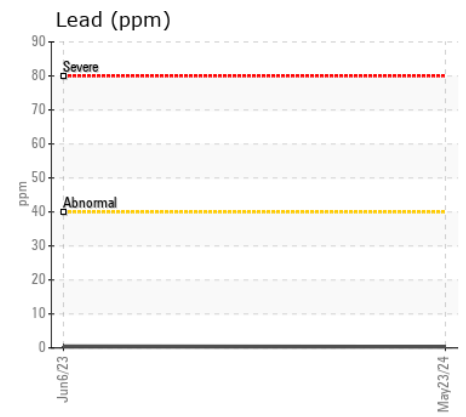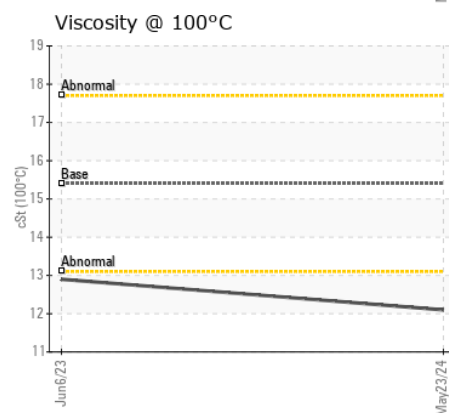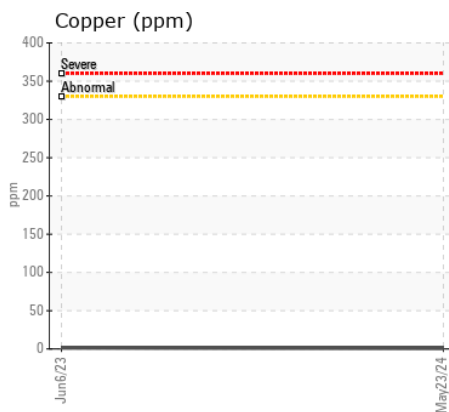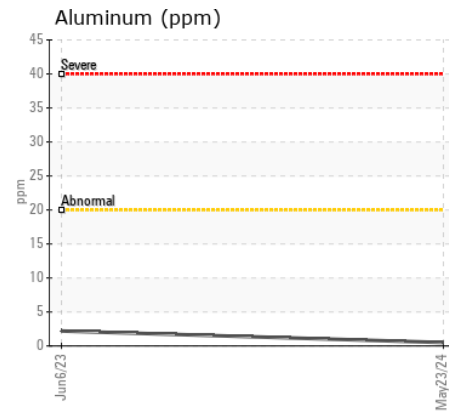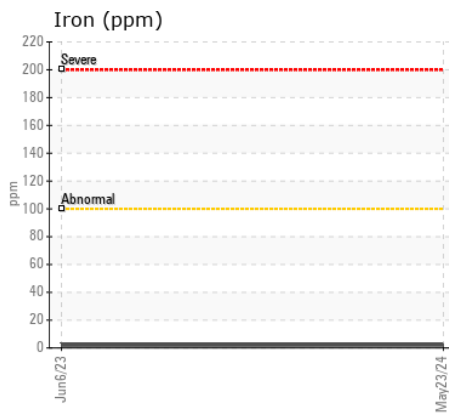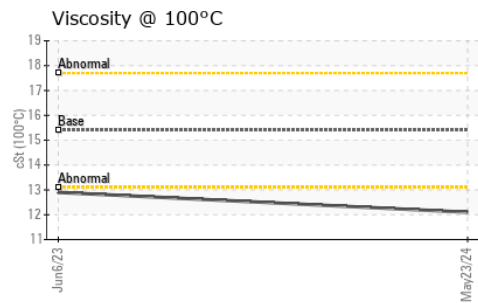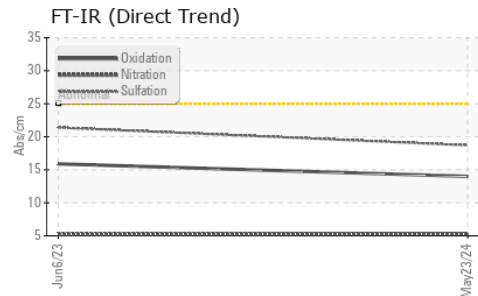

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0940153 **Received** : 20 Jun 2024
Lab Number : 02643154 **Tested** : 21 Jun 2024
Unique Number : 5800693 **Diagnosed** : 21 Jun 2024 - Wes Davis
Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel)

NORTHERN GENERATOR CO. LTD.
 80 ASHBRIDGE CIRCLE., UNIT #1 & 2
 WOODBRIDGE, ON
 CA L4L 3R5
 Contact: Selome Afework
 selome@northerngenerator.com
 T: (905)264-9744
 F: (905)264-9714

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.