



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
NOVA BUS 170
 Component
Rear Diesel Engine
 Fluid
ESSO XD-3 EXTRA 15W40 (--- LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0866482	WC0888987	WC0889089
Sample Date		Client Info		07 Jun 2024	16 Apr 2024	10 Jan 2024
Machine Age	kms	Client Info		0	0	0
Oil Age	kms	Client Info		8431	8880	9092
Filter Age	kms	Client Info		8431	8880	9092
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	MARGINAL	SEVERE

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	18	19	19
Chromium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	2	1	1
Lead	ppm	ASTM D5185(m)	>40	0	0	<1
Copper	ppm	ASTM D5185(m)	>330	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	5	4	4
Potassium	ppm	ASTM D5185(m)	>20	8	8	5
Fuel		WC Method	>5	<1.0	▲ 3.6	▲ 10.7
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	1.8	1.2	1.2
Nitration	Abs/cm	ASTM D7624*	>20	11.3	11.6	11.9
Sulfation	Abs/.1mm	ASTM D7415*	>30	28.3	28.2	28.0
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>192	9	11	8
Boron	ppm	ASTM D5185(m)		51	47	43
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		<1	<1	<1
Manganese	ppm	ASTM D5185(m)		<1	0	0
Magnesium	ppm	ASTM D5185(m)		15	24	14
Calcium	ppm	ASTM D5185(m)	3780	2201	2169	2022
Phosphorus	ppm	ASTM D5185(m)	1370	941	916	863
Zinc	ppm	ASTM D5185(m)	1500	1157	1128	1018
Sulfur	ppm	ASTM D5185(m)	3800	2770	2683	2683
Oxidation	Abs/.1mm	ASTM D7414*	>25	23.2	24.2	24.6
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	15.0	14.1	▲ 12.1

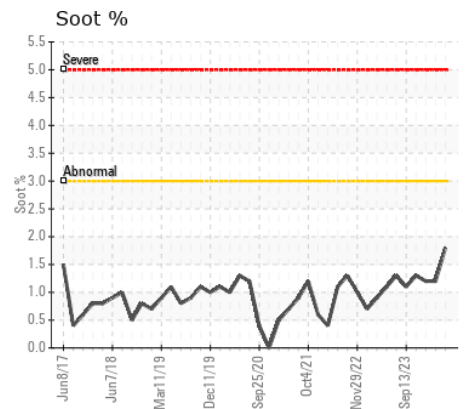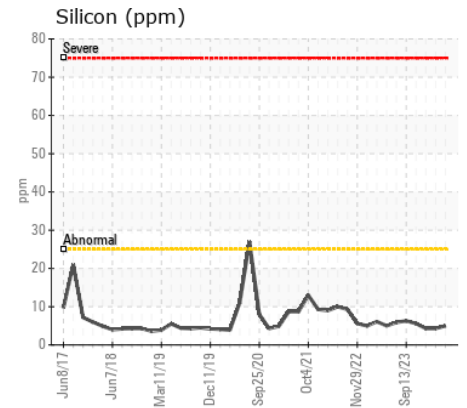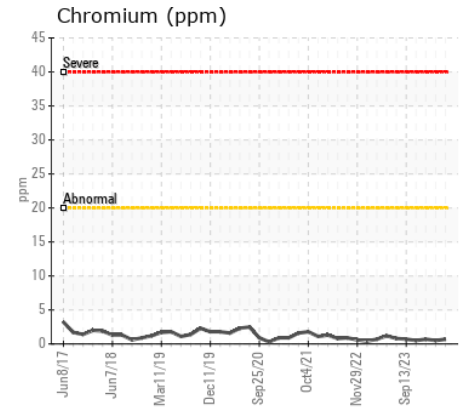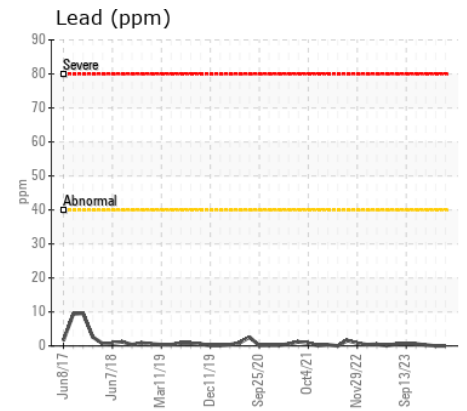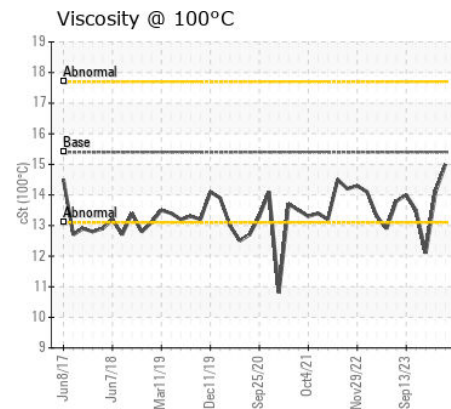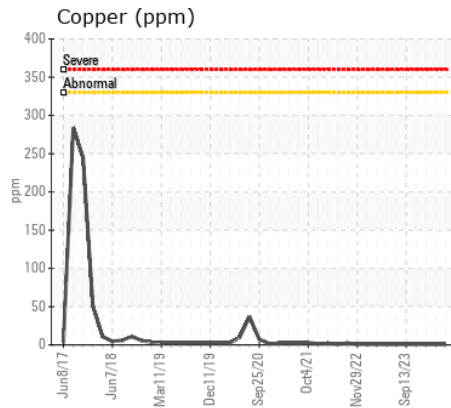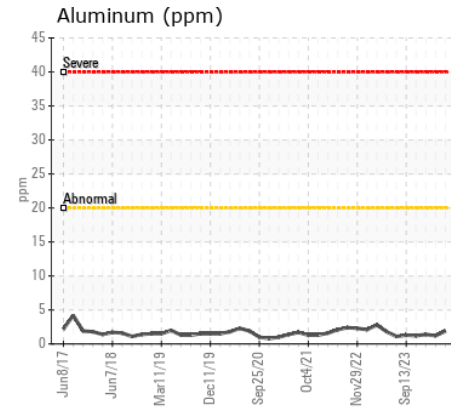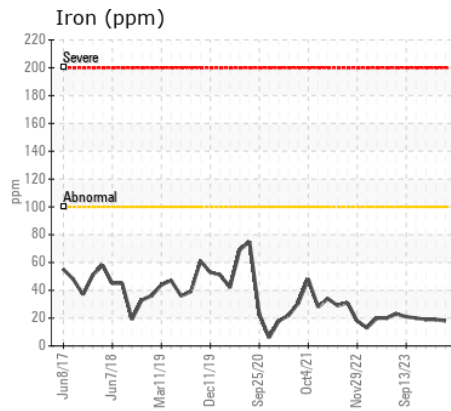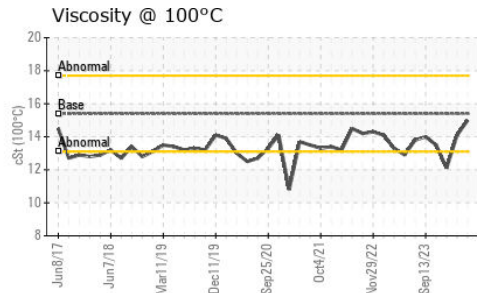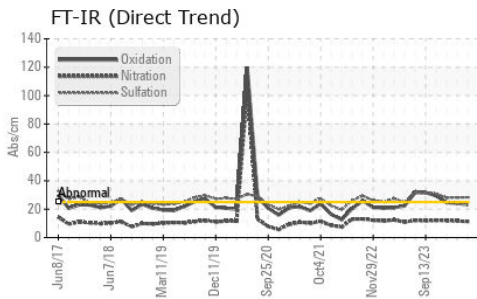

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0866482
Lab Number : 02643649
Unique Number : 5801188
Test Package : MOB 1

Received : 24 Jun 2024
Tested : 24 Jun 2024
Diagnosed : 24 Jun 2024 - Wes Davis

CITY OF THUNDER BAY
 AUTO MAINTENANCE STORES, 570 FORT WILLIAM ROAD
 THUNDER BAY, ON
 CA P7B 2Z8
 Contact: Sean Malcolm
 sean.malcolm@thunderbay.ca
 T: (807)684-2716
 F: (807)344-0237

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.