

OIL ANALYSIS REPORT

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL NORMAL


Aroo.

(CGCPX) SKYCARE AIR AMBULANCE [53413] [CGCPX] FAIRCHILD SA226 P-54101C (S/N TC274)

Left Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT57960	GT58023	GT57712
	Sample Date		Client Info		24 Jun 2024	04 Jun 2024	18 May 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		722	650	579
	Filter Age	hrs	Client Info		72	71	58
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL	NORMAL	NORMAL
WEAR	Iron	ppm	ASTM D5185(m)	>8	0	<1	<1
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	0	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	<1	<1	<1
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.55	0.57	0.51
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.4	24.3	24.5

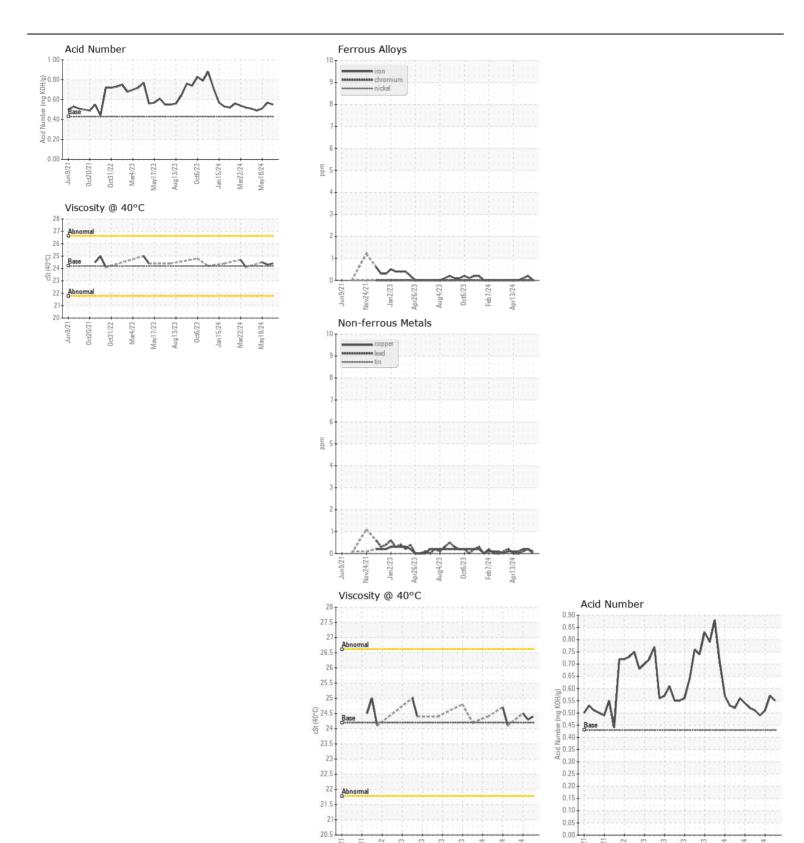





Laboratory Sample No.

: GT57960

Lab Number : 02644079 Unique Number : 5801618

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received **Tested**

Diagnosed

: 25 Jun 2024 : 25 Jun 2024

: 25 Jun 2024 - Wes Davis

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ

US 85034 Contact: GARRETT

Test Package: G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676