

**OIL ANALYSIS REPORT** 

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL NORMAL

Area


SKYCARE AIR AMBULANCE [53416]


FAIRCHILD SA227 P-44197 (S/N AC-594)

Right Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT58053	GT58049	GT57809
	Sample Date		Client Info		21 Jun 2024	05 Jun 2024	25 May 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		541	479	423
	Filter Age	hrs	Client Info		63	56	72
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL	NORMAL	
WEAR	Iron	ppm	ASTM D5185(m)	>8	0	0	<1
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	0	0	0
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.67	0.62	0.58
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.7	24.7	

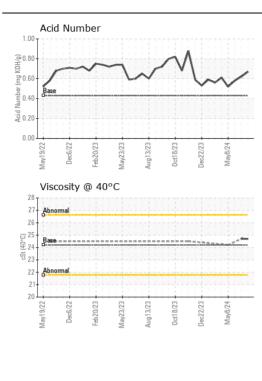

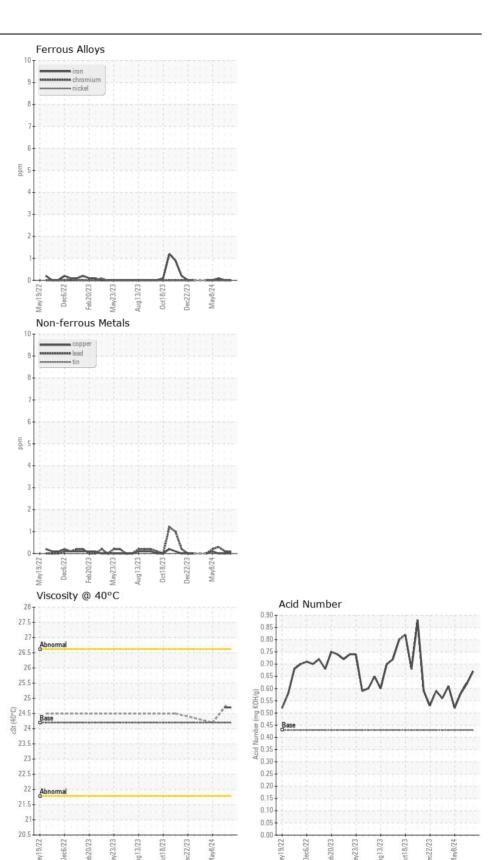





Laboratory Sample No.

: GT58053 Lab Number : 02644283

Unique Number : 5801822

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received **Tested** 

: 26 Jun 2024 : 26 Jun 2024 Diagnosed

: 26 Jun 2024 - Wes Davis

**Honeywell Engines** 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ US 85034

Contact: GARRETT

Test Package: G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (602)365-2676

Contact/Location: GARRETT ? - HONPHO

T: