



WEAR	NORMAL
CONTAMINATION	SEVERE
FLUID CONDITION	NORMAL



Machine Id
VZ7692
Component
Hydraulic System
Fluid
{not provided} (--- GAL)

RECOMMENDATION

Vérifier les scelles et/ou les filtres pour des points d'entrée des contaminants. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessiccant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Nous recommandons le remplacement des filtres de ce composant. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation. Veuillez préciser la marque, le type et la viscosité de l'huile lors de votre prochain échantillon.

WEAR

Les taux d'usure de tous les composants sont normaux.








CONTAMINATION

Il y a une grande quantité de limon (particules de 4 à 14 microns) dans l'huile.

FLUID CONDITION

La viscosité de l'échantillon se situe dans la portée de l'ATF; nous vous conseillons de vérifier. l'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0119720	---	---
Sample Date		Client Info		17 Jun 2024	---	---
Machine Age	kms	Client Info		28154	---	---
Oil Age	kms	Client Info		0	---	---
Filter Age	kms	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				SEVERE	---	---
Iron	ppm	ASTM D5185(m)	>40	2	---	---
Chromium	ppm	ASTM D5185(m)	>5	0	---	---
Nickel	ppm	ASTM D5185(m)	>2	<1	---	---
Titanium	ppm	ASTM D5185(m)	>2	0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>8	<1	---	---
Lead	ppm	ASTM D5185(m)	>5	0	---	---
Copper	ppm	ASTM D5185(m)	>20	<1	---	---
Tin	ppm	ASTM D5185(m)	>2	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Silicon	ppm	ASTM D5185(m)	>20	<1	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---
Water		WC Method	>0.1	NEG	---	---
Particles >4µm		ASTM D7647	>5000	▲ 42208	---	---
Particles >6µm		ASTM D7647	>1300	▲ 4293	---	---
Particles >14µm		ASTM D7647	>160	45	---	---
Particles >21µm		ASTM D7647	>40	8	---	---
Particles >38µm		ASTM D7647	>10	0	---	---
Particles >71µm		ASTM D7647	>3	0	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 23/19/13	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Sodium	ppm	ASTM D5185(m)		<1	---	---
Boron	ppm	ASTM D5185(m)		3	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		2	---	---
Calcium	ppm	ASTM D5185(m)		611	---	---
Phosphorus	ppm	ASTM D5185(m)		206	---	---
Zinc	ppm	ASTM D5185(m)		55	---	---
Sulfur	ppm	ASTM D5185(m)		1068	---	---
Visc @ 40°C	cSt	ASTM D7279(m)		32.7	---	---

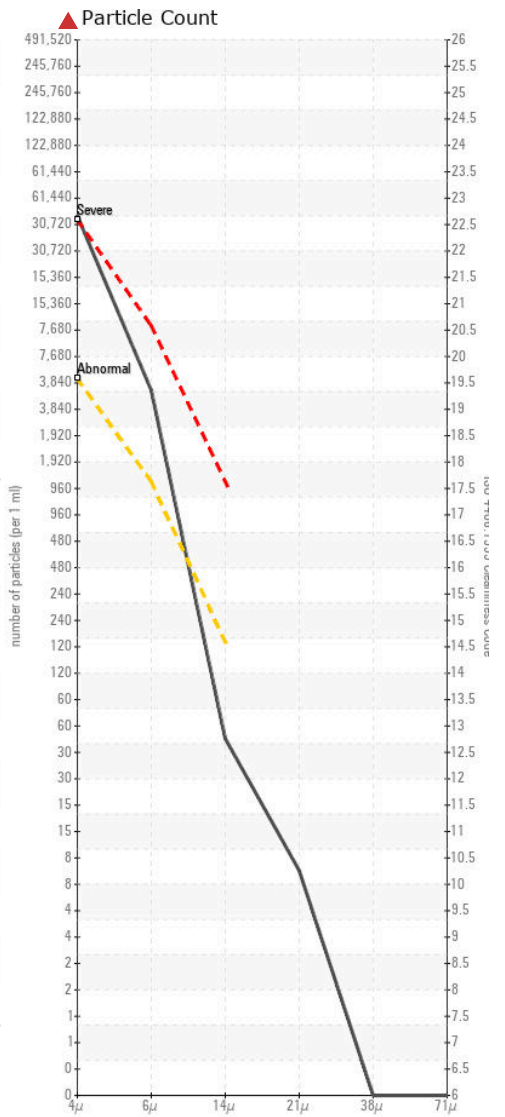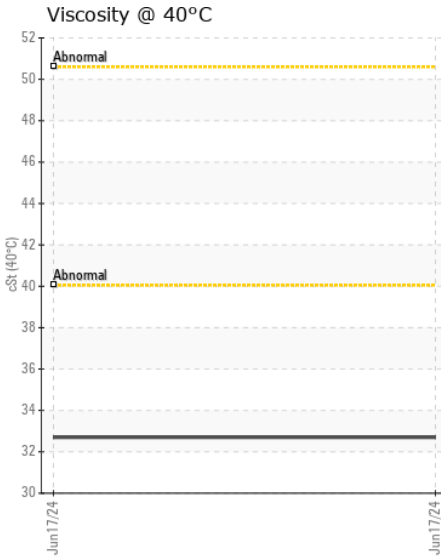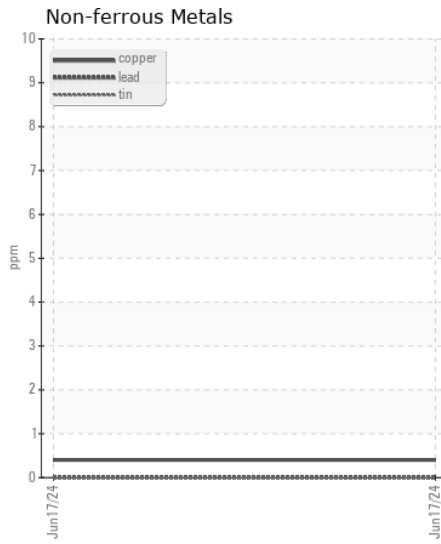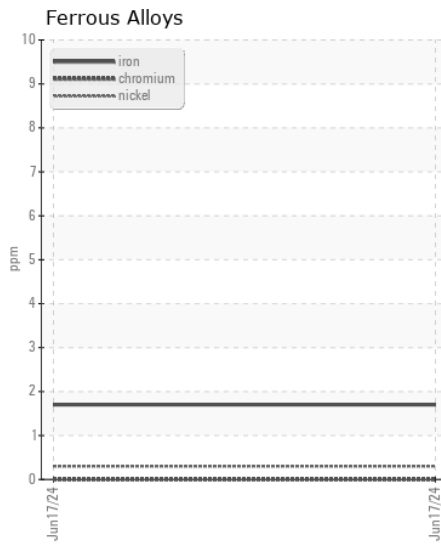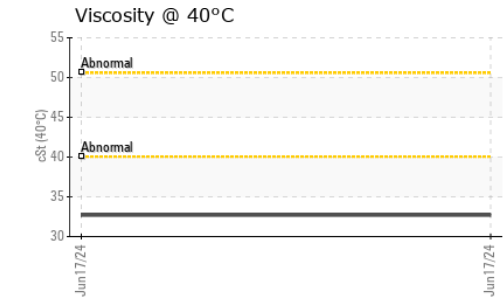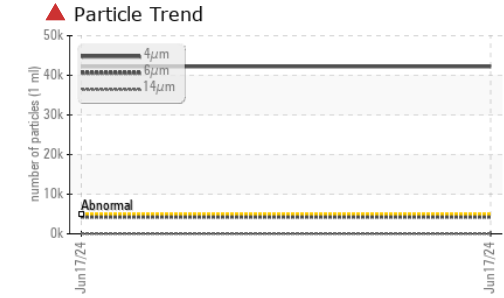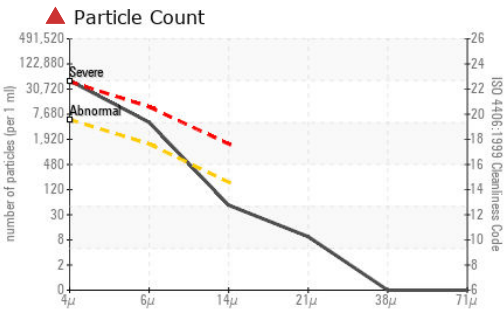

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0119720
Lab Number : 02645277
Unique Number : 5802816
Test Package : MOB 1 (Additional Tests: PrtCount)

GFL Environmental - 780 - GMA - ICI - Solid Waste
 4365 boul. St-Elzear Ouest,
 Laval, QC
 CA H7P 4J3
 Contact: Pieces Laval
 pieces.laval@gflenv.com
 T: (450)687-3838
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.