



JOHN DEERE 210G 528252

Component Pump Drive Fluid

DIESEL ENGINE OIL SAE 15W40 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		MT0005890		
Resample at the next service interval to monitor.	Sample Date		Client Info		09 Mar 2023		
	Machine Age	hrs	Client Info		1990		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	PQ		ASTM D8184		7		
All component wear rates are normal.	Iron	ppm	ASTM D5185m	>151	11		
	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>21	2		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		<1		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m		8		
	Potassium	ppm	ASTM D5185m		2		
	Water		WC Method		NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor Emulsified Water	scalar	*Visual	NORML	NORML NEG		
		scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m	>158	<1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	250	239		
	Barium	ppm	ASTM D5185m	10	0		
	Molybdenum	ppm	ASTM D5185m	100	213		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m	450	783		
	Calcium	ppm	ASTM D5185m	3000	1334		
					000		
	Phosphorus	ppm	ASTM D5185m	1150	806		
	Phosphorus Zinc	ppm ppm	ASTM D5185m ASTM D5185m		986		
	-			1350			


Visc @ 40°C


cSt

ASTM D445 115

Contact/Location: DUSTIN DAILEY - MURCAM

113

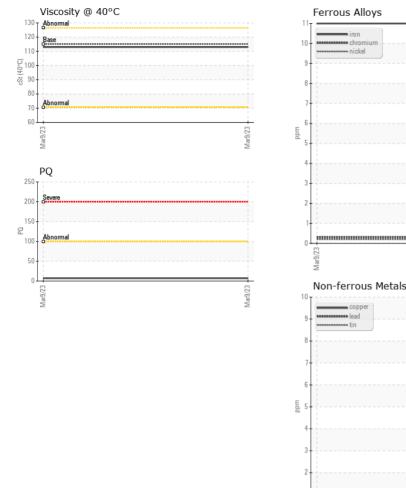

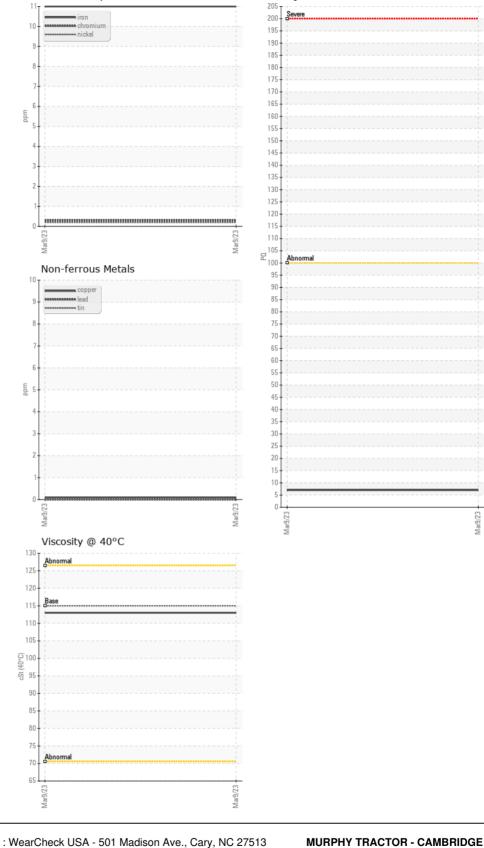

PQ



Unique Number : 10375925 Diagnostician : Sean Felton Test Package : CONST (Additional Tests: PQ) Contact: DUSTIN DAILEY DDAILEY@MURPHYTRACTOR.COM To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Recieved

Diagnosed

: 14 Mar 2023

: 16 Mar 2023

11!

40°C) 100

: MT0005890

: 05791254

Report Id: MURCAM [WUSCAR] 05791254 (Generated: 02/07/2024 09:14:50) Rev: 1

Contact/Location: DUSTIN DAILEY - MURCAM

Page 2 of 2

60611 HULSE DRIVE

CAMBRIDGE, OH

F: (740)439-2325

US 43725

T: