


WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**

Machine Id **96624**

96624							
Component Diesel Engine							
{not provided} (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		WC05828598		
	Sample Date		Client Info		24 Apr 2023		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR All component wear rates are normal.	Iron	ppm	ASTM D5185m	>100	11		
	Chromium	ppm	ASTM D5185m	>20	<1		
	Nickel	ppm	ASTM D5185m	>4	0		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m	>3	<1		
	Aluminum	ppm	ASTM D5185m	>20	0		
	Lead	ppm	ASTM D5185m	>40	4		
	Copper	ppm	ASTM D5185m	>330	32		
	Tin	ppm	ASTM D5185m	>15	1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION							
	Silicon	ppm	ASTM D5185m		13		
Fuel content negligible. There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		13		
	Fuel	%	ASTM D3524		0.4		
	Water		WC Method	>0.2	NEG		
	Glycol	0/	WC Method	0	NEG		
	Soot %	%	*ASTM D7844		0		
	Nitration	Abs/dm	*ASTM D7624	>20	6.6		
	Sulfation	Abs/.1mm	*ASTM D7415		18.7		
	Silt Debris	scalar	*Visual	NONE	NONE NONE		
		scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar scalar	*Visual	NONE	NORML		
	Appearance Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water		*Visual	>0.2	NEG		
	Lindisinca Water		· · · · · · · · · · · · · · · · · · ·				
FLUID CONDITION	Sodium	ppm	ASTM D5185m		4		
The DNI was all the Break at the Adenna to a Mark be a Health to a was to be a local	Boron	ppm	ASTM D5185m		62		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m		19		
	Molybdenum	ppm	ASTM D5185m		34		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m		654		
	Calcium	ppm	ASTM D5185m		1388		
	Phosphorus	ppm	ASTM D5185m		943		
	Zinc	ppm	ASTM D5185m		1071		
	Sulfur	ppm	ASTM D5185m		3123		
	Oxidation	Abs/.1mm	*ASTM D7414	>25	15.1		
	Base Number (BN)		ASTM D2896		9.2		
	Visc @ 100°C	cSt	ASTM D445		12.2		



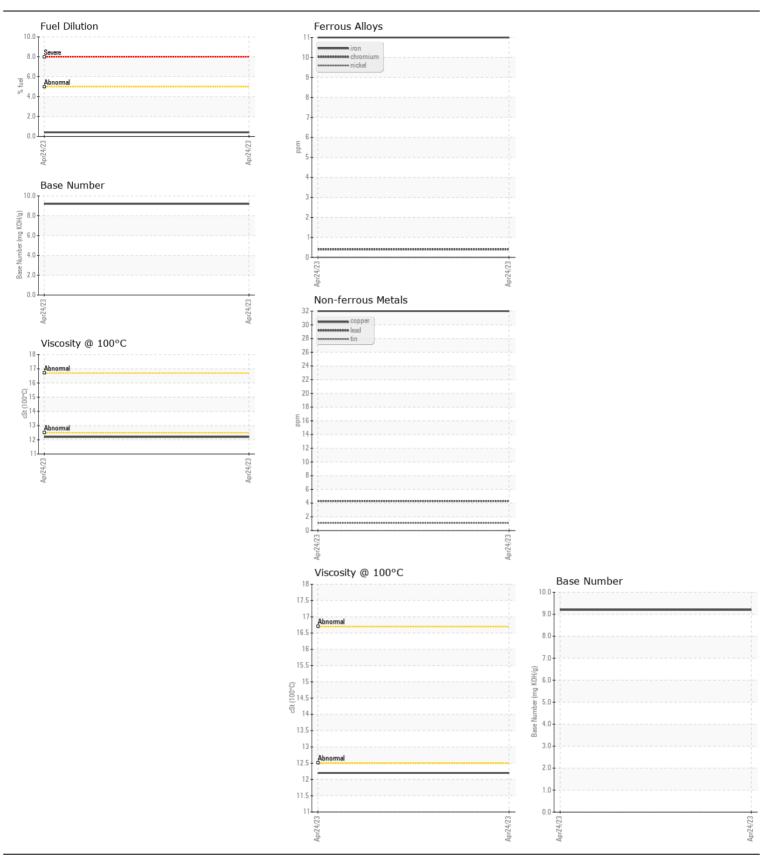



Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: WC05828598 Lab Number : 05828598 Unique Number : 10442091

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Received **Tested** Diagnosed

: 26 Apr 2023

: 26 Apr 2023 - Wes Davis Test Package: CONST (Additional Tests: FuelDilution, PercentFuel, TBN)

: 25 Apr 2023

GRAHAM, NC US 27253-9215 Contact: MICHAEL LAWSON michaell@bucknercompanies.com

T: (336)376-8888

BUCKNER HEAVY LIFT

4732 NC 54 EAST

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (336)376-4090 Contact/Location: MICHAEL LAWSON - BUCGRA