



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	SEVERE
FLUID CONDITION	ABNORMAL

Machine Id
PA3TA2062
 Component
Diesel Engine
 Fluid
WOLFS HEAD 15W40 (--- GAL)

RECOMMENDATION

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		KT0000858	---	---
Sample Date		Client Info		11 Oct 2023	---	---
Machine Age	hrs	Client Info		52	---	---
Oil Age	hrs	Client Info		52	---	---
Filter Age	hrs	Client Info		52	---	---
Oil Changed		Client Info		Not Changd	---	---
Filter Changed		Client Info		Not Changd	---	---
Sample Status				SEVERE	---	---

WEAR

Metal levels are typical for a components first oil change.

Iron	ppm	ASTM D5185m	>100	18	---	---
Chromium	ppm	ASTM D5185m	>20	<1	---	---
Nickel	ppm	ASTM D5185m	>4	<1	---	---
Titanium	ppm	ASTM D5185m		<1	---	---
Silver	ppm	ASTM D5185m	>3	0	---	---
Aluminum	ppm	ASTM D5185m	>20	6	---	---
Lead	ppm	ASTM D5185m	>40	<1	---	---
Copper	ppm	ASTM D5185m	>330	4	---	---
Tin	ppm	ASTM D5185m	>15	1	---	---
Vanadium	ppm	ASTM D5185m		<1	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION









There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Silicon	ppm	ASTM D5185m	>25	9	---	---
Potassium	ppm	ASTM D5185m	>20	5	---	---
Fuel	%	ASTM D3524	>5	▲ 11.6	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	*ASTM D7844	>3	0	---	---
Nitration	Abs/cm	*ASTM D7624	>20	5.7	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	18.3	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

Sodium	ppm	ASTM D5185m		2	---	---
Boron	ppm	ASTM D5185m		191	---	---
Barium	ppm	ASTM D5185m		10	---	---
Molybdenum	ppm	ASTM D5185m		1	---	---
Manganese	ppm	ASTM D5185m		<1	---	---
Magnesium	ppm	ASTM D5185m		31	---	---
Calcium	ppm	ASTM D5185m		1781	---	---
Phosphorus	ppm	ASTM D5185m		795	---	---
Zinc	ppm	ASTM D5185m		990	---	---
Sulfur	ppm	ASTM D5185m		3385	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	14.0	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		9.1	---	---
Visc @ 100°C	cSt	ASTM D445		▲ 10.8	---	---

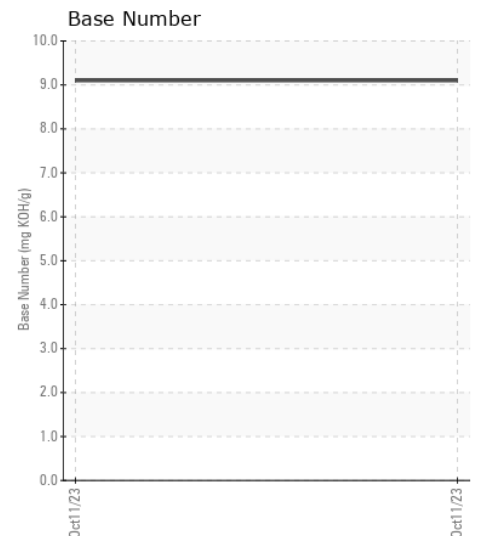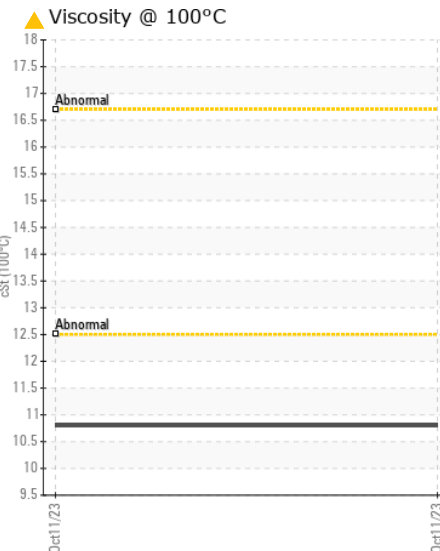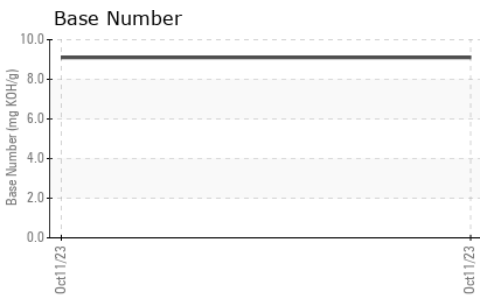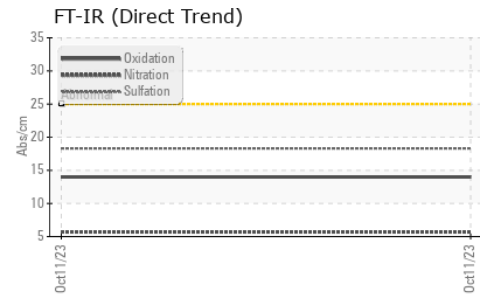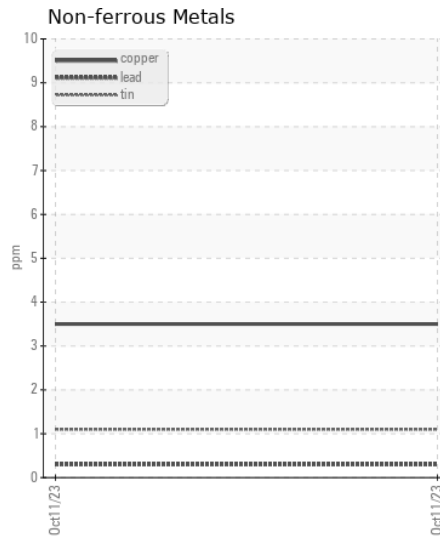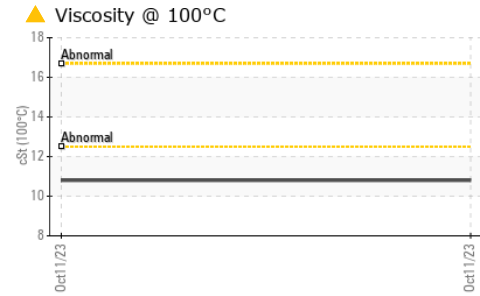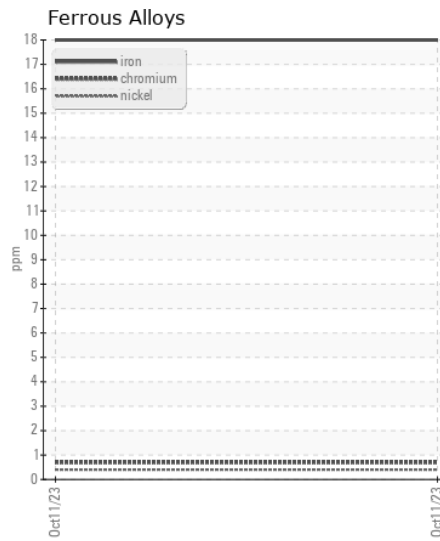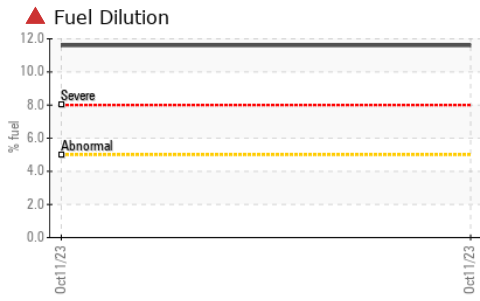

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KT0000858 **Received** : 17 Oct 2023
Lab Number : 05981800 **Tested** : 19 Oct 2023
Unique Number : 10699095 **Diagnosed** : 19 Oct 2023 - Wes Davis
Test Package : CONST (Additional Tests: FuelDilution, PercentFuel, TBN)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

GENERAL AUTO PARTS
 804 W MLK JR BLVD
 BROOKSVILLE, FL
 US 34601
 Contact: Service Manager
 generalauto52@gmail.com
 T: (352)796-2522
 F: