
**WEAR** CONTAMINATION **FLUID CONDITION**  **NORMAL NORMAL NORMAL** 

Machine Id 2327

Component Diesel Engine							
ROYAL PURPLE MOTOR OIL 15W40 ( QTS)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the component make and model with your next sample.	Sample Number		Client Info		WC0720152		
	Sample Date		Client Info		19 Dec 2023		
	Machine Age	mls	Client Info		178274		
	Oil Age	mls	Client Info		50000		
	Filter Age	mls	Client Info		50000		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>100	42		
	Chromium	ppm	ASTM D5185m	>20	2		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m	>4	<1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>3	<1		
	Aluminum	ppm	ASTM D5185m		16		
	Lead	ppm	ASTM D5185m	>40	<1		
	Copper	ppm	ASTM D5185m	>330	35		
	Tin	ppm	ASTM D5185m	>15	<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m		10		
	Potassium	ppm	ASTM D5185m		40		
	Fuel		WC Method	>5	<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method	-	NEG		
	Soot %	%	*ASTM D7844		0.8		
	Nitration	Abs/cm	*ASTM D7624	>20	9.6		
	Sulfation	Abs/.1mm	*ASTM D7415		23.4		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		3		
	Boron	ppm	ASTM D5185m	0	0		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m	60	37		
	Calcium	ppm	ASTM D5185m		2591		
	Phosphorus	ppm	ASTM D5185m		989		
	Zinc	ppm	ASTM D5185m		1239		
	Sulfur	ppm	ASTM D5185m	12500	3362		
	Oxidation	Abs/.1mm	*ASTM D7414		16.1		
	Base Number (BN)		ASTM D2896	10.5	5.3		
	Visc @ 100°C	cSt	ASTM D445	14.9	13.1		





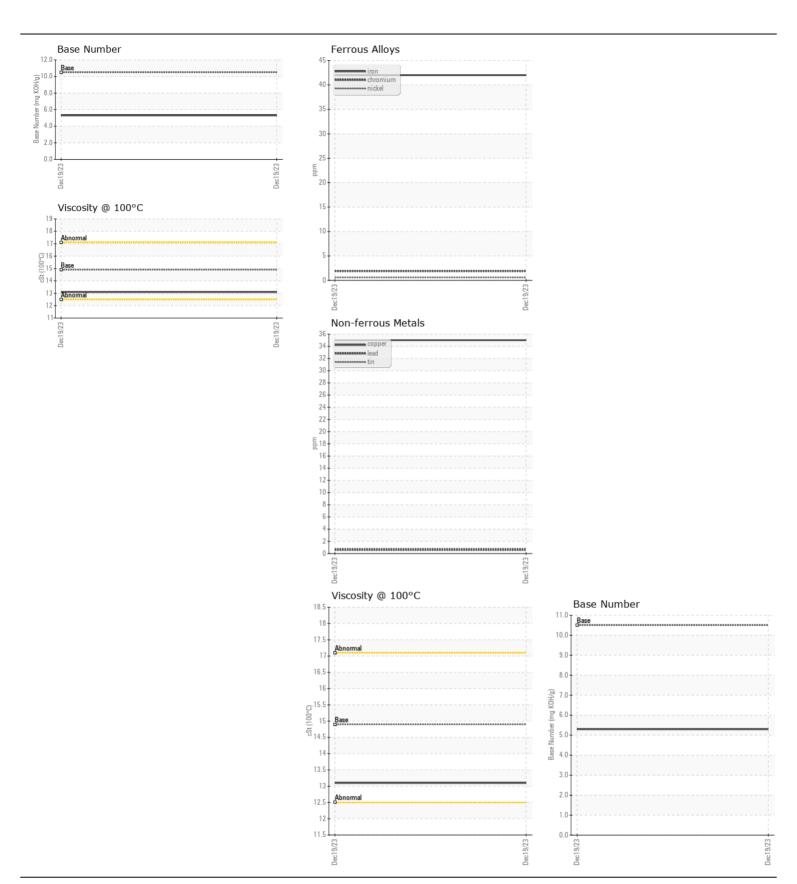

Laboratory Sample No. Lab Number **Unique Number** 

: WC0720152 : 06054696 : 10820645 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 08 Jan 2024 : 09 Jan 2024 Diagnosed : Wes Davis Diagnostician

**DILLON TRANSPORTATION** 974 TN WALTZ PARKWAY ASHLAND CITY, TN US 37015

Contact: MASON NICHOLSON M.NICHOLSON@DILLONTRANSPORTATION.COM

T: (615)792-5099

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (615)469-4200