



| | |
|-----------------|---------------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Machine Id
912077
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 15W40 (40 GAL)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | GFL0099011 | GFL0099004 | GFL0098952 |
| Sample Date | | Client Info | | 28 Dec 2023 | 06 Dec 2023 | 21 Nov 2023 |
| Machine Age | hrs | Client Info | | 5496 | 5330 | 5214 |
| Oil Age | hrs | Client Info | | 5330 | 4761 | 4761 |
| Filter Age | hrs | Client Info | | 0 | 0 | 0 |
| Oil Changed | | Client Info | | N/A | Changed | N/A |
| Filter Changed | | Client Info | | None | Changed | None |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|--------------|------|------|
| Iron | ppm | ASTM D5185m | >100 | 5 | 22 | 16 |
| Chromium | ppm | ASTM D5185m | >20 | <1 | <1 | <1 |
| Nickel | ppm | ASTM D5185m | >4 | 2 | 4 | 2 |
| Titanium | ppm | ASTM D5185m | | 0 | <1 | 0 |
| Silver | ppm | ASTM D5185m | >3 | 0 | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | 2 | 2 | 2 |
| Lead | ppm | ASTM D5185m | >40 | <1 | <1 | 0 |
| Copper | ppm | ASTM D5185m | >330 | <1 | 4 | 2 |
| Tin | ppm | ASTM D5185m | >15 | <1 | <1 | 0 |
| Vanadium | ppm | ASTM D5185m | | <1 | 0 | 0 |
| White Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | NONE |

CONTAMINATION







There is no indication of any contamination in the oil.

| | | | | | | |
|------------------|----------|-------------|-------|----------------|-------|-------|
| Silicon | ppm | ASTM D5185m | >25 | 3 | 4 | 5 |
| Potassium | ppm | ASTM D5185m | >20 | 0 | 4 | 3 |
| Fuel | | WC Method | >5 | <1.0 | <1.0 | <1.0 |
| Water | | WC Method | >0.2 | NEG | NEG | NEG |
| Glycol | | WC Method | | NEG | NEG | NEG |
| Soot % | % | *ASTM D7844 | >3 | 0.4 | 1.1 | 0.9 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 6.0 | 8.5 | 7.7 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 18.5 | 20.6 | 20.0 |
| Silt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | NEG | NEG |

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|-------------|------|--------------|------|------|
| Sodium | ppm | ASTM D5185m | | 0 | 0 | 2 |
| Boron | ppm | ASTM D5185m | 0 | 0 | 0 | 0 |
| Barium | ppm | ASTM D5185m | 0 | 0 | 12 | 0 |
| Molybdenum | ppm | ASTM D5185m | 60 | 54 | 59 | 63 |
| Manganese | ppm | ASTM D5185m | 0 | <1 | <1 | 0 |
| Magnesium | ppm | ASTM D5185m | 1010 | 913 | 922 | 984 |
| Calcium | ppm | ASTM D5185m | 1070 | 998 | 1061 | 1117 |
| Phosphorus | ppm | ASTM D5185m | 1150 | 988 | 920 | 1015 |
| Zinc | ppm | ASTM D5185m | 1270 | 1232 | 1194 | 1280 |
| Sulfur | ppm | ASTM D5185m | 2060 | 2984 | 2811 | 2442 |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 13.6 | 15.4 | 14.8 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 9.8 | 8.4 | 8.0 | 7.9 |
| Visc @ 100°C | cSt | ASTM D445 | 15.4 | 13.9 | 13.7 | 13.6 |

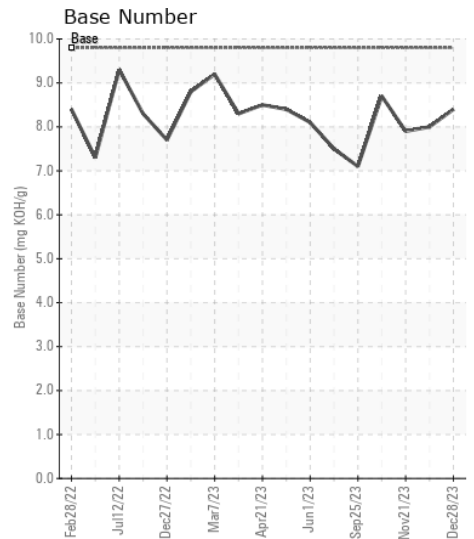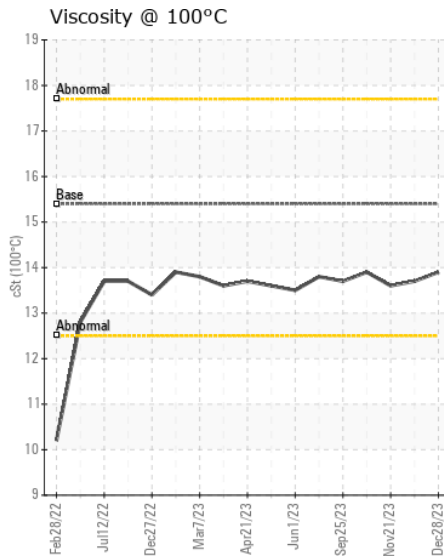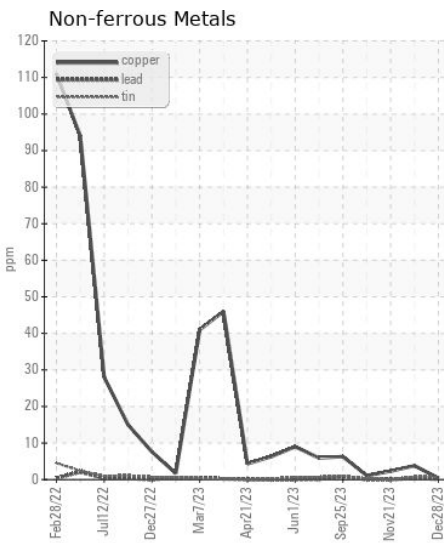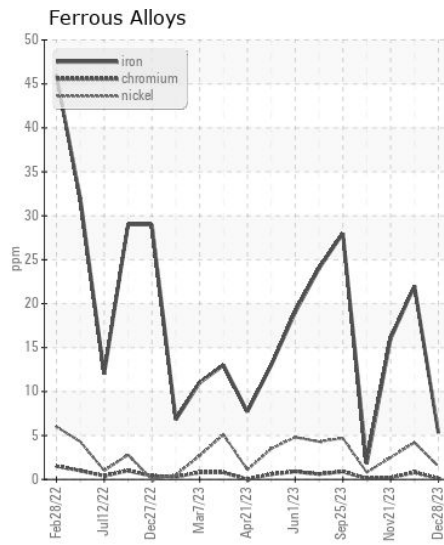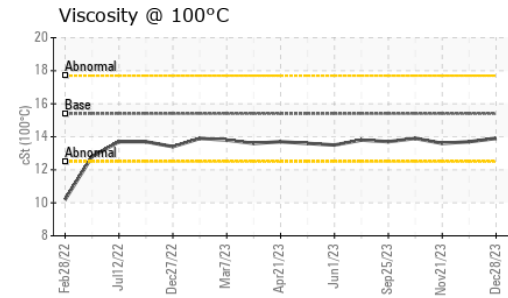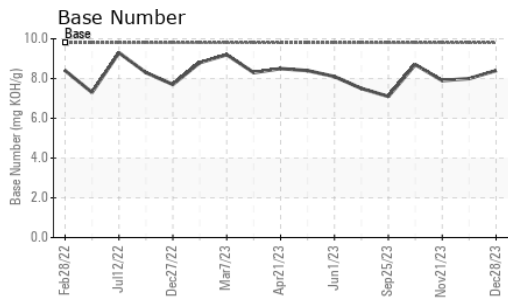

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0099011 **Received** : 11 Jan 2024
Lab Number : 06057886 **Diagnosed** : 12 Jan 2024
Unique Number : 10829268 **Diagnostician** : Wes Davis
Test Package : FLEET

GFL Environmental - 084 - Clarksville
 699 Jack Miller Boulevard
 Clarksville, TN
 US 37042
 Contact: ROBERT THIBAUT
 robert.thibault@gflenv.com
 T: (931)552-7276
 F: (931)572-9674

Certificate L2367
 To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)