WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL ATTENTION



[HERC] Machine Id VOLVO L110H 632557

Component Transmission (Auto)

DIESEL ENGINE OIL SAE 15W	40 (GAL)						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP432218		
	Sample Date		Client Info		28 Dec 2023		
	Machine Age	hrs	Client Info		1206		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				ATTENTION		
WEAR	Iron	ppm	ASTM D5185m	>160	37		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>5	0		
	Nickel	ppm	ASTM D5185m	>5	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>5	0		
	Aluminum	ppm	ASTM D5185m	>50	2		
	Lead	ppm	ASTM D5185m	>50	0		
	Copper	ppm	ASTM D5185m	>225	5		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	6		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m		<1		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m	>158	3		
The fluid viscosity is lower than normal. This plus the additive levels indicates the addition of a different brand, or type of oil. Confirm oil type.	Boron	ppm	ASTM D5185m	250	85		
	Barium	ppm	ASTM D5185m	10	0		
	Molybdenum	ppm	ASTM D5185m	100	1		
	Manganese	ppm	ASTM D5185m		3		
	Magnesium	ppm	ASTM D5185m	450	14		
	Calcium	ppm	ASTM D5185m	3000	104		
	Phosphorus	ppm	ASTM D5185m		213		
	Zinc	ppm	ASTM D5185m	1350	▲ 33		
	Sulfur	ppm	ASTM D5185m		1818		
	Visc @ 40°C	cSt	ASTM D445	115	▲ 29.0		

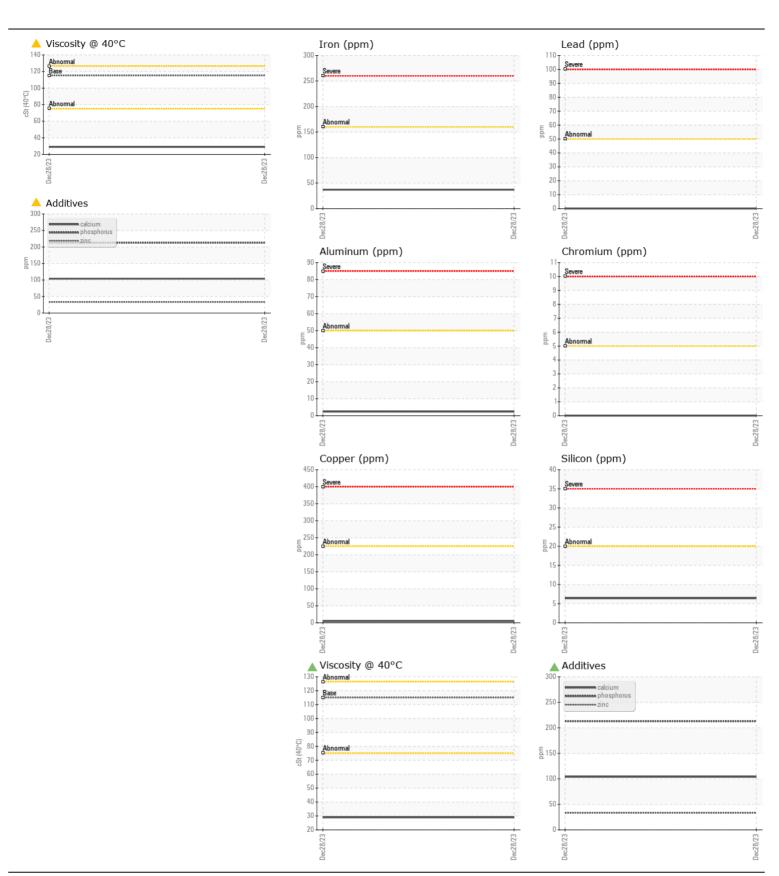



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: VCP432218 : 06058527 : 10829909 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 11 Jan 2024 Diagnosed : 14 Jan 2024 : Don Baldridge Diagnostician

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD

TAMPA, FL US 33619 Contact: KENNY HANEY khaney@flaglerce.com

T: (813)630-0077 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)