
WEAR CONTAMINATION FLUID CONDITION

NORMAL ABNORMAL NORMAL

JOHN DEERE S670 1H0S670SJD0765098

Component Front Right Final Drive

{not provided} (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
No corrective action is recommended at this time. We recommend an early resample to monitor this condition. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		JR0201653		
	Sample Date		Client Info		16 Jan 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				ABNORMAL		
WEAR	PQ		ASTM D8184	>1250	155		
All component wear rates are normal.	Iron	ppm	ASTM D5185m	>750	169		
	Chromium	ppm	ASTM D5185m	>9	4		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>40	<1		
	Lead	ppm	ASTM D5185m	>15	0		
	Copper	ppm	ASTM D5185m	>40	<1		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION Elemental level of silicon (Si) above normal indicating ingress of seal material.	Silicon	ppm	ASTM D5185m	>75	<u> </u>		
	Potassium	ppm	ASTM D5185m	>20	<1		
	Water		WC Method	>0.075	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.075	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m	>51	1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		26		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		9		
	Magnesium	ppm	ASTM D5185m		<1		
	Calcium	ppm	ASTM D5185m		61		
	Phosphorus	ppm	ASTM D5185m		535		
	Zinc	ppm	ASTM D5185m		6		
	Sulfur	ppm	ASTM D5185m		23716		
	Visc @ 40°C	cSt	ASTM D445		133		

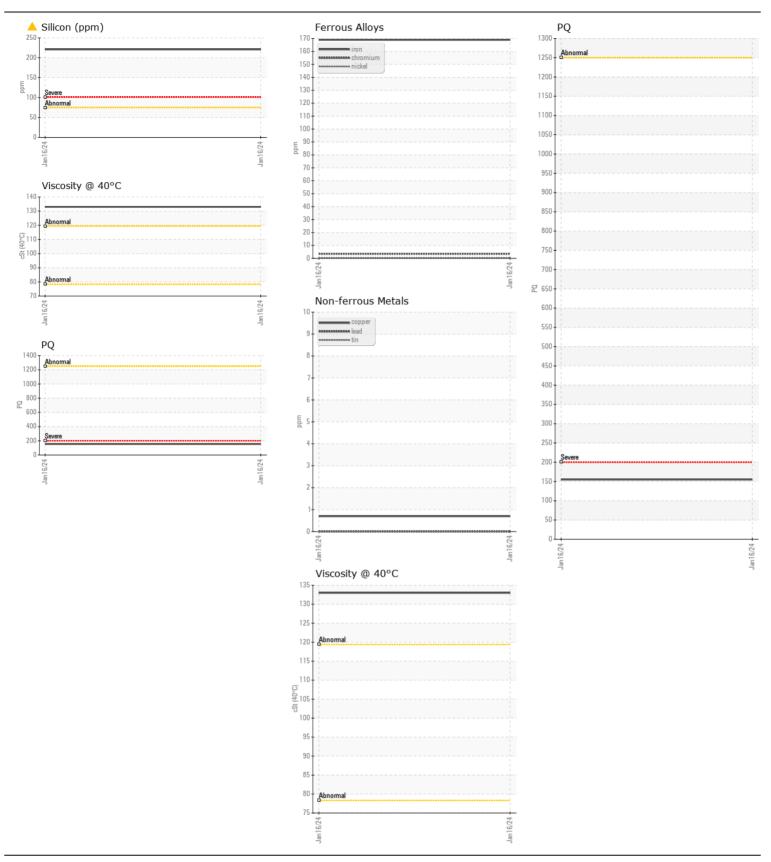



Laboratory Sample No. Lab Number

Unique Number

: JR0201653 : 06063062 : 10834444

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 17 Jan 2024 Diagnosed : 18 Jan 2024

Diagnostician : Sean Felton

Test Package : CONST (Additional Tests: PQ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

Contact: BILL ACKER backer@jamesriverequipment.com T: (757)899-3232

10489 GENERAL MAHONE HWY

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: JAMWAK [WUSCAR] 06063062 (Generated: 01/19/2024 20:14:21) Rev: 1

Contact/Location: BILL ACKER - JAMWAK

JRE - WAKEFIELD

WAKEFIELD, VA

F: (757)899-6464

US 23888