



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
KAWASAKI 90ZV F-62 (S/N 90C4-5231)

Component
Rear Left Planetary

Fluid
CHEVRON 1000 THF (4 GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0879495	WC0869348	WC0833561
Sample Date		Client Info		29 Jan 2024	25 Oct 2023	16 Aug 2023
Machine Age	hrs	Client Info		41074	40532	40116
Oil Age	hrs	Client Info		958	416	1576
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	N/A
Filter Changed		Client Info		Changed	Changed	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>500	17	7	12
Chromium	ppm	ASTM D5185m	>10	6	3	7
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	2	0	0
Lead	ppm	ASTM D5185m	>25	0	0	0
Copper	ppm	ASTM D5185m	>75	2	1	2
Tin	ppm	ASTM D5185m	>10	<1	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION





There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>75	4	3	4
Potassium	ppm	ASTM D5185m	>20	1	0	0
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		0	<1	0
Boron	ppm	ASTM D5185m	10	12	14	17
Barium	ppm	ASTM D5185m		<1	0	0
Molybdenum	ppm	ASTM D5185m		<1	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m	20	6	5	8
Calcium	ppm	ASTM D5185m	3200	714	862	949
Phosphorus	ppm	ASTM D5185m	1100	485	479	563
Zinc	ppm	ASTM D5185m	1400	627	619	673
Sulfur	ppm	ASTM D5185m	3600	2228	1653	2022
Visc @ 40°C	cSt	ASTM D445	58.4	44.8	45.5	45.6

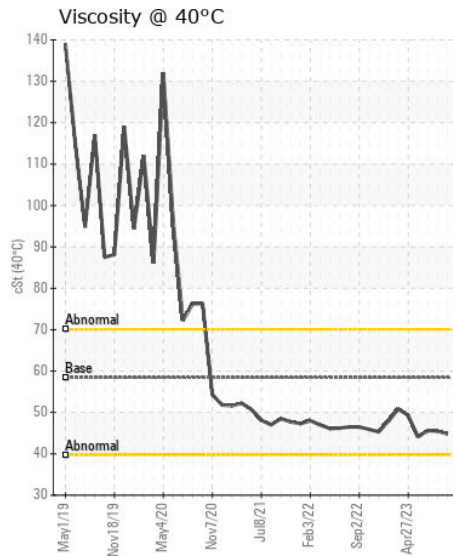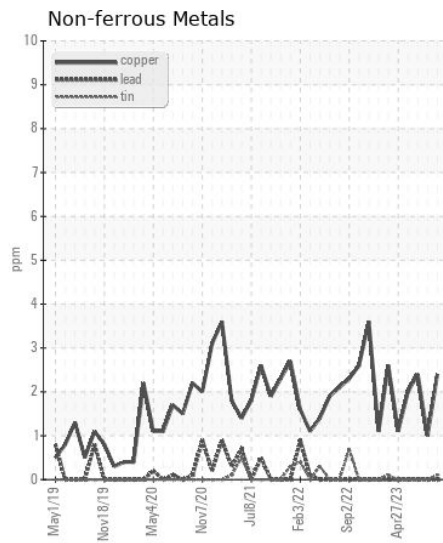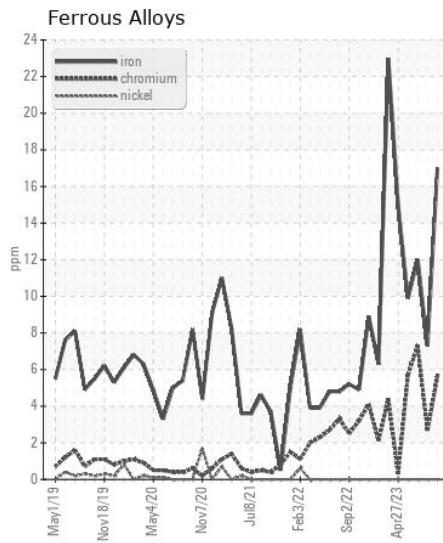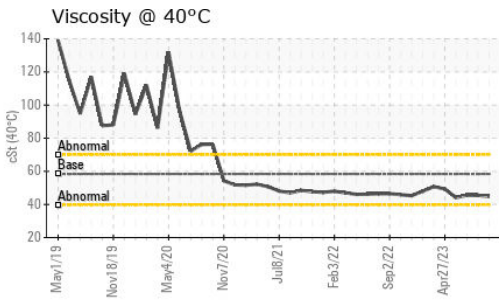

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0879495 **Received** : 31 Jan 2024
Lab Number : 06076154 **Diagnosed** : 02 Feb 2024
Unique Number : 10858245 **Diagnostician** : Sean Felton
Test Package : CONST

FRANKLIN IRON & METAL CORP
 1939 EAST 1ST ST
 DAYTON, OH
 US 45403
 Contact: BILL PITTL JR
 parts@frankliniron.com
 T: (937)253-8184
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)