

WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**


Machine Id **612003**


Component Pump Drive

RECOMMENDATION Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		WC06087759		
	Sample Date		Client Info		12 Feb 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>500	2		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		0		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m	>10	0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>20	<1		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m	>35	<1		
	Tin	ppm	ASTM D5185m	>4	1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTANUNATION							
CONTAMINATION	Silicon	ppm	ASTM D5185m		13		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		0		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
<u></u>	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		<1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		10		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		6		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		41		
	Calcium	ppm	ASTM D5185m		2720		
	Phosphorus	ppm	ASTM D5185m		808		
	Zinc	ppm	ASTM D5185m		1099		
	Sulfur	ppm	ASTM D5185m		5050		
	Visc @ 40°C	cSt	ASTM D445		41.6		
	1100 @ 10 0						

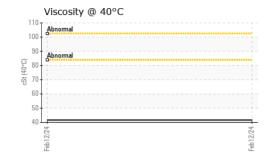

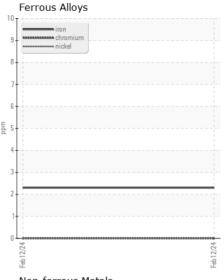

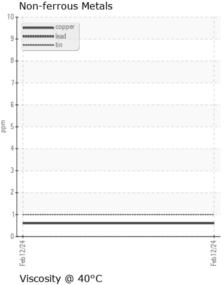

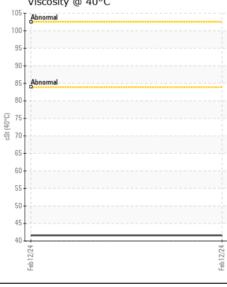



Laboratory Sample No.

Lab Number : 06087759 Unique Number : 10875204 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC06087759

Received : 13 Feb 2024 : 14 Feb 2024 **Tested** Diagnosed

: 15 Feb 2024 - Jonathan Hester

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

LANCASTER DEVELOPMENT

145 PODPADIC ROAD RICHMONDVILLE, NY

US 12149

T:

F:

Contact: Service Manager