



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	NORMAL

Machine Id
NOT GIVEN VCP436709 (S/N NO INFO ON SIF/BOTTLE)

Component
Diesel Engine

Fluid
{not provided} (--- GAL)

RECOMMENDATION

We advise that you check the air filter, air induction system, and any areas where dirt may enter the component. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP436709	---	---
Sample Date		Client Info		12 Feb 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				ABNORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	17	---	---
Chromium	ppm	ASTM D5185m	>20	0	---	---
Nickel	ppm	ASTM D5185m	>4	3	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m	>3	0	---	---
Aluminum	ppm	ASTM D5185m	>20	3	---	---
Lead	ppm	ASTM D5185m	>40	0	---	---
Copper	ppm	ASTM D5185m	>330	208	---	---
Tin	ppm	ASTM D5185m	>15	3	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION

Fuel content negligible. Elemental level of silicon (Si) above normal indicating ingress of dirt/seal material.


Silicon	ppm	ASTM D5185m	>25	▲ 27	---	---
Potassium	ppm	ASTM D5185m	>20	2	---	---
Fuel	%	ASTM D3524	>5	0.4	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	*ASTM D7844	>3	0.2	---	---
Nitration	Abs/cm	*ASTM D7624	>20	9.6	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	20.5	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		2	---	---
Boron	ppm	ASTM D5185m		30	---	---
Barium	ppm	ASTM D5185m		<1	---	---
Molybdenum	ppm	ASTM D5185m		85	---	---
Manganese	ppm	ASTM D5185m		3	---	---
Magnesium	ppm	ASTM D5185m		24	---	---
Calcium	ppm	ASTM D5185m		2206	---	---
Phosphorus	ppm	ASTM D5185m		1041	---	---
Zinc	ppm	ASTM D5185m		1204	---	---
Sulfur	ppm	ASTM D5185m		3638	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	14.4	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		5.0	---	---
Visc @ 100°C	cSt	ASTM D445		10.8	---	---


▲ Silicon (ppm)

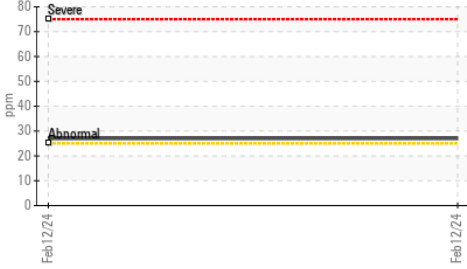


Iron (ppm)

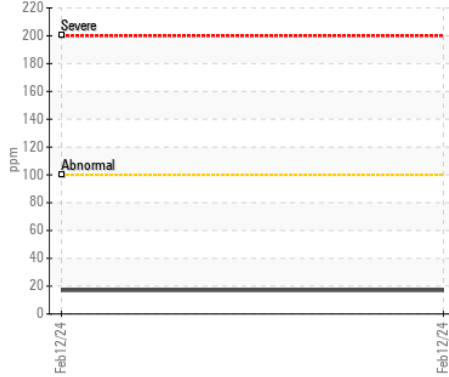


Lead (ppm)

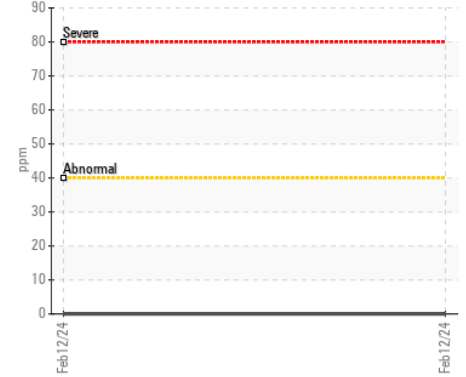


Fuel Dilution

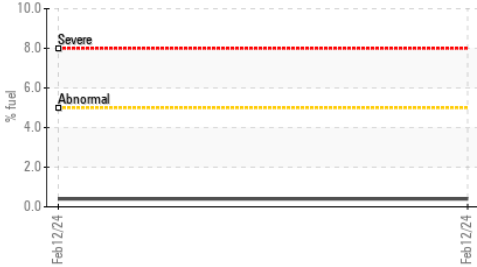


Aluminum (ppm)

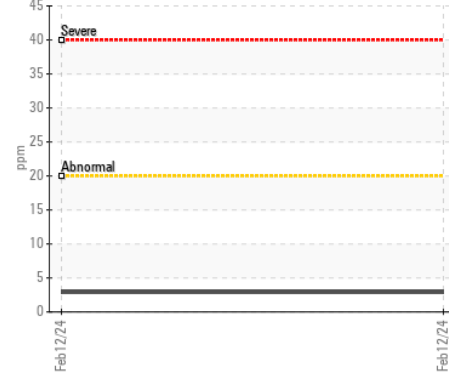


Chromium (ppm)

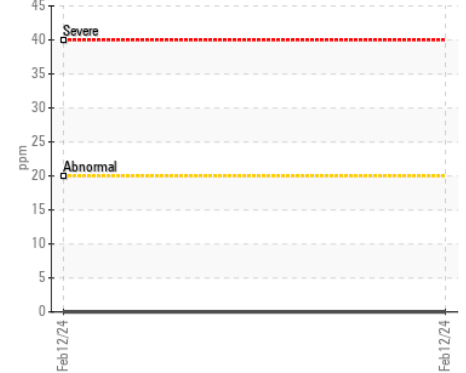


Base Number

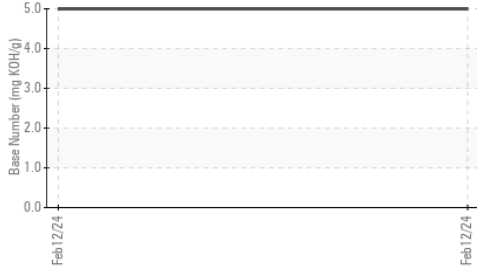

Copper (ppm)

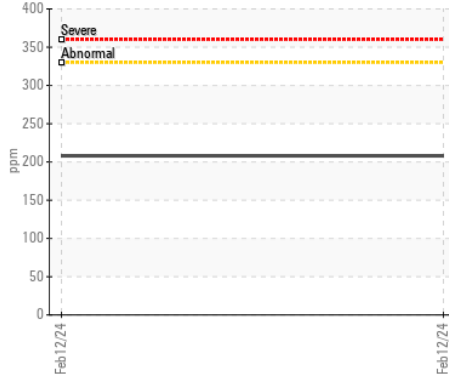


▲ Silicon (ppm)

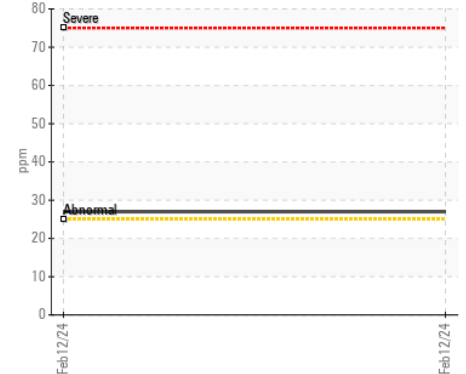


Viscosity @ 100°C



Viscosity @ 100°C

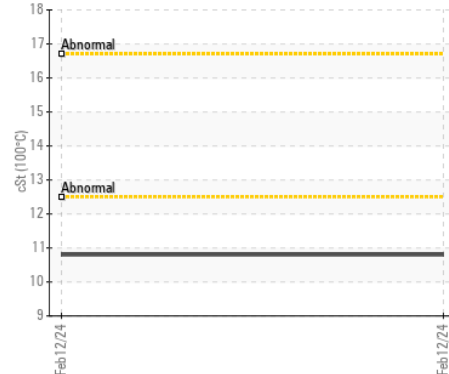

Base Number

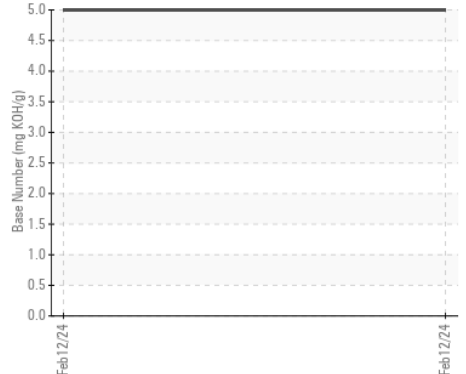

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP436709 **Received** : 13 Feb 2024
Lab Number : 06087915 **Tested** : 15 Feb 2024
Unique Number : 10875360 **Diagnosed** : 15 Feb 2024 - Doug Bogart
Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel, TBN)

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: KENNY HANEY
 khaney@flaglerce.com
 T: (813)630-0077
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)