
WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL NORMAL



## **LIEBHERR LH30M 1253-146764**

Component Rear Right Wheel Hub Fluid {not provided} ( GAL)					-,		
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		LH0276517		
	Sample Date		Client Info		08 Feb 2024		
	Machine Age	hrs	Client Info		1019		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>450	51		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>4	<1		
	Nickel	ppm	ASTM D5185m	>2	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>15	6		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m	>75	5		
	Tin	ppm	ASTM D5185m		<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION  There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m	>60	31		
	Potassium	ppm	ASTM D5185m	>20	3		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor Emulsified Water		*Visual	NORML	NORML		
		scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		5		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		40		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		2		
	Magnesium	ppm	ASTM D5185m		8		
	Calcium	ppm	ASTM D5185m		898		
	Phosphorus	ppm	ASTM D5185m		631		
	Zinc	ppm	ASTM D5185m		402		
	Sulfur	ppm	ASTM D5185m		17278		
	Visc @ 40°C	cSt	ASTM D445		107		

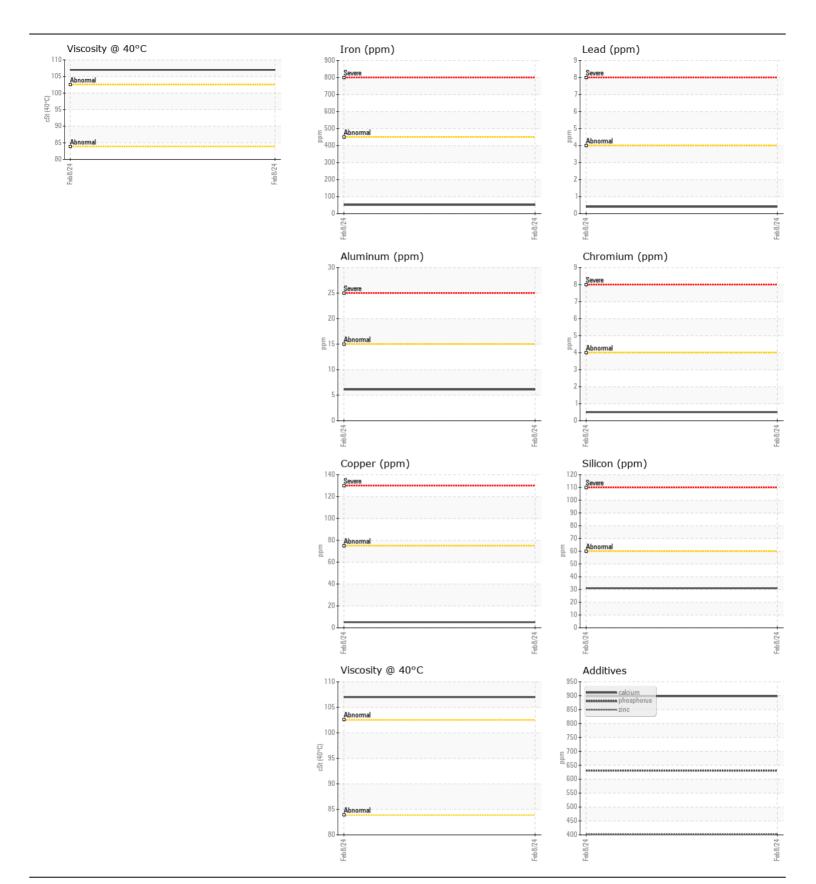





Certificate L2367

Laboratory Sample No.

Lab Number : 06089738 Unique Number : 10877183 Test Package : MOBCE

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : LH0276517 : 14 Feb 2024 : 16 Feb 2024 **Tested** 

: 16 Feb 2024 - Don Baldridge Diagnosed

TRAM CONSTRUCTION

9279 E KY 8 GARRISON, KY US 41141

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: