
WEAR CONTAMINATION **FLUID CONDITION**

NORMAL NORMAL NORMAL

Machine Id **362109**

Component							
Diesel Engine							
{not provided} (QTS)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
TIEGOWINIENDATION	Sample Number	OOW	Client Info	LITTIO/TOTT	IL06101399		
No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Date		Client Info		12 Feb 2024		
	Machine Age	hrs	Client Info		1028		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed	1113	Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status		Oliciti IIIIo		NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>100	21		
	Chromium	ppm	ASTM D5185m	>20	2		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m	>4	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m	>3	<1		
	Aluminum	ppm	ASTM D5185m	>20	6		
	Lead	ppm	ASTM D5185m	>40	1		
	Copper	ppm	ASTM D5185m	>330	7		
	Tin	ppm	ASTM D5185m	>15	1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION Fuel content negligible. There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m	>25	11		
	Potassium	ppm	ASTM D5185m	>20	19		
	Fuel	%	ASTM D3524	>5	0.7		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844	>3	0.1		
	Nitration	Abs/cm	*ASTM D7624	>20	6.7		
	Sulfation	Abs/.1mm	*ASTM D7415	>30	22.1		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
EL LUD CONDITION			40TH DE 10E				
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Boron	ppm	ASTM D5185m		51		
	Barium	ppm	ASTM D5185m		2		
	Molybdenum	ppm	ASTM D5185m		41		
	Manganese	ppm	ASTM D5185m		2		
	Magnesium	ppm	ASTM D5185m		430		
	Calcium	ppm	ASTM D5185m		1392		
	Phosphorus	ppm	ASTM D5185m		693		
	Zinc	ppm	ASTM D5185m		827		
	Sulfur	ppm	ASTM D5185m	6-	2467		
		Abs/.1mm	*ASTM D7414	>25	19.8		
	Oxidation			- =0			
	Base Number (BN) Visc @ 100°C	mg KOH/g	ASTM D2896 ASTM D445		9.3 12.4		



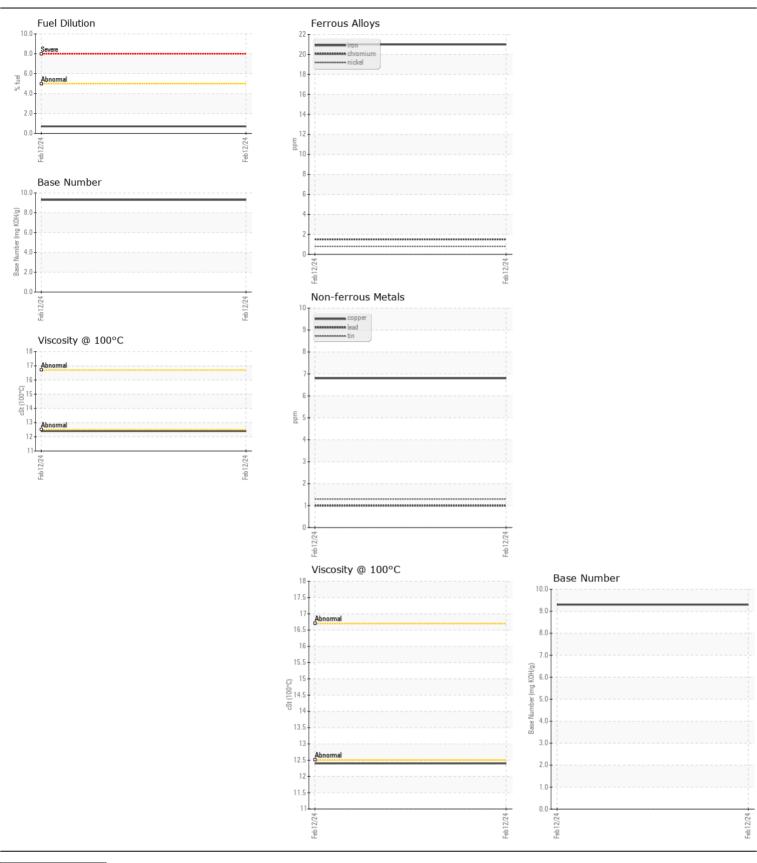

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Lab Number : 06101399 Unique Number: 10899629 Test Package: FLEET (Additional Tests: FuelDilution, PercentFuel)

: IL06101399

Received : 27 Feb 2024 : 29 Feb 2024 **Tested** Diagnosed

: 29 Feb 2024 - Wes Davis

RUSH TRUCK LEASING - CINCINNATI IDEALEASE 11777 HIGHWAY DRIVE CINCINNATI, OH

US 45241 Contact: ROBERT BAIER baierr@rushenterprises.com

T: (513)657-7901

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (513)733-0537

Report Id: IDECIN [WUSCAR] 06101399 (Generated: 02/29/2024 08:50:02) Rev: 1

Contact/Location: ROBERT BAIER - IDECIN