

[687011]



## **VOLVO EC200EL 314968**

Rear Right Final Drive

VOLVO PREMIUM GEAR OIL 80W-90 GL-5 (--- GAL)

		-`	· · · · · · · · · · · · · · · · · · ·				
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP437062		
	Sample Date		Client Info		07 Mar 2024		
	Machine Age	hrs	Client Info		554		
	Oil Age	hrs	Client Info		554		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR Iron ppm ASTM D5185m >500					400		
WEAN	Iron	ppm			406		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		7		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m	05	0		
	Aluminum	ppm	ASTM D5185m		1		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		<1		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m	NONE	<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>75	16		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		<1		
	Water			>0.2	NEG		
	Silt	scalar	*Visual	NONE	MODER		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	379	0		
	Barium	ppm	ASTM D5185m		<1		
	Molybdenum	ppm	ASTM D5185m	0.8	<1		
	Manganese	ppm	ASTM D5185m		10		
	Magnesium	ppm	ASTM D5185m	31	1		
	Calcium	ppm	ASTM D5185m		36		
	Phosphorus	ppm	ASTM D5185m	1077	372		
	Zinc	ppm	ASTM D5185m	46	41		
	Sulfur	ppm	ASTM D5185m	23526	21268		
	N# 0 100-						


Visc @ 40°C


cSt

ASTM D445 139

Contact/Location: ROBERT TURNER - RIPTAM

175

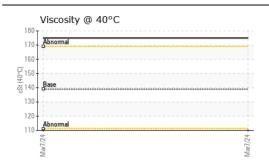

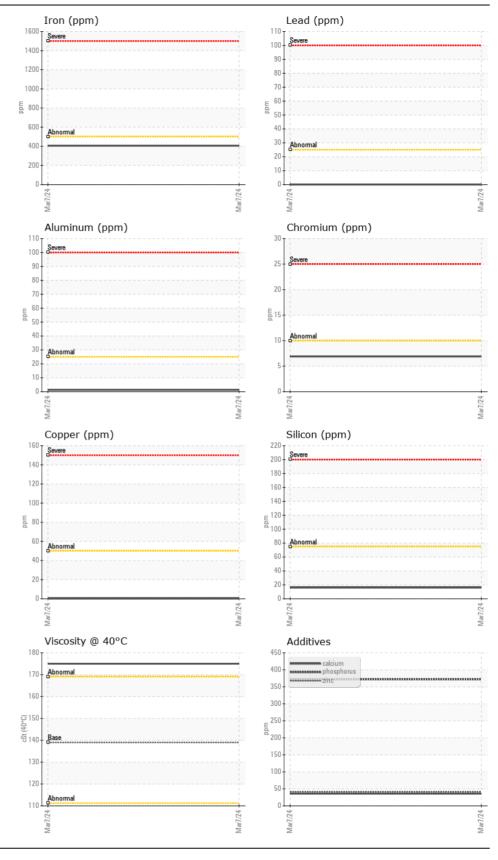



**RIPA AND ASSOCIATES** Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 10149 FISHER AVENUE : VCP437062 : 11 Apr 2024 Lab Number : 06146237 : 12 Apr 2024 TAMPA, FL Tested Unique Number : 10976315 : 15 Apr 2024 - Don Baldridge US 33619 Diagnosed Test Package : MOB 1 Contact: ROBERT TURNER Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. rturner@ripatampa.com \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: RIPTAM [WUSCAR] 06146237 (Generated: 04/15/2024 15:14:27) Rev: 1

Contact/Location: ROBERT TURNER - RIPTAM Page 2 of 2

T:

F: