
WEAR CONTAMINATION **FLUID CONDITION**

NORMAL NORMAL NORMAL

Machine Id 113407

Component Diesel Engine

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number	JOIVI	Client Info	LITTIV/AUIT	IL0033007		
No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.	Sample Date		Client Info		26 Feb 2024		
	Machine Age	mls	Client Info		64882		
	Oil Age	mls	Client Info		14299		
	Filter Age	mls	Client Info		14299		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185m	>100	25		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	2		
	Nickel	ppm	ASTM D5185m	>4	0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>3	0		
	Aluminum	ppm	ASTM D5185m	>20	49		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		2		
	Tin	ppm	ASTM D5185m	>15	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	nnm	ASTM D5185m	> 25	5		
CONTAININATION	Potassium	ppm	ASTM D5185m		99		
Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. No other contaminants were detected in the oil.	Fuel	ррпп	WC Method	>5	<1.0		
	Water		WC Method		NEG		
	Glycol		WC Method	<i>></i> 0.2	NEG		
	Soot %	%	*ASTM D7844	\3	0.4		
	Nitration	Abs/cm	*ASTM D7624	>20	10.0		
	Sulfation	Abs/.1mm	*ASTM D7415		22.7		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2		
The BN result indicates that there is suitable alkalinity remaining in the	Boron	ppm	ASTM D5185m	269	126		
oil. The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m	0	6		
	Manganese	ppm	ASTM D5185m		0		
	Magnesium	ppm	ASTM D5185m		49		
	Calcium	ppm	ASTM D5185m		2237		
	Phosphorus	ppm	ASTM D5185m		1063		
	Zinc	ppm	ASTM D5185m	893	1199		
	Sulfur	ppm	ASTM D5185m	0.5	3466		
	Oxidation	Abs/.1mm	*ASTM D7414		18.3		
	Base Number (BN)				5.9		

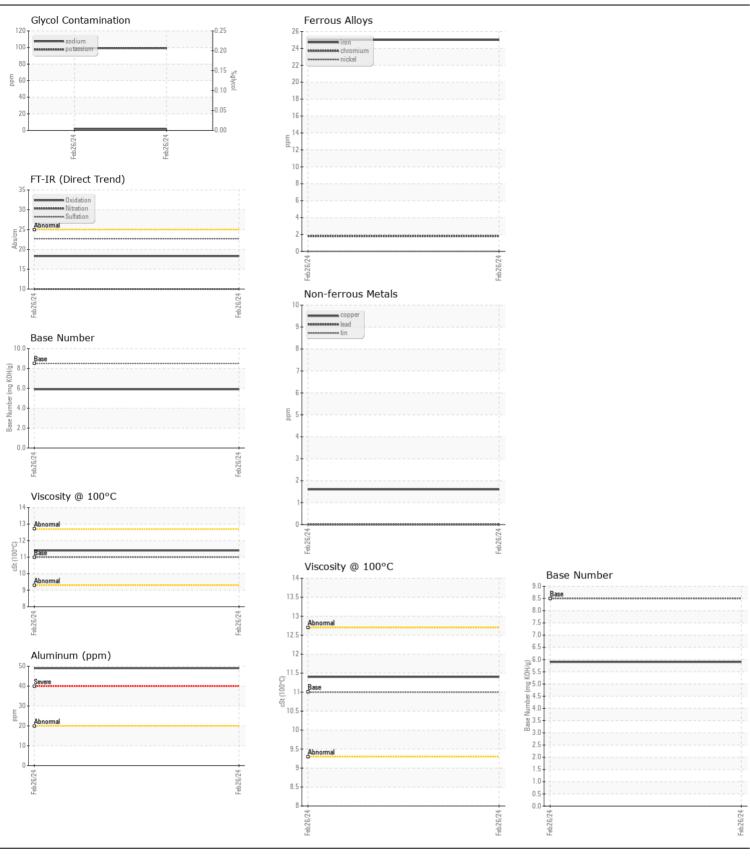





Certificate L2367

Laboratory Sample No.

Lab Number : 06151808 Unique Number: 10981886 Test Package : FLEET

: IL0033007

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 17 Apr 2024 **Tested**

Diagnosed

: 18 Apr 2024 : 19 Apr 2024 - Don Baldridge **IDEALEASE OF NORTHWEST WI** 611 HANSEN ROAD GREEN BAY, WI US 54304

Contact: GARY KOLTZ gkoltz@pcitrucks.com T: (920)499-6200

F: (920)499-5332

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)