CORROSION CONTAMINANTS COOLANT CONDITION

NORMAL NORMAL NORMAL


WCLSNC Machine Id

QC COOL ELC NC 09012022

Coolant

CAT EXTENDED LIFE COOLANT (ELC) (--- GAL)

CAT EXTENDED LIFE COOLANT (ELC) (GAI	- /						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
No corrective action is recommended at this time. The fluid is suitable for further service.	Sample Number		Client Info		WC0939676	WC0939674	WC0939673
	Sample Date		Client Info		23 May 2024	21 May 2024	20 May 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		0	0	0
	Oil Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL	NORMAL	NORMAL
CORROSION	Iron	ppm	ASTM D6130	>2	<1	0	0
All metal levels are normal indicating no corrosion in the cooling system.	Aluminum	ppm	ASTM D6130	>2	0	0	0
	Copper	ppm	ASTM D6130	>2	2	0	0
	Lead	ppm	ASTM D6130	>2	1	0	0
	Tin	ppm	ASTM D6130	>2	<1	0	0
	Zinc	ppm	ASTM D6130	>10	0	0	0
CONTAMINANTS	Calcium	ppm	ASTM D6130	>5	0	0	0
There is no indication of any contamination in the coolant.	Chlorine	ppm	ASTM D6130		1	<1	0
	Magnesium	ppm	ASTM D6130	>6	<1	0	0
	Total Dissolved Solids				341.0	298.0	306.5
	Coolant Appearance		*Visual	Clear	normal	normal	norma
COOLANT CONDITION	Boiling Point	°C	WC Method		225	225	225
Carboxylate test failed. Glycol and nitrite levels are acceptable. The pH level of this fluid is within the acceptable limits.	Specific Gravity		*ASTM D1298		1.067	1.067	1.067
	рН	Scale 0-14	ASTM D1287		8.17	8.18	8.12
	Nitrites	ppm	AP-053:2009		936	900	712
	Reserve Alkalinity	Scale 0-20	*ASTM D1121				
	Percentage Glycol	%	ASTM D3321		49.3	49.3	49.4
	Freezing Point	°F	ASTM D3321		-33	-33	-33
	Carboxylate				fail	fail	fail
	Silicon	ppm	ASTM D6130	0	3	<1	<1
	Phosphorus	ppm	ASTM D6130	0	0	0	0
	Boron	ppm	ASTM D6130	0	0	0	0
	Molybdenum	ppm	ASTM D6130	950	843	749	691
	Sodium	ppm	ASTM D6130		5308	4272	4012
	Potassium	ppm	ASTM D6130		9	4	2
	Coolant Color		*Visual		Red	Red	Red

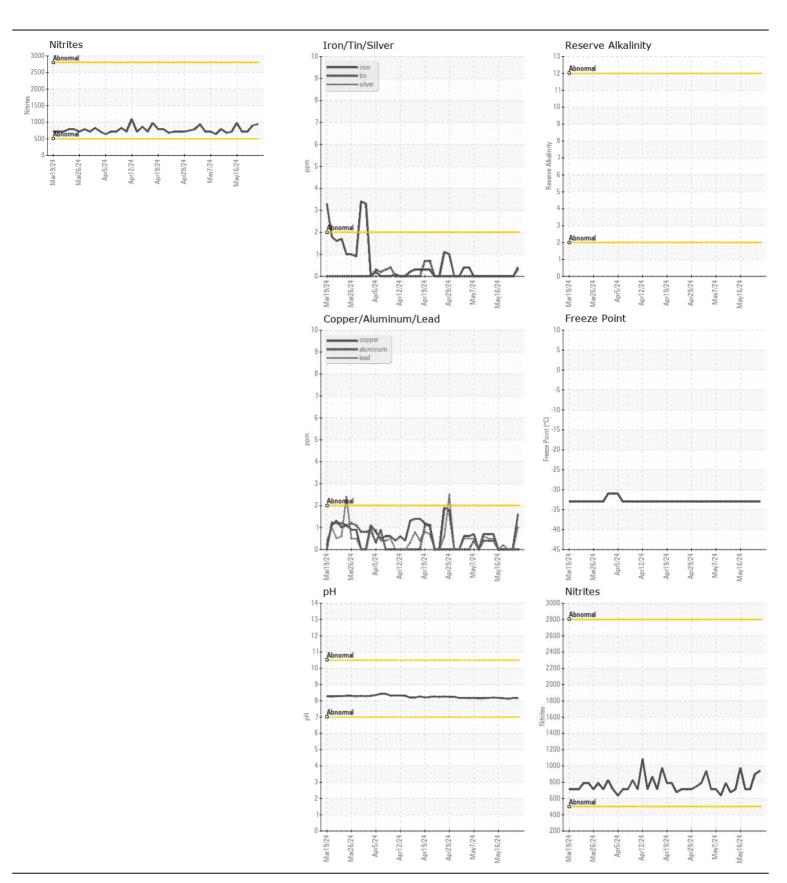





Certificate L2367

Laboratory Sample No.

Lab Number : 06189687 Unique Number : 11046439

: WC0939676

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 23 May 2024 **Tested** : 03 Jun 2024

Diagnosed : 03 Jun 2024 - Jonathan Hester Test Package : COOL- (Additional Tests: BoilingPoint, COOL, GlycolType, ICP)

WEARCHECK LUBRICATION SERVICES QA ACCOUNT

501 Madison Ave Cary, NC US 27513

Contact: WCLS CARY NC

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (919)379-4102