WEAR CONTAMINATION **FLUID CONDITION**


NORMAL NORMAL NORMAL


Machine Id


948012 Component


Transmission (Auto)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		GFL0121864		
	Sample Date		Client Info		27 May 2024		
	Machine Age	hrs	Client Info		398		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	nnm	ASTM D5185m	\325	28		
	Chromium	ppm	ASTM D5185m		0		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		16		
	Lead	ppm	ASTM D5185m		8		
	Copper	ppm	ASTM D5185m		12		
	Tin	ppm	ASTM D5185m		4		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	0		40TM DE405				
CONTAMINATION	Silicon	ppm	ASTM D5185m		4		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m		1		
	Water		WC Method		NEG		
	Silt Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE NONE		
		scalar	*Visual	NORML	NORML		
	Appearance Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
			· · · · · · · · · · · · · · · · · · ·				
FLUID CONDITION	Sodium	ppm	ASTM D5185m		10		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m		102		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm	ASTM D5185m		120		
	Phosphorus	ppm	ASTM D5185m		279		
	Zinc	ppm	ASTM D5185m		29		
	Sulfur	ppm	ASTM D5185m		1433		
	Visc @ 40°C	cSt	ASTM D445	34	31.9		

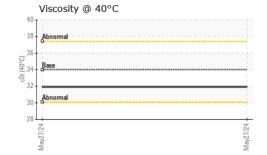

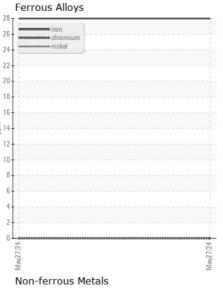

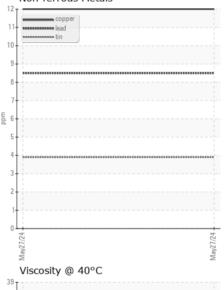

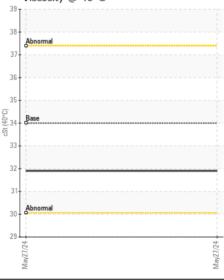



Certificate L2367

Laboratory Sample No.

Test Package : FLEET

Lab Number : 06197159 Unique Number : 11059282

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : GFL0121864

Received : 31 May 2024 **Tested** : 03 Jun 2024 Diagnosed

: 03 Jun 2024 - Wes Davis

Kemp Quarries - Pryor Stone - Pryor 1050 E 520 Rd Pryor, OK US 74361

Contact: pryor@pryorstone.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) T:

F: