WEAR CONTAMINATION FLUID CONDITION

ABNORMAL NORMAL NORMAL

[SWO-072798 APAC AL]


WEILER 2850A 1533

Front Right Final Drive {not provided} (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.	Sample Number		Client Info		VCP443981		
	Sample Date		Client Info		11 Jun 2024		
	Machine Age	hrs	Client Info		4072		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Not Changd		
	Sample Status				ABNORMAL		
WEAR	Iron	ppm	ASTM D5185m	>500	297		
The copper level is abnormal. All other component wear rates are normal.	Chromium	ppm	ASTM D5185m	>10	4		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		<1		
	Aluminum	ppm	ASTM D5185m	>25	2		
	Lead	ppm	ASTM D5185m	>25	<1		
	Copper	ppm	ASTM D5185m	>50	△ 73		
	Tin	ppm	ASTM D5185m	>10	2		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>75	10		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	3		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		8		
	Barium	ppm	ASTM D5185m		5		
	Molybdenum	ppm	ASTM D5185m		1		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm	ASTM D5185m		8		
	Phosphorus	ppm	ASTM D5185m		264		
	Zinc	ppm	ASTM D5185m		45		
	Sulfur	ppm	ASTM D5185m		17158		

Visc @ 40°C

200

ASTM D445

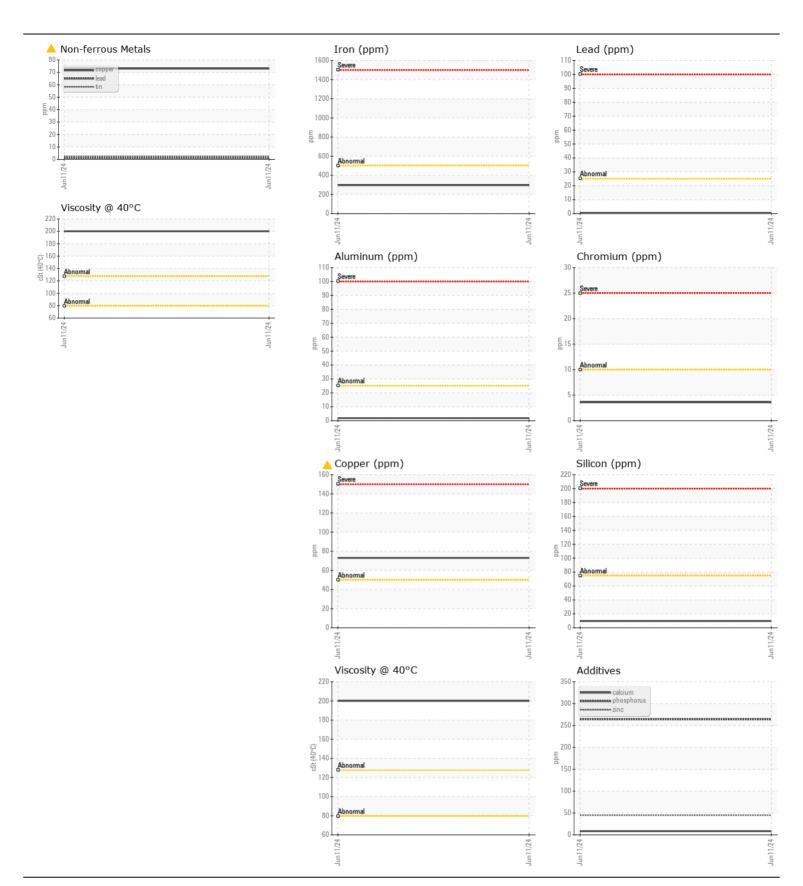





Certificate L2367

Laboratory Sample No.

: VCP443981 Lab Number : 06212153 Unique Number : 11085017 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 17 Jun 2024 **Tested** : 19 Jun 2024

Diagnosed : 19 Jun 2024 - Don Baldridge **COWIN EQUIPMENT COMPANY**

2238 PINSON VALLEY PARKWAY BIRMINGHAM, AL

US 35217 Contact: BRANTLY CLAY

bclay@cowin.com

F: (205)856-2106

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)