



OIL ANALYSIS REPORT

| | |
|-----------------|---------------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Machine Id
2317
 Component
Diesel Engine
 Fluid
ROYAL PURPLE MOTOR OIL 15W40 (40 QTS)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | WC0720123 | WC0720052 | WC0720162 |
| Sample Date | | Client Info | | 01 Jun 2024 | 03 Feb 2024 | 14 Oct 2023 |
| Machine Age | mls | Client Info | | 271281 | 221081 | 171691 |
| Oil Age | mls | Client Info | | 0 | 100000 | 50000 |
| Filter Age | mls | Client Info | | 0 | 50000 | 50000 |
| Oil Changed | | Client Info | | Not Changd | Changed | Not Changed |
| Filter Changed | | Client Info | | Changed | Changed | Changed |
| Sample Status | | | | NORMAL | ABNORMAL | NORMAL |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|--------------|------|------|
| Iron | ppm | ASTM D5185m | >100 | 39 | 93 | 50 |
| Chromium | ppm | ASTM D5185m | >20 | <1 | 3 | 2 |
| Nickel | ppm | ASTM D5185m | >4 | <1 | <1 | 0 |
| Titanium | ppm | ASTM D5185m | | 0 | <1 | 0 |
| Silver | ppm | ASTM D5185m | >3 | <1 | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | 10 | 22 | 15 |
| Lead | ppm | ASTM D5185m | >40 | 0 | 2 | <1 |
| Copper | ppm | ASTM D5185m | >330 | 28 | 88 | 75 |
| Tin | ppm | ASTM D5185m | >15 | <1 | 1 | <1 |
| Vanadium | ppm | ASTM D5185m | | 0 | 0 | 0 |
| White Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | NONE |

CONTAMINATION

There is no indication of any contamination in the oil.


| | | | | | | |
|------------------|----------|-------------|-------|----------------|-------|-------|
| Silicon | ppm | ASTM D5185m | >25 | 8 | 11 | 8 |
| Potassium | ppm | ASTM D5185m | >20 | 24 | 54 | 38 |
| Fuel | | WC Method | >5 | <1.0 | <1.0 | <1.0 |
| Water | | WC Method | >0.2 | NEG | NEG | NEG |
| Glycol | | WC Method | | NEG | NEG | NEG |
| Soot % | % | *ASTM D7844 | >3 | 1.4 | 2.3 | 1.2 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 11.3 | 17.1 | 10.8 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 26.5 | 34.0 | 24.0 |
| Silt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | NEG | NEG |

FLUID CONDITION


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|-------------|-------|--------------|-------|------|
| Sodium | ppm | ASTM D5185m | | 4 | 4 | 3 |
| Boron | ppm | ASTM D5185m | 0 | <1 | 0 | 0 |
| Barium | ppm | ASTM D5185m | 0 | 0 | 0 | 0 |
| Molybdenum | ppm | ASTM D5185m | 100 | 1 | 7 | 8 |
| Manganese | ppm | ASTM D5185m | | 1 | 2 | <1 |
| Magnesium | ppm | ASTM D5185m | 60 | 34 | 125 | 118 |
| Calcium | ppm | ASTM D5185m | 3050 | 2572 | 2703 | 2280 |
| Phosphorus | ppm | ASTM D5185m | 1050 | 1014 | 1046 | 840 |
| Zinc | ppm | ASTM D5185m | 1200 | 1183 | 1270 | 1101 |
| Sulfur | ppm | ASTM D5185m | 12500 | 3824 | 3240 | 2748 |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 19.8 | 32.4 | 18.6 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 10.5 | 5.1 | ▲ 2.9 | 5.0 |
| Visc @ 100°C | cSt | ASTM D445 | 14.9 | 14.0 | 15.0 | 13.4 |


FT-IR (Direct Trend)

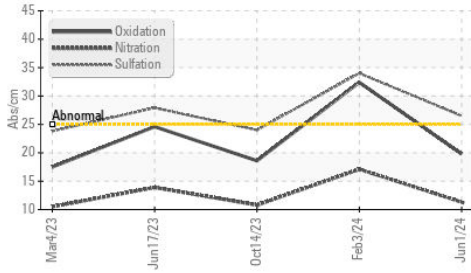


Ferrous Alloys

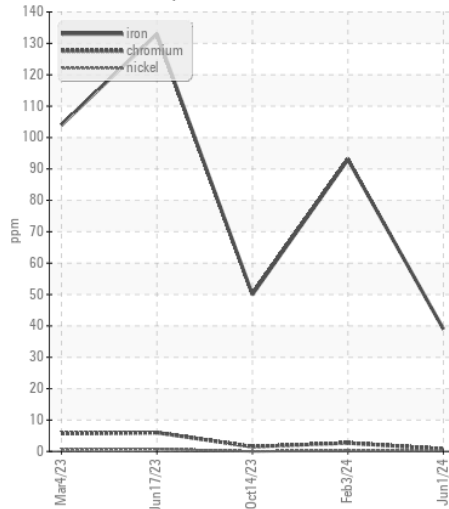


Base Number

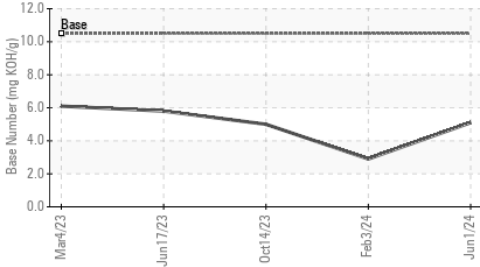


Non-ferrous Metals

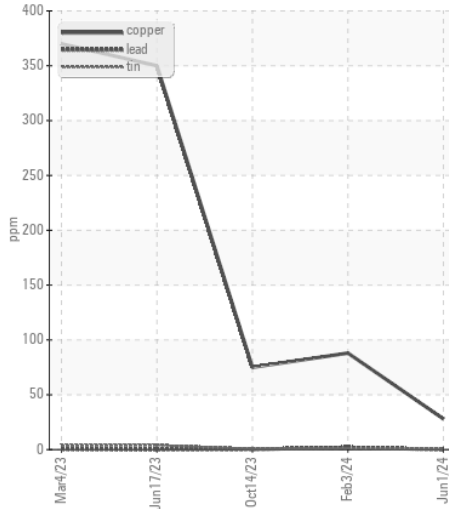


Viscosity @ 100°C

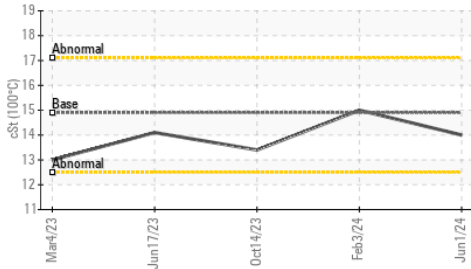

Viscosity @ 100°C

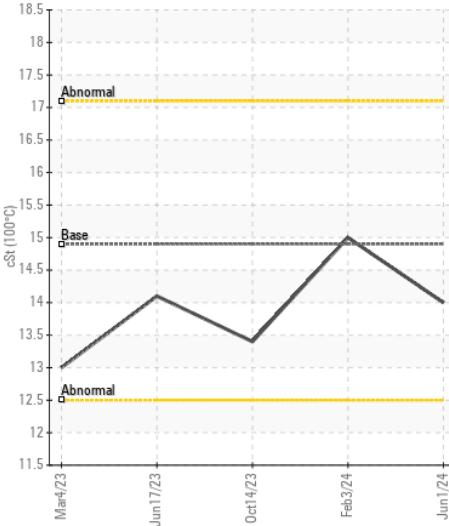

Base Number

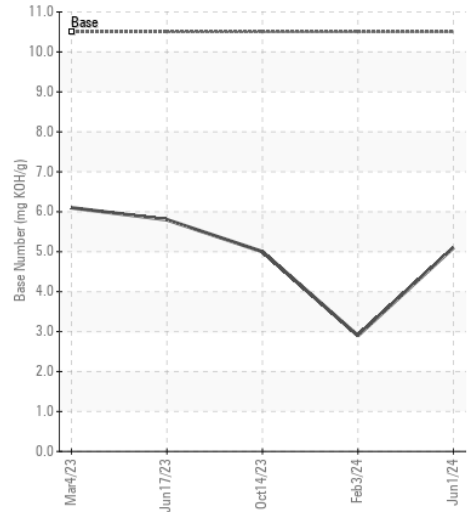

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0720123
Lab Number : 06213293
Unique Number : 11086157
Test Package : FLEET

Received : 18 Jun 2024
Tested : 19 Jun 2024
Diagnosed : 19 Jun 2024 - Wes Davis

DILLON TRANSPORTATION
 974 TN WALTZ PARKWAY
 ASHLAND CITY, TN
 US 37015

Contact: MASON NICHOLSON
 M.NICHOLSON@DILLONTRANSPORTATION.COM

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (615)792-5099
 F: (615)469-4200