

Area [701681] Machine Id VOLVO L110H 631226 Component Front Axle Fluid VOLVO WB 102 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

WEAR

All component wear rates are normal.

CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP447471	VCP410371	VCP274711
Sample Date		Client Info		20 May 2024	11 Apr 2023	13 Jul 2020
Machine Age	hrs	Client Info		13441	11460	5614
Oil Age	hrs	Client Info		2000	2096	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		Changed	Changed	Not Change
Sample Status				NORMAL	NORMAL	NORMAL
Iron	ppm	ASTM D5185m	>500	322	192	14
Chromium	ppm	ASTM D5185m	>20	5	3	<1
Nickel	ppm	ASTM D5185m	>10	0	0	<1
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>30	<1	1	0
Lead	ppm	ASTM D5185m	>50	0	0	0
Copper	ppm	ASTM D5185m	>120	2	<1	0
Tin	ppm	ASTM D5185m	>20	0	0	0
Vanadium	ppm	ASTM D5185m		<1	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Silicon	ppm	ASTM D5185m	>50	15	12	<1
Potassium	ppm	ASTM D5185m	>20	0	0	0
Water	ppin	WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	*Visual	NONE	NONE	MODER	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORM
Odor	scalar	*Visual	NORML	NORML	NORML	NORM
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Sodium	ppm	ASTM D5185m		11	8	0
Boron	ppm	ASTM D5185m		118	132	6
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		2	2	<1
Manganese	ppm	ASTM D5185m		3	2	<1
Magnesium	ppm	ASTM D5185m		27	21	<1
Calcium	ppm	ASTM D5185m		3732	3603	201
Phosphorus	ppm	ASTM D5185m		1257	1317	56
Zinc	ppm	ASTM D5185m		1511	1576	66
Cultur		ACTM DE10Em		4117	4776	110

WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

Sulfur

Visc @ 40°C

ASTM D5185m

ASTM D445 55

ppm

cSt

Contact/Location: PM Services ? - RIPTAM

4776


41.5


4117

41.7

413

39.6

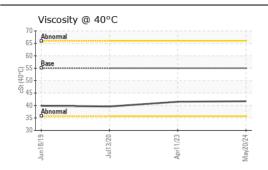

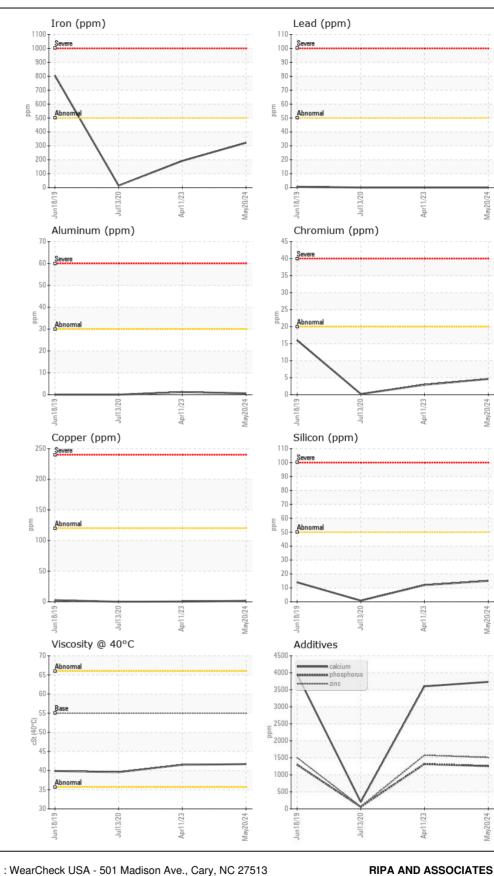

Diagnosed Unique Number : 11087955 : 20 Jun 2024 - Wes Davis Test Package : MOB 1 Contact: PM Services Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. PMServices@ripaconstruction.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Received

Tested

: 19 Jun 2024

: 20 Jun 2024

Laboratory

Sample No.

Lab Number : 06215091

: VCP447471

Contact/Location: PM Services ? - RIPTAM Page 2 of 2

av20/74

10/00/NEW

TAMPA, FL

US 33619

Т:

F:

10149 FISHER AVENUE