


WEAR CONTAMINATION **FLUID CONDITION**


NORMAL NORMAL NORMAL





Machine Id LIEBHERR LH50 145582-1216

Energy Recovery Cylinder {not provided} (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		LH0273650		
	Sample Date		Client Info		06 Jun 2024		
	Machine Age	hrs	Client Info		3371		
	Oil Age	hrs	Client Info		1000		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	~300	10		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		16		
	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m	>10	<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	2		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		<1		
	Tin	ppm	ASTM D5185m		<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION There is no indication of any contamination in the fluid.	Silicon	ppm	ASTM D5185m	>90	3		
	Potassium	ppm	ASTM D5185m	>20	2		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor		*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		1		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m		13		
	Barium	ppm	ASTM D5185m		<1		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		<1		
	Calcium	ppm	ASTM D5185m		2		
	Phosphorus	ppm	ASTM D5185m		489		
	Zinc	ppm	ASTM D5185m		5		
	Sulfur	ppm	ASTM D5185m		6133		
	Visc @ 40°C	cSt	ASTM D445		103		

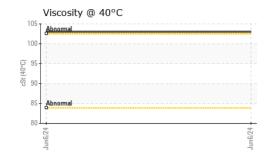

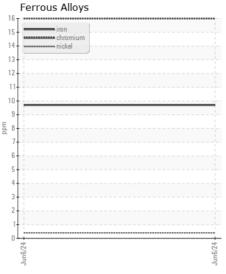

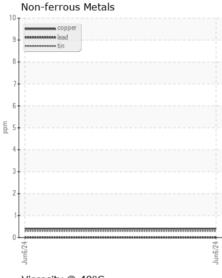

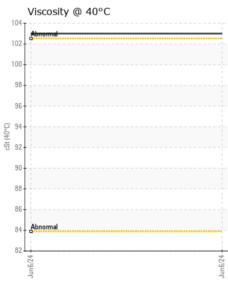



Certificate L2367

Laboratory Sample No.

: LH0273650 Lab Number : 06215161 Unique Number : 11088025 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 19 Jun 2024 **Tested** : 20 Jun 2024 Diagnosed

: 21 Jun 2024 - Sean Felton

10461 GRAND RIVER RD BRIGHTON, MI US 48116 Contact: MATT VISEL

RECO EQUIPMENT INC

MVISEL@RECOEQUIP.COM T: (810)299-1731

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)